

Volume

#

R0574

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

1

FIELD NOTES

OF THE

DEPENDENT RESURVEY

OF

A PORTION OF THE NORTH BOUNDARY

(FIRST STANDARD PARALLEL SOUTH)

AND

A PORTION OF THE SUBDIVISIONAL LINES

AND

THE SURVEY

OF A PORTION OF THE SUBDIVISION OF SECTION 3

OF

TOWNSHIP 6 SOUTH, RANGE 7 WEST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

Glen B. Hatch

Cadastral Surveyor

Under special instructions dated March 11, 19 64, which provided for the surveys
included under Group Number 473, approved March 12, 1964,
and assignment instructions dated March 13, 19 64.

Survey commenced March 23, 19 64

Survey completed April 8, 19 64

2

DEPT. OF THE INTERIOR
BUREAU OF LAND MGMT

1965 JUN 2 AM 10 00 .0

REC'D
STATE & LAND OFFICE
SALT LAKE CITY, UTAH

INDEX DIAGRAM

Township 6 South, Range 7 West,
4 2 2

6	5	4	11	10	9	1
			17	7		
7	8	10	10	11	12	
13	17	16	15	14	13	
19	20	21	22	23	24	
30	29	28	27	26	25	
31	32	33	34	35	36	

Township 6 South, Range 7 West

CHAINS

The north boundary (First Standard Parallel South) was surveyed by A. D. Ferron in 1871 and retraced by A. J. Stookey in 1899. A portion of the subdivisional lines was surveyed by Joseph Gorlinski in 1876. The completion survey was surveyed by A. J. Stookey in 1899. The east boundary of section 3 was retraced by A. J. Stookey in 1899.

The following field notes are those of the dependent resurvey of a portion of the north boundary (First Standard Parallel South) and a portion of the subdivision and the survey of a portion of the subdivision of section 3, Township 6 South, Range 7 West.

Before restoring the corners, the lines of the original survey were retraced and diligent search made for any evidence of the original corners, bearing trees, and other calls of the original field note record.

The rules of proportionate measurement were applied to ascertain the position of the lost corners, but not until exhausting every reasonable possibility of finding direct evidence for the control of each particular corner.

This survey was initiated at the request of the Chief, Lands and Minerals Division, and approved by memoranda dated February 12, 1964.

The survey was executed in accordance with the specifications as set forth in the Manual of Surveying Instructions, 1947, and special instructions dated March 11, 1964.

The direction of the lines of this survey were determined by reference to true meridians established on line by hour angle observations on Polaris and altitude observations on the sun. The lines were carried forward by sustained angulation being supplemented by other altitude observations on the sun.

The geographic position for the $\frac{1}{4}$ cor. of sections 2 and 11 is at latitude $40^{\circ}19'03''$ North and longitude $112^{\circ}36'02''$ West as scaled from U.S.G.S. topographic map "Deseret Peak".

The magnetic declination was read at several places throughout the survey and the average of these readings was found to be 17° East.

Dependent Resurvey of a Portion
of the
North Boundary (First Standard Parallel South)
Township 6 South, Range 7 West

Re-establishment of the Survey Executed
by A. D. Ferron in 1871 and the Retracement
Executed by A. J. Stookey in 1899

Beginning at the Standard $\frac{1}{4}$ sec. cor. of sec. 35, monumented with a limestone, $18 \times 10 \times 4$ ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

SC
T5S R7W
 $\frac{1}{4}$ S35
1964

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of

4

Dependent Resurvey of a Portion of the North Boundary
(First Standard Parallel South), T. 6 S., R. 7 W.

CHAINS

cor.; and bury original stone cor. alongside iron post.
Cor. is located on SW. slope.

Thence,

S. 89°52' W., along the S. bdy. sec. 35.

Over rolling and broken land facing W. and SW. through
medium dense juniper timber. Desc. 25 ft. over SW.
slope.

2.30 Wash, 15 lks. wide, 4 ft. deep, drains SW., desc. 175
ft. over SW. slope over series of small spurs and draws.

23.70 Wash, 15 lks. wide, 3 ft. deep, drains S. 70° W., con-
tinue descent.

26.10 Draw, 20 ft. deep, drains SW.

33.30 Small spur, slopes SW., desc. 50 ft. over NW. slope.

36.90 Draw, drains SW., asc. 15 ft. over SE. slope.

38.70 Spur, slopes SW., desc. 30 ft. over NW. slope.

39.60 Point for the closing cor. of secs. 2 and 3, T. 6 S.,
R. 7 W., hereinafter described.

40.30 The Standard cor. of secs. 34 and 35, monumented with
a limestone, 14x10x6 ins., set, mkd. and witnessed as
described in the official record.

From which

A leaning juniper, 14 ins. diam., bears S. 36°
W., 19 lks. dist., mkd. T6S R7W S3 BT.(Note:
no original record of this bearing tree.)

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins.
in the ground, and in a collar of stone to top, with
brass cap mkd.

SC

T5S R7W

S34 | S35

1964

From which

A juniper, 12 ins. diam., bears N. 72°30' E.,
16½ lks. dist., mkd. SC S35 BT.

A juniper, 6 ins. diam., bears N. 57° W., 42
lks. dist., mkd. SC S34 BT.

Bury original stone cor. alongside iron post.

Cor. is located on steep NW. slope.

Land, rolling and broken.

Soil, rocky.

Timber, medium dense juniper.

Undergrowth, sagebrush and buck brush.

S. 89°57' W., along the S. bdy. sec. 34.

Dependent Resurvey of a Portion of the North Boundary
(First Standard Parallel South), T. 6 S., R. 7 W.

CHAINS	
	Over rolling land through dense juniper timber. Desc. 50 ft. over NW. slope.
2.00	Draw, drains S., asc. 85 ft. over E. slope.
6.10	Spur, slopes S., desc. 50 ft. over SW. slope.
7.50	Transmission line, 2 strand, bears about N. 40° E. and S. 40° W.
10.00	Draw, drains SW., asc. 40 ft. over SE. slope.
13.85	Transmission line, 3 wire, bears about N. 40° E., and S. 40° W.
17.50	Spur, slopes SW., desc. 90 ft. over NW. slope.
18.20	Fence, 5 strand wire, bears N. 25° E. and S. 25° W.
23.50	Telephone line, 15 wire, bears NE. and SW.
24.20	Wash, in bottom of canyon, drains SW.
24.75	Center of state highway No. 215, bet. Clover and Dugway, bears N. 30° E. and S. 30° W., asc. 60 ft. over SE. slope.
31.00	Spur, slopes SW., desc. 50 ft. over broken SW. slope.
39.82	Point for N. $\frac{1}{4}$ sec. cor. sec. 3, T. 6 S., R. 7 W., hereinafter described.
39.96	The standard $\frac{1}{4}$ sec. cor. of sec. 34, monumented with a limestone, 12x10x5 ins., set, mkd. and witnessed as described in the official record.
	From which the original bearing trees
	A dead juniper, 15 ins. diam., bears N. 35° E., 13 lks. dist., dimly mkd. $\frac{1}{4}$ S BT.
	A juniper, 12 ins. diam., bears S. 5° E., 22 lks. dist., showing dim scribe marks.
	At the cor. point
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
	SC T5S R7W <u>$\frac{1}{4}$ S34</u> 1964
	From which
	A juniper, 15 ins. diam., bears N. 30° E., 22 lks. dist., mkd. SC $\frac{1}{4}$ S34 BT.
	Bury original stone cor. alongside iron post.
	S. 89°56' W., beginning new measurement.
	Continue over rolling land through dense juniper timber.
0.80	Low spur, slopes SW., desc. 50 ft. over NW. slope.

Dependent Resurvey of a Portion of the North Boundary
(First Standard Parallel South), T. 6 S., R. 7 W.

CHAINS	
5.30	Draw, drains SW., asc. 80 ft. over SE. slope.
10.30	Spur, slopes S., desc. 90 ft. over W. slope.
17.40	Draw, with unimproved dirt road in bottom, drains S. to SW., asc. 20 ft. over SE. slope.
20.50	Spur, slopes SW., desc. 90 ft. over SW. slope.
36.20	Draw, drains SW., asc. 20 ft. over SE. slope.
37.70	Small spur, slopes S., desc. 20 ft. over W. slope.
39.20	Draw, drains S., asc. 10 ft. over E. slope.
40.08	The standard cor. of secs. 33 and 34, monumented with a limestone, 22x9x6 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
	SC T5S R7W <u>S33 S34</u> 1964
	From which
	A juniper, 12 ins. diam., bears N. 44° W., 30½ lks. dist., mkd. SC T5S R7W S33 BT.
	Raise a mound of stone, 3 ft. base, 1½ ft. high, N. of cor.; and bury original stone cor. alongside iron post.
	Land, rolling. Soil, sandy and rocky. Timber, dense juniper. Undergrowth, sagebrush.
	S. 89°57' W., along the S. bdy. sec. 33.
	Over rolling land through dense juniper timber. Asc. 10 ft. over E. slope.
0.30	Point for closing cor. secs. 3 and 4, T. 6 S., R. 7 W., hereinafter described.
1.20	Low rise, slopes SW., desc. 80 ft. along general S. slope to ¼ cor.
12.20	Top of rise, slopes S.
19.50	Small draw, drains SW.
22.43	Fence, 4 strand wire, bears S. and extends N. 37 lks. thence W.; a water trough, 45 lks. long, extending through fence, bears S. about 10 lks.
22.65	Underground water pipe line, bears S.
22.95	Unimproved road, parallel to fence S. and curves W., thence along road.

Dependent Resurvey of a Portion of the North Boundary
(First Standard Parallel South), T. 6 S., R. 7 W.

CHAINS

40.22

The standard $\frac{1}{4}$ sec. cor. sec. 33, monumented with a limestone, 10x7x6 ins., set, mkd. and witnessed as described in the official record.

From which the original bearing trees

A juniper, 24 ins. diam., bears North, 33 lks. dist., mkd. $\frac{1}{4}$ S.

A juniper, 18 ins. diam., bears N. 45° W., 43 lks. dist., no mks. visible. (Record: N. 45° W., 40 lks. dist.)

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.

SC
T5S. R7W
 $\frac{1}{4}$ S33
1964

From which

A juniper, 24 ins. diam., bears N. 45° W., 43 lks. dist., mkd. SC $\frac{1}{4}$ S33 BT.

Raise a mound of stone, 3 ft. base, 1 $\frac{1}{2}$ ft. high, N. of cor.; and bury original stone cor. alongside iron post.

Cor. located on gentle S. slope under E.-W. fence line.

Land, rolling, general S. to SW. slope.

Soil, sandy and rocky.

Timber, dense juniper.

Undergrowth, sagebrush.

Dependent Resurvey of a Portion
of the
Subdivision, T. 6 S., R. 7 W.

Re-establishment of the Survey Executed
by Joseph Gorkinski in 1876

The cor. of secs. 3, 4, 9 and 10, reported as being in place and tied to at the time of the highway survey in 1942, was later destroyed during construction of the highway. The same is restored from ties made to the original $\frac{1}{4}$ sec. cor. of secs. 8 and 9 from the highway survey in the following manner.

The $\frac{1}{4}$ sec. cor. of secs. 8 and 9, monumented with a blue limestone, 12x6x4 ins., set, mkd. and witnessed as described in the official record, and in E.-W. fence line.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 26 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T6S R7W
 $\frac{1}{4}$
S8 S9
1964

Dependent Resurvey of a Portion of the Subdivision, T. 6 S., R. 7 W.

CHAINS

Bury original stone cor. alongside iron post.

Thence,

S. 89°24' E., through sec. 9.

Over nearly level land, along fence line with unimproved farm road along N. side.

17.80 Wash, 20 lks. wide, 6 ft. deep, drains SW.

22.67 Telephone line, 15 wire, bears about N. 40° E. and S. 40° W.

43.35 Cattle Guard, bears N. 50 lks. dist.

44.22 Transmission line parallels highway.

45.31 Fence, turns S. 39°51' W., parallel to highway. End E.-W. fence line.

46.258 Intersect state highway No. 215, at intersection of highway and fences to E. and W. Turn angle from $\frac{1}{4}$ cor. 8 and 9 to right of 129°15'. This point equals highway station 965+05.7.

Thence,

N. 39°51' E., along centerline of highway, beginning new measurement.

51.989 Point for station 999+37.0, turn 90° to right for 9.5 ft., to record position for cor. of secs. 3, 4, 9 and 10, and identical with the southwest cor. of lot 38, sec. 3.

At the cor. point, which falls in oiled highway

Set a cadmium cap mkd.

$$\frac{4}{9} \frac{3}{10}$$

From which

A juniper, 8 ins. diam., bears S. 3°20' W., 135½ lks. dist., mkd. S9 BT.

A juniper, 6 ins. diam., bears N. 56° W., 115 lks. dist., mkd. S4 BT.

An iron post, 30 ins. long, 2½ ins. diam., 26 ins. in the ground, for a reference monument, bears S. 89°46' E., 50 ft. dist., with brass cap mkd. $\frac{S3}{S10}$ RM 50 FT 1964, and an arrow pointing to true cor.

An iron post, 30 ins. long, 2½ ins. diam., 26 ins. in the ground, for a reference monument, bears S. 45° E., 32.5 ft. dist., with brass cap mkd. S10 RM 32.5 FT 1964, and an arrow pointing to the true cor.

An iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, for a reference monument, bears N. 45° W., 56.7 ft. dist., with brass cap mkd. S4 RM 56.7 FT 1964, and an arrow pointing to the true cor.

Dependent Resurvey of a Portion of the Subdivision, T. 6 S., R. 7 W.

CHAINS

The $\frac{1}{4}$ sec. cor. of secs. 9 and 10, bears S. $0^{\circ}20'$ E., 40.22 chs. dist., at cor. of fences from S. and W., which is accepted as being a perpetuation of the original cor. point according to adjacent land owners.

At the cor. point:

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.

T6S R7W

$\frac{1}{4}$

S9 | S10

1964

Deposit glass at base of iron post.

Land, nearly level farm land.

Soil, sandy.

Timber, scattered juniper.

Undergrowth, sagebrush.

From the $\frac{1}{4}$ sec. cor. of secs. 2 and 11, monumented with a limestone, 10x10x4 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T6S. R7W

$\frac{1}{4}$ $\frac{S2}{S11}$

1964

From which

A juniper, 8 ins. diam., bears S. 66° W., $23\frac{1}{2}$ lks. dist., mkd. $\frac{1}{4}$ S11 BT.

A juniper, 6 ins. diam., bears N. $17^{\circ}45'$ W., 55 lks. dist., mkd. $\frac{1}{4}$ S2 BT.

Cor. is located on gentle SW. slope.

Thence,

N. $89^{\circ}38'$ W., bet. secs. 2 and 11.

Over rolling land sloping SW., through dense juniper timber. Desc. 215 ft. over general SW. slope.

10.10 Shallow wash, drains S. 70° W.

16.10 Wash, 10 lks. wide, 3 ft. deep, drains S. 60° W.

18.60 Wash, 10 lks. wide, 3 ft. deep, drains S. 60° W.

26.00 Shallow wash, drains SW.

27.10 Wash, 15 lks. wide, 6 ft. deep, drains SW.

40.10 The cor. of secs. 2, 3, 10 and 11, monumented with a limestone, 12x11x6 ins., set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the Subdivision, T. 4 S., R. 7 W.

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T6S R7W
 $\frac{S3}{S10} \frac{S2}{S11}$
 1964

From which

A juniper, 6 ins. diam., bears N. 55° E.,
 40 $\frac{1}{2}$ lks. dist., mkd. S2 BT.

A juniper, 7 ins. diam., bears S. 58° E., 27
 lks. dist., mkd. S11 BT.

A juniper, 6 ins. diam., bears S. 69° W., 47 lks.
 dist., mkd. S10 BT.

A juniper, 6 ins. diam., bears N. 43° W., 66 $\frac{1}{2}$
 lks. dist., mkd. S3 BT.

Bury original stone cor. alongside iron post.

Land, rolling, sloping SW.

Soil, rocky clay.

Timber, dense, scrubby juniper.

Undergrowth, sagebrush.

N. $89^{\circ}46'$ W., bet. secs. 3 and 10.

Over rolling land sloping SW., through dense, scrubby
 juniper. Desc. 170 ft. over SW. slope.

35.00 Shallow draw, drains SW.

38.60 Cor. of fences bearing N. $10^{\circ}15'$ W. and N. $89^{\circ}36'$ W.,
bears 13 lks. S. of line.40.16 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 10 at propor-
tionate dist., and identical with the southeast cor. of
lot 33; there is no remaining evidence of the original
cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
 in the ground, and in a collar of stone to top, with
 brass cap mkd.

T6S R7W
 $\frac{1}{4} \frac{S3}{S10}$
 1964

From which

A juniper, 8 ins. diam., bears S. $23^{\circ}15'$ W.,
 81 lks. dist., mkd. $\frac{1}{4}$ S10 BT.

A juniper, 10 ins. diam., bears N. $74^{\circ}45'$ E.,
 75 lks. dist., mkd. $\frac{1}{4}$ S3 BT.

Note: at each lot corner supplementary to the T-iron
 stake or cor. monument, there are 2x2x24 ins. wood
 stakes set 15 ins. in the ground and scribed with the

Dependent Resurvey of a Portion of the Subdivision, T. 6 S., R. 7 W.

CHAINS	lot number in which it stands. No further reference is made of these stakes in the following notes.
45.18	<p>Point for the cor. of lots 33 and 34, of sec. 3.</p> <p>Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.</p> <p style="text-align: center;"><u>L34 L33</u></p> <p>Continue over nearly level land through scattered juniper timber.</p>
49.35	Wash, 30 lks. wide, 6 ft. deep, drains SW.
49.70	Graded road, 15 lks. N. of line, bears W. and NE.
50.20	<p>Point for the southwest cor. of lot 34, sec. 3, and identical with the E-W. 1/64 sec. cor. of secs. 3 and 10.</p> <p>Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.</p> <p style="text-align: center;"><u>L34</u></p>
60.24	<p>Point for the W. 1/16 sec. cor. of secs. 3 and 10 at proportionate dist. and identical with the southeast cor. of lot 35.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T6S R7W W1/16 $\frac{S3}{S10}$ 1964</p> <p>From which</p> <p style="padding-left: 40px;">A juniper, 8 ins. diam., bears S. 37°45' W., 34½ lks. dist., mkd. W1/16 BT.</p> <p>Continue along graded dirt road, bears W. and N., with fence along S. side.</p>
65.26	<p>Point for the cor. of lots 35 and 36, sec. 3.</p> <p>Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.</p> <p style="text-align: center;"><u>L36 L35</u></p>
70.28	<p>Point for the cor. of lots 36 and 37, sec. 3, and identical with the W-W. 1/64 sec. cor. of secs. 3 and 10.</p> <p>Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.</p> <p style="text-align: center;"><u>L37 L36</u></p>
75.30	<p>Point for the cor. of lots 37 and 38, sec. 3.</p> <p>Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.</p> <p style="text-align: center;"><u>L38 L37</u></p>
79.71	Cor. of fences from S. 89°36' E. and S. 39°51' W.

Dependent Resurvey of a Portion of the Subdivision, T. 6 S., R. 7 W.

CHAINS	DIAM.
80.32	<p>The cor. of secs. 3, 4, 9 and 10.</p> <p>Land, rolling E. portion; nearly level W. portion. Soil, rocky clay E. portion; sandy clay W. portion. Timber, dense juniper E. portion; scattered juniper W. portion. Undergrowth, sagebrush.</p>
	<p>From the cor. of secs. 2, 3, 10 and 11, hereinbefore described.</p> <p>N. 0°23' W., bet. secs. 2 and 3.</p> <p>Over rolling land sloping SW. through dense scrub juniper timber. Asc. 30 ft. over gently rolling SW. slope to $\frac{1}{2}$ cor.</p> <p>4.50 Wash, 20 lks. wide, 2 ft. deep, drains W.</p> <p>28.00 Shallow draw, drains W.</p> <p>32.70 Draw, 25 ft. deep, drains SW.</p> <p>40.17 The $\frac{1}{2}$ sec. cor. of secs. 2 and 3, monumented with a limestone, 15x8x6 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 20 ins. in the ground to bedrock, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T6S R7W $\frac{1}{2}$ S3 S2 1964</p> <p>From which</p> <p style="padding-left: 40px;">A juniper, 4 ins. diam., bears N. 77° E., 34 lks. dist., mkd. $\frac{1}{2}$ S2 BT.</p> <p style="padding-left: 40px;">A juniper, 6 ins. diam., bears S. 85° W., 39 lks. dist., mkd. $\frac{1}{2}$ S3 BT.</p> <p>Bury original stone cor. alongside iron post.</p> <p style="text-align: center;">—————</p> <p>N. 0°19' E., beginning new measurement.</p> <p>Asc. 115 ft. over gently rolling SW. slope to closing cor.</p>
1.50	Draw, 30 ft. deep, drains W.
19.00	Small draw, 10 ft. deep, drains SW.
27.50	Draw, 20 ft. deep, drains SW.
38.00	Draw, 25 ft. deep, drains SW.
41.00	Spur, slopes SW.
41.52	<p>Intersect the First Standard Parallel South, and point for the closing cor. of secs. 2 and 3 at proportionate dist.; there is no remaining evidence of the original cor.</p>

Dependent Resurvey of a Portion of the Subdivision, T. 6 S., R. 7 W.

CHAINS

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T5S R7W

S35

S3|S2

CC

T6S R7W

1964

From which

A juniper, 7 ins. diam., bears S. 77° E.,
28 lks. dist., mkd. CC S2 BT.

The standard cor. of secs. 34 and 35, T. 5 S.,
R. 6 W., hereinbefore described, bears S. 89°
52' W. 0.70 chs. dist.

Land, rolling, with general SW. slope.
Soil, rocky, sandy clay.
Timber, medium dense juniper.
Undergrowth, sagebrush.

From the cor. of secs. 3, 4, 9 and 10.

N. 0°28' W., bet. secs. 3 and 4.

Over gently rolling land sloping SW., through medium
dense juniper timber. Asc. 85 ft. to ½ cor.

0.21 Center of state highway No. 215, bears N. 39°51' E.
and S. 39°51' W.

2.55 Transmission line, 3 wire, bears about N. 40° E. and
S. 40° W.

4.958 Point for the cor. of lots 31 and 38, sec. 3.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the
ground, with cadmium plated cap mkd.

L31L38

9.916 Point for the cor. of lots 30 and 31, sec. 3, and iden-
tical with the S-S 1/64 sec. cor. of secs. 3 and 4.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the
ground, with cadmium plated cap mkd.

L30L31

12.46 Telephone line, 15 wire, bears N. 42°30' E. and S. 42°
30' W.

14.76 Cor. of fences from N. and E., bears W. 6 lks.; thence
along E. side of fence.

14.874 Point for the NW. cor. of lot 30, sec. 3.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the
ground, with cadmium plated cap mkd.

L30

Dependent Resurvey of a Portion of the Subdivision, T. 6 S., R. 7 W.

CHAINS

- 19.75 Fence, 4 strand wire, bears E. and extends W. 6 lks. to N.-S. fence.
- 19.832 Point for the S. 1/16 sec. cor. of secs. 3 and 4, at proportionate dist.
- Set an iron post, 36 ins. long, 1 in. diam., 34 ins. in the ground, with brass cap mkd.
- T6S R7W
S1/16
S4|S3
1964
- From which
- A juniper, 20 ins. diam., bears N. 15° E.,
8 lks. dist. to face. Tree not mkd.
- 24.75 Fence, bears E. and extends W. 5 lks. to N.-S. fence.
- 29.74 Fence, bears E. and extends W. 4 lks. to N.-S. fence.
- 29.748 Point for the N.-S. 1/64 cor. of secs. 3 and 4; not monumented.
- 32.53 Fence, bears E. and extends W. 10 lks. to N.-S. fence.
- 34.706 Point for the southwest cor. of lot 12, sec. 3.
- Set 1 in. T-iron stake, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.
- L12
- 34.77 Fence, bears E. and extends W. 15 lks. to cor., thence S. End N.-S. fence line.
- 39.664 The ½ sec. cor. of secs. 3 and 4, and identical with the NW. cor. of lot 12, monumented with a limestone, 10x8x4 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, 2½ ins. diam., 26 ins. in the ground, with brass cap mkd.
- T6S R7W
½
S4|S3
1964
- From which
- A juniper, 5 ins. diam., bears N. 44° E.,
70 lks. dist., mkd. ½ S3 BT.
- A juniper, 6 ins. diam., bears S. 24° W.,
30½ lks. dist., mkd. ½ S4 BT.
- Bury original stone cor. alongside iron post.
-
- N. 0°36' W., beginning new measurement.
- Asc. 55 ft. over general SW. slope through dense juniper timber.
- 17.50 Spur, slopes SW., desc. 30 ft. over NW. slope.
- 21.05 Trail road, bears irregularly NE. and SW.

Dependent Resurvey of a Portion of the Subdivision, T. 6 S., R. 7 W.

CHAINS

21.65 Wash, 20 lks. wide, 10 ft. deep, drains S. 75° W., asc. 70 ft. over general SW. slope.

41.61 Intersect the First Standard Parallel South and point for the closing cor. of secs. 3 and 4 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 26 ins. in the ground, with brass cap mkd.

T5S R7W

S33

S4 | S3

CC

T6S R7W

1964

From which

A juniper, 16 ins. diam., bears S. 37° E., 55½ lks. dist., mkd. T6S R7W CC S3 BT.

A juniper, 6 ins. diam., bears S. 57° W., 13 lks. dist., mkd. T6S R7W CC S4 BT.

The standard cor. of secs. 33 and 34, T. 5 S., R. 7 W., hereinbefore described, bears N. 89° 57' E., 0.30 chs. dist.

Land, rolling, with general SW. drainage.

Soil, rocky, sandy clay.

Timber, medium dense juniper.

Undergrowth, sagebrush.

Point for the N. ¼ sec. cor. of sec. 3, on the First Standard Parallel South, and midpoint bet. the closing cor. of secs. 2 and 3 and the closing cor. of sec. 3 and 4.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T5S R7W

¼ S3

T6S R7W

1964

From which

A juniper, 8 ins. diam., bears S. 11°30' E., 35 lks. dist., mkd. ¼ S3 BT.

The standard ¼ cor. of sec. 34, T. 5 S., R. 7 W., hereinbefore described, bears S. 89° 57' W., 0.14 chs. dist.

Survey of a Portion of the Subdivision,
sec. 3, T. 6 S., R. 7 W.

From the ¼ sec. cor. of secs. 3 and 10.

N. 0°16' W., on the N. and S. center line of sec. 3.

Over rolling land through medium dense juniper timber.

Asc. 105 ft. over gentle SW. slope to C.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS

4.99 Point for the northeast cor. of lot 33.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L33

6.75 Wash, 30 lks. wide, 6 ft. deep, drains S. 70° W.

8.85 Fence, 4 strand wire, bears N. 10° W. and S. 10° E.

17.75 Wash, 30 lks. wide, 3 ft. deep, drains S. 75° W.

19.96 Point for the center south 1/16 sec. cor. of sec. 3 at midpoint bet. the C½ sec. cor. of sec. 3, and the ¼ sec. cor. of secs. 3 and 10.

Set an iron post, 30 ins. long, 2½ ins. diam., 28 ins. in the ground, with brass cap mkd.

T6S R7W

C

S1/16|S3

C

1964

From which

A juniper, 8 ins. diam., bears S. 58° W.,
10½ lks. dist., mkd. BT only.

Raise a mound of stone, 2½ ft. base, 1½ ft. high, W. or cor.

24.95 Point for the cor. of lots 19 and 28.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L19
L28

29.94 Point for the cor. of lots 18 and 19.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L18
L19

34.93 Point for the cor. of lots 5 and 18.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L5
L18

35.95 Wash, 10 lks. wide, 2 ft. deep, drains SW.

39.92 Intersect E. and W. center line sec. 3.

Point for the center ¼ sec. cor. of sec. 3, and identical with the northeast cor. of lot 5.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS

T6S R7W

C $\frac{1}{2}$

S3

1964

From which

A juniper, 6 ins. diam., bears N. 57° E.,
75 lks. dist., mkd. C $\frac{1}{2}$ S3 BT.

A juniper, 5 ins. diam., bears S. 72° E.,
40 lks. dist., mkd. BT only.

Asc. 80 ft. over SE. slope through dense juniper timber.

43.27 Transmission line, bears about N. 40° E. and S. 40° W.

50.90 Transmission line, bears about N. 40° E. and S. 40° W.

51.90 Spur, slopes SW., desc. 80 ft. over NW. slope.

54.90 Telephone line, 15 wire, bears NE. and SW.

60.90 Wash, in bottom of canyon, drains irregularly SW., asc.
120 ft. over SE. slope.

62.40 Center of state highway No. 215, bears irregularly NE.
and SW.

75.90 Spur, slopes SW., desc. 40 ft. over NW. slope.

78.90 Small, draw, drains SW., asc. 20 ft. over SE. slope.

81.48 Intersect the First Standard Parallel South at the N.
 $\frac{1}{2}$ sec. cor. of sec. 3, hereinbefore described.

Land, rolling, with general SW. drainage.

Soil, rocky, sandy clay.

Timber, dense juniper.

Undergrowth, sagebrush.

From the $\frac{1}{2}$ sec. cor. of secs. 2 and 3, hereinbefore
described,

S. 89°53' W., on the E. and W. center line of sec. 3.

Over rolling land through dense juniper timber. Desc.
50 ft. over NW. slope.

3.25 Small draw, drains SW., asc. 25 ft. over SE. slope.

5.00 Small spur, slopes SW., desc. 55 ft. over NW. slope.

14.35 Wash, 15 lks. wide, 1 ft. deep, drains S. 30° W., asc.
10 ft. over gentle SE. slope.

19.35 Small spur, slopes SW., desc. 45 ft. over NW. slope.

22.90 Small draw, drains SW., asc. 40 ft. over SE. slope.

26.60 Spur, slopes SW., desc. 40 ft. over gentle NW. slope.

40.065 The center $\frac{1}{2}$ sec. cor. of sec. 3, hereinbefore des-
cribed.

Asc. 20 ft. over SE. slope.

42.92 Transmission line, bears about N. 40° E. and S. 40° W.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS

45.103 Point for the cor. of lots 5 and 6.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L6|L5

45.70 Fence, 4 strand wire, bears N. 10° W. and S. 10° E.

49.22 Transmission line, 3 wire, bears about N. 40° E. and South 40° W., desc. 60 ft. over NW. slope.

50.141 Point for the cor. of lots 6 and 7.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L7|L6

53.50 Wash, in bottom of canyon, drains SW. from NW.

54.61 Center of state highway No. 215, bears S. 30°03' W. and curves NE.

55.12 Telephone line, 15 wire, bears NE. and SW.

55.179 Point for the cor. of lots 7 and 8.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L8|L7

Asc. 50 ft. over SE. slope.

59.40 Spur, slopes SW., desc. 30 ft. over gentle NW. slope.

60.217 Point for the center west 1/16 sec. cor. of sec. 3 and identical with lot corners 8 and 9.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T6S R7W

W1/16

C C

S3

1964

65.255 Point for the cor. of lots 9 and 10.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L10|L9

70.293 Point for the cor. of lots 10 and 11.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L11|L10

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS

75.331 Point for the cor. of lots 11 and 12.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L12|L11

75.40 Desc. 35 ft. over W. slope.

80.369 The $\frac{1}{4}$ sec. cor. of secs. 3 and 4 and identical with the northwest cor. of lot 12, hereinbefore described.

Land, rolling, with general SW. drainage.

Soil, rocky clay.

Timber, dense juniper.

Undergrowth, sagebrush.

From the west $\frac{1}{16}$ sec. cor. of secs. 3 and 10.

N. $0^{\circ}22'$ W., on the N. and S. center line of the SW $\frac{1}{4}$ of sec. 3.

Over gently rolling land through dense juniper timber. Asc. 40 ft. along E. side of dirt road over general SW. slope to center west $\frac{1}{16}$ sec. cor. sec. 3.

4.974 Point for the northeast cor. of lot 35.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L35

9.90 Intersection of dirt roads from N., S., E. and W., continue along road.

15.00 Intersection of dirt roads from N., S., E. and W., continue along road.

19.80 Road curves NW.

19.896 Intersect the E. and W. center line of the SW $\frac{1}{4}$ of sec. 3.

Point for the southwest $\frac{1}{16}$ sec. cor. of sec. 3 and identical with the southeast cor. of lot 24 and the southwest cor. of lot 25.

Set an iron post, 36 ins. long, 1 in. diam., 36 ins. in the ground, with glass around iron post, 6 ins. below ground, and brass cap mkd.

SW $\frac{1}{16}$ S3
1964

From which

A juniper, 10 ins. diam., bears N. $4^{\circ}15'$ E.,
43 $\frac{1}{2}$ lks. dist., mkd. SW $\frac{1}{16}$ S3 BT.

A juniper, 5 ins. diam., bears N. $82^{\circ}45'$ W.,
67 lks. dist., mkd. BT only.

20.05 Dirt road, bears E. and W.

22.55 Wash, 20 lks. wide, 3 ft. deep, drains SW.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS

- 24.12 Trail road, bears SW. and about 5.00 chs. NE. to end.
 24.874 Point for the cor. of lots 21, 24 and 25.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L21
L24 | L25

- 26.35 Transmission line, bears about N. 40° E. and S. 40° W.
 29.852 Point for the cor. of lots 14, 15 and 21.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L14 | L15
L21

- 30.85 Center of state highway No. 215, bears N. 36°01' E. and S. 36°01' W.

- 31.90 Wash, 20 lks. wide, 4 ft. deep, drains SW., asc. 60 ft. over SE. slope.

- 34.15 Telephone line, 15 wire bears NE. and SW.

- 34.83 Point for the cor. of lots 8, 9, 14 and 15.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L9 | L8
L14 | L15

- 39.808 The center west 1/16 sec. cor. sec. 3, hereinbefore described.

From the center south 1/16 sec. cor. of sec. 3.

N. 89°56'30" W., on the E. and W. center line of the SW $\frac{1}{4}$ sec. 3.

Over gently rolling land through dense timber.

- 2.03 Fence, 4 strand wire, bears N. 10° W. and S. 10° E.

- 5.029 Point for the cor. of lots 27 and 28.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L27 | L28

- 10.058 Point for the cor. of lots 26 and 27.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L26 | L27

- 10.40 Enter road, bears W.

- 15.087 Point for the cor. of lots 25 and 26.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS

L25|L26

- 19.68 Transmission line, 2 wire, bears about N. 40° E. and S. 40° W.
- 20.116 The southwest 1/16 sec. cor., hereinbefore described. Leave road.
- 21.45 Small gully, drains SW.
- 24.30 Wash, 20 lks. wide, 4 ft. deep, drains S.
- 25.146 Point for the cor. of lots 23 and 24.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L23|L24

- 25.33 Center of state highway No. 215, bears N. 16°58' E. and S. 16°58' W.
- 25.71 Transmission line, bears about N. 40° E. and S. 40° W.
- 30.10 Road, bears N. and S.
- 30.176 Point for the southwest cor. of lot 23.

Set 1 in. T-iron post. 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L23

- 30.27 Fence, net wire, bears N. and S., enter private land.
- 32.39 Telephone line, 15 wire, bears NE. and SW.
- 40.236 The south 1/16 sec. cor. of secs. 3 and 4, hereinbefore described.

From the southwest cor. of lot 34.

N. 0°19' W., along the W. bdy. lot 34.

Over gently rolling land through dense juniper timber.

- 0.15 Road, bears W.

- 4.982 Point for the northwest cor. of lot 34.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L34

From the cor. of lots 26 and 27.

N. 0°19' W., on the N. and S. center line of the NE $\frac{1}{4}$ SW $\frac{1}{4}$ sec. 3.

Over rolling land through medium dense juniper timber. Asc. 60 ft. over general SW. slope.

- 4.984 Point for the cor. of lots 20, 26 and 27.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS	
	$\begin{array}{c} \text{L20} \\ \hline \text{L26} \mid \text{E27} \end{array}$
9.968	Intersect the E.-W. center line of the NE $\frac{1}{4}$ SW $\frac{1}{4}$ sec. 3. Point for the cor. of lots 16, 17 and 20, and identical with the NE.-SW. 1/64 sec. cor. Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.
	$\begin{array}{c} \text{L16} \mid \text{L17} \\ \hline \text{L20} \end{array}$
10.50	Wash, drains SW.
11.42	Transmission line, bears about N. 40° E. and S. 40° W.
14.952	Point for the cor. of lots 6, 7, 16 and 17. Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.
	$\begin{array}{c} \text{L7} \mid \text{L6} \\ \hline \text{L16} \mid \text{L17} \end{array}$
18.85	Transmission line, 3 wire, bears about N. 40° E. and S. 40° W.
19.936	The cor. of lots 6 and 7, hereinbefore described.
	<p>From the cor. of lots 18 and 19.</p> <p>S. 89°58'15" W., on the E. and W. center line NE$\frac{1}{4}$ SW$\frac{1}{4}$ sec. 3.</p> <p>Over gently rolling land through medium dense juniper timber, Desc. 55 ft. over general SW. slope.</p>
4.03	Fence, 4 strand wire, bears N. 10° W. and S. 10° E.
5.034	Point for the cor. of lots 17, 18, 19 and 20. Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.
	$\begin{array}{c} \text{L17} \mid \text{L18} \\ \hline \text{L20} \mid \text{L19} \end{array}$
10.068	The cor. of lots 16, 17 and 20, hereinbefore described.
11.00	Wash, drains SW.
11.27	Transmission line, bears about N. 40° E. and S. 40° W.
15.102	Point for the cor. of lots 15 and 16. Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.
	$\text{L15} \mid \text{L16}$
17.18	Transmission line, bears about N. 40° E. and S. 40° W.
20.136	The cor. of lots 14, 15 and 21, hereinbefore described.
	From the cor. of lots 36 and 37.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS

N. 0°25' W., on the N. and S. center line of the SW $\frac{1}{4}$ SW $\frac{1}{4}$ sec. 3.

Over gently rolling land through medium dense juniper timber.

0.15 Road, bears E. and W.

4.966 Point for the cor. of lots 32, 36 and 37.

Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd.

L32
L37 | L36

7.44 Transmission line, bears about N. 40° E. and S. 40° W.

9.80 Road, bears E. and W.

9.932 Point for the cor. of lots 29 and 32, falls on N. edge of road.

Set 1 in. T-iron post, 24 ins. long, 12 ins. below surface of road, with cadmium plated cap mkd.

L29
L32 |

From which

A reference nail in face of juniper, 6 ins. diam., bears N. 9°38' E., 16.1 ft. dist.

A reference nail in face of juniper, 7 ins. diam., bears S. 10°56' E., 38.1 ft. dist.

A reference nail in face of juniper, 12 ins. diam., bears N. 39°40' W., 27 ft. dist.

12.06 Center of state highway No. 215, bears S. 39°51' W. and N. 39°51' E., thence enter dirt road, bears N.

14.43 Transmission line, bears about N. 40° E. and S. 40° W.

14.898 Point for the northeast cor. of lot 29, falls in N. and S. road.

Set 1 in. T-iron post, 24 ins. long, 12 ins. below surface of road, with cadmium plated cap mkd.

L29 |

From which

A reference nail in power pole, bears SW., 57 ft. dist.

19.864 The southwest cor. of lot 23, hereinbefore described.

N. 0°25' W., on the N. and S. center line of the NW $\frac{1}{4}$ SW $\frac{1}{4}$ sec. 3.

Over gently rolling land through medium dense juniper timber. Along N. and S. dirt road.

3.50 Telephone line, 15 wire, bears NE. and SW.

Survey of a Portion of the Subdivision, sec. 3, T. 6 S., R. 7 W.

CHAINS 4.968	Point for the cor. of lots 22 and 23, falls on W. side of road. Set 1 in. T-iron post, 24 ins. long, 22 ins. in the ground, with cadmium plated cap mkd. <u>L22</u> <u>L23</u>
9.00	End N. and S. road.
9.936	Intersect the E.-W. center line of the NW $\frac{1}{4}$ SW $\frac{1}{4}$ of sec. 3. Point for the cor. of lots 13 and 22, and identical with the NW.-SW. 1/64 sec. cor. Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd. <u>L13</u> <u>L22</u>
14.904	Point for the cor. of lots 10, 11 and 13. Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd. <u>L11</u> <u>L10</u> <u>L13</u>
19.872	The cor. of lots 10 and 11, hereinbefore described.
	From the cor. of lots 14, 15 and 21. S. 89°58'15" W., on the E. and W. center line of the NW $\frac{1}{4}$ SW $\frac{1}{4}$ sec. 3. Over gently rolling land through medium dense juniper timber.
0.92	Center of state Highway No. 215, bears N. 36°01' E. and S. 36°01' W.
4.15	Telephone line, 15 wire, bears NE. and SW.
5.034	Point for the cor. of lots 13, 14, 21 and 22. Set 1 in. T-iron post, 24 ins. long, 20 ins. in the ground, with cadmium plated cap mkd. <u>L13</u> <u>L14</u> <u>L22</u> <u>L21</u>
10.068	The cor. of lots 13 and 22, hereinbefore described, thence over private land.
20.136	Intersect the W. boundary of sec. 3, at the point for the N.-S. 1/64 cor. of secs. 3 and 4.
	Survey of Highway 215, through the Southwest $\frac{1}{4}$ of section 3 for alignment only
	From a point 0.21 chs. N. of secs. cor. 3, 4, 9 and 10. Thence, along the center line of road. N. 39°51' E., 21.53 chs. At this point, the center line of the highway is 25 ft. to left.

Survey of Highway 215, through the Southwest $\frac{1}{4}$ of section 3
for alignment only

CHAINS

N. $16^{\circ}58'$ E., 10.57 chs. At this point, the center line of the highway is 11.4 ft. to the right.

N. $36^{\circ}01'$ E., 9.49 chs. At this point, the center line of the highway is 2.5 ft. to the left.

From this same point, a U.S.G.S. bench mark, bears N. $23^{\circ}57'$ W., 51.6 ft. dist., monumented with a brass tablet set in cement block, 8x8 ins., 6 ins. above ground, with brass tablet mkd.

T 62

—+—

1934

N. $30^{\circ}03'$ E., 6.00 chs. Intersect the E. and W. center line of sec. 3. End of road survey at a point 0.569 chs. N. $89^{\circ}53'$ E. of lot cor. 7 and 8.

GENERAL DESCRIPTION

Section 3, Township 6 South, Range 7 West, is located about 10 miles northeast of Dugway Proving Grounds. The highway from Dugway to Clover, enters section 3 at the southwest corner and bears irregularly northeast through the section. Section 3 is rolling land covered with a heavy growth of juniper timber and sagebrush undergrowth. The soil is rocky, sandy gravel. The area drains in a southwesterly direction by numerous washes draining into the main wash alongside the highway. Section 3 was subdivided to establish lots for the future townsite of "Terra", which will be located in the southwest $\frac{1}{4}$. There are several homes in the area already built and several more under construction. The only water supply noted was several small wells on the private property.

CHAINS

FIELD ASSISTANTS

[illegible]

CERTIFICATE OF SURVEY

I, Glen B. Hatch, HEREBY CERTIFY upon honor that,
in pursuance of special instructions bearing date of the 11 day of March, 19 64,
I have dependently resurveyed a portion of the north boundary (First Standard
Parallel South) and a portion of the subdivisional lines and surveyed a portion
of the subdivision of section 3, Township 6 South, Range 7 West

of the Salt Lake Meridian, in the State of Utah, which
are represented in the foregoing field notes as having been executed by me and under my direction;
and that said survey has been made in strict conformity with said special instructions, the Manual
of Instructions for the Survey of the Public Lands of the United States, and in specific manner
described in the foregoing field notes.

(Date)

1/21/65
(Date)

(Cadastral Surveyor)

Glen B. Hatch
(Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL
Date JAN 25 1965

BUREAU OF LAND MANAGEMENT,
Washington, D. C.

The foregoing field notes of the dependent resurvey of a portion of the north
boundary (First Standard Parallel South) and a portion of the subdivisional
lines and the survey of a portion of the subdivision of section 3, Township
6 South, Range 7 West.

executed by Glen B. Hatch, Cadastral Surveyor
having been critically examined and found correct, are hereby approved.

APR 6 1965
(Date)

[Signature]
(Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in
_____, is a true copy of the original field notes.

(Date)

(Chief, Division of Engineering)

Blank

Page

Blank

Page

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

31

FIELD NOTES

OF THE

DEPENDENT RESURVEY

OF THE

FRACTIONAL WEST 2 MILES

OF THE

NORTH BOUNDARY

AND

SECTIONS 3 AND 4

OF

TOWNSHIP 22 SOUTH, RANGE 2½ WEST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

GERALD W. HOCHSTRASSER, SURVEYING TECHNICIAN, UNDER THE SUPERVISION OF

GLEN B. HATCH, CADASTRAL SURVEYOR

Under special instructions dated MAY 15, 19 63, which provided for the surveys
included under Group Number 465, approved May 16, 1963,
and assignment instructions dated June 4, 19 63.

Survey commenced July 16, 19 63

Survey completed August 20, 19 63

0.5 2 00.0

Township 22 SOUTH, Range 2½ WEST,

		4	2		
6	5	4	7 3 5	2	1
		9	6		
7	8	9	10	11	12
13	17	16	15	14	13
19	20	21	22	23	24
30	29	28	27	26	25
21	22	23	24	25	26

Dependent Resurvey of a Portion of Township 22 South, Range 2½ West

CHAINS

The north, east and south boundaries and the subdivisional lines were surveyed by John T. Brecken in 1896, and the record appears in the field notes of T. 22 S., R. 2½ W. The west boundary was surveyed by John T. Brecken in 1896 and concurrently resurveyed by Glen B. Hatch in 1963 under Group 465, Utah, and the record appears in the field notes of T. 22 S., R. 3 W.

fractional

The following field notes are those of the dependent resurvey of the west 2 miles of the north boundary and of sections 3 and 4 of T. 22 S., R. 2½ W.

The survey was executed with a W. & L. E. Gurley solar transit No. 600539. It is equipped with full vertical circle and improved Smith-type telescopic solar attachment, and conforms to the standard instrumental specifications of the Bureau of Land Management. The instrument was in good adjustment prior to the beginning of the survey and was maintained in precise adjustment throughout the survey.

Before restoring the corners, the lines of the original survey were retraced and a diligent search made for any evidence of the original corners, bearing trees, and other calls of the original field note record.

The rules of proportionate measurement were applied to ascertain the position of the lost corners, but not until exhausting every reasonable possibility of finding direct evidence for the control of each particular corner.

The cost of the field and office work incurred in the execution of the retracements and resurveys herein described are payable from the current appropriations for "Management of Lands and Resources," Bureau of Land Management.

Lines connecting previously established corners were run by random and true method, but for simplification of the record, the random lines are omitted from the field notes.

Measurements herein contained were made with a narrow steel tape, 5 chains in length, graduated every link for the first 100 links, and thereafter at intervals of 10 links. The tape was tested by comparison with a one chain standard steel tape and found to be correct. Measurements were made on the slope with the vertical angle of each interval ascertained with a clinometer in good adjustment; horizontal equivalents alone are entered in the field notes. All lines of the survey were run by direct method where the lines were accessible; lines inaccessible were run by triangulation or traverse methods. Distances to topography on lines run by triangulation and traverse are approximate as scaled from reliable U.S.G.S. topographic sheets. The details of such triangulations and traverses have been thoroughly checked and verified, and in order to simplify the record, the diagrams and reductions are omitted from these field notes.

The direction of the lines of the survey were determined by reference to true meridians established on line by altitude observations on the sun. The lines were carried forward by sustained angulation, being supplemented by numerous other altitude observations on the sun taken throughout the progress of the survey.

Dependent Resurvey of a Portion of Township 22 South, Range 2½ West

CHAINS

The geographic position of the southeast corner of section 3 is at latitude 30°54'27.7" North, and a longitude 112°06'26.69" West, as adjusted from section line ties to U.S.G.S. triangulation station No. 6 (SRS) (OSGS), latitude 38°51'55.190" N. and longitude 112°12'51.721" W., located S. 67°31'20" W., 202.36 chas. dist. from the cor. of secs. 21, 22, 27 and 28, T. 22 S., R. 3 W.

The magnetic declination was read at a number of stations throughout the township and the average of these readings was found to be 16° E.

Dependent Resurvey of a Portion of the North
Boundary, Township 22 South, Range 2½ West.

Reestablishment of the Survey Ex-
ecuted by John T. Brecken in 1896

Beginning at the cor. of secs. 2, 3, 34 and 35 on the N. bdy. of the Tp., monumented with a sandstone, 14x11x5 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R2½W
S34 | S35
S3 | S2
T22S
1963

from which

A cedar, 10 ins. diam., bears N. 42°15' E., 31 lks. dist., mkd. T21S R2½W S35 BT.

A pinon, 14 ins. diam., bears S. 50°45' E., 45 lks. dist., mkd. T22S R2½W S2 BT.

A pinon, 16 ins. diam., bears S. 27°45' W., 71 lks. dist., mkd. T22S R2½W S3 BT.

A spruce, 4 ins. diam., bears N. 75°15' W., 50 lks. dist., mkd. T21S R2½W S34 BT.

Deposit the original stone alongside the iron post.

S. 89°54' W., bet. secs. 3 and 34.

Over broken mountainous land through medium dense pinon and juniper and scattered spruce timber.

Desc. by triangulation 120 ft. over W. slope of spur.

4.00 Ravine, drains S.; thence along broken S. slope.

16.50 Ravine, drains SE.; asc. about 80 ft. over E. slope of spur.

22.00 Spur, projects S.; desc. about 80 ft. over SW. slope.

Dependent Resurvey of a Portion of the North Boundary of T. 22 S., R. 2 $\frac{1}{2}$ W.

CHAINS

31.00 Fork of N. Cedar Ridge Canyon, intermittent stream, course SE.; enter medium dense spruce and cedar; asc. about 200 ft. over NE. slope.

37.80 End of triangulation; leave dense timber.

39.78 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R2 $\frac{1}{2}$ W

S34

S3

T22S

1963

from which

A spruce, 18 ins. diam., bears S. 15° W., 53 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W $\frac{1}{4}$ S3 BT

A cedar, 10 ins. diam., bears N. 67°45' W., 100 lks. dist., mkd. T21S R2 $\frac{1}{2}$ W $\frac{1}{4}$ S34 BT.

Asc. 125 ft. over broken NE. slope.

47.80 Low spur, projects NE.; desc. 35 ft. over N. slope.

54.90 Draw, drains NE.; enter aspen; asc. 155 ft. over NE. slope.

57.50 Leave aspen; enter dense oak brush.

59.67 Point for the W. 1/16 sec. cor. of secs. 3 and 34 at proportionate dist.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R2 $\frac{1}{2}$ W

W1/16 S34-

S3

T22S

1963

Asc. 220 ft. over broken NE. slope through scattered mahogany and spruce.

79.56 The cor. of secs. 3, 4, 33 and 34, monumented with a sandstone, 18x10x4 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T21S R2 $\frac{1}{2}$ W

S33 | S34

S4 | S3

T22S

1963

deposit the original stone alongside the iron post.

Dependent Resurvey of a Portion of the North Boundary of T. 22 S. R. 2

CHAINS

The cor. is located on top of a spur that projects SE.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pinon, cedar, mahogany and scattered spruce.

Undergrowth, sagebrush, manzanita and oak brush.

S. 89°03' W., bet. secs. 4 and 33.

Over broken mountainous land through scattered mahogany and spruce.

Asc. 50 ft. over point of spur.

4.40 Slope changes to NE.; asc. 35 ft.

13.30 Leave spruce; slope changes to E.; asc. 80 ft.

26.60 Spur, projects S.; leave mahogany; desc. 60 ft. over rocky W. slope.

32.61 The closing cor. of Tps. 21 and 22 S., R. 2½ W., monumented with an iron post, 2½ ins. diam., firmly set, with brass cap mkd.

T22S	T21S
R3W	R2½W
S1	S33
	S4
	CC
	T22S
	1963

From this cor., the E. ¼ sec. cor. of sec. 1, T. 22 S., R. 3 W., bears N. 0°06' W., 10.18 chs. dist., and is monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the official record.

Land, mountainous.

Soil, rocky and gravelly.

Timber, scattering mahogany and spruce.

Undergrowth, sagebrush and manzanita.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 2½ W.

Reestablishment of the survey executed by John T. Brecken, in 1896.

From the cor. of secs. 2, 3, 10 and 11, monumented with a sandstone, 15x10x5 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S	R2½W
S3	S2
S10	S11
	1963

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 2½ W.

CHAINS

from which

A spruce, 12 ins. diam., bears N. 60°15' E., 66 lks. dist., mkd. T22S R2½W S2 BT.

A spruce, 14 ins. diam., bears S. 52° E., 42 lks. dist., mkd. T22S R2½W S11 BT.

A pine, 20 ins. diam., bears S. 77°45' W., 42 lks. dist., mkd. T22S R2½W S10 BT.

A spruce, 15 ins. diam., bears N. 24° W., 22 lks. dist., mkd. T22S R2½W S3 BT.

deposit the original stone alongside the iron post.

N. 0°10' W., bet. secs. 2 and 3.

Over mountainous land through medium dense timber.

Desc. 305 ft. over broken NE. slope.

- .60 Wash, 6 ft. deep, 30 lks. wide, drains NE.
- 2.00 Small spur, projects NE.
- 2.90 Wash, 2 ft. deep, 10 ft. wide, drains NE.
- 6.50 Spur, projects NE.
- 9.80 Wash, 3 ft. deep, 20 lks. wide, drains NE.
- 11.50 Low spur, projects NE.
- 14.40 Wash, 3 ft. deep, 20 lks. wide, drains NE.; leave dense spruce, pine and fir; enter dense mahogany and cedar.
- 18.70 Draw, drains NE.; asc. 30 ft. over SE. slope.
- 22.50 Spur, projects NE.; desc. 90 ft. over steep NE. slope.
- 27.50 Trough Canyon; wash, 15 ft. deep, 50 lks. wide, drains SE.; asc. 110 ft. over W. slope of spur.
- 40.40 Point for the ¼ sec. cor. of secs. 2 and 3 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R2½W

½
S3 | S2
1963

from which

A spruce, 12 ins. diam., bears S. 38°45' E., 100 lks. dist., mkd. ¼ S2 BT.

A spruce, 12 ins. diam., bears N. 37°30' W., 30 lks. dist., mkd. ¼ S3 BT.

Asc. gradually along bottom of draw.

- 42.00 Wash in bottom of draw, 1 ft. deep, 6 lks. wide, drains SW.; asc. 240 ft. over SE. slope through scattered mahogany and cedar.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 2½ W.

CHAINS

64.20 Spur, projects SW.; asc. 20 ft. over top of spur.

71.90 Ridge, bears NW. and SE.; desc. 65 ft. over N. slope.

79.00 Enter dense spruce and pine; slope changes to NW.

80.80 Point for the 1/16 sec. cor. of secs. 2 and 3 at proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R2½W

1/16

S3|S2

80

1963

from which

A spruce, 10 ins. diam., bears S. 80°45' E., 40 lks. dist., mkd. 1/16 S2 BT.

A spruce, 12 ins. diam., bears N. 65°15' W., 29 lks. dist., mkd. 1/16 S3 BT.

Desc. 350 ft. over NW. slope.

92.00 Fork of North Cedar Ridge Canyon; stream of water, 1 lk. wide, 1 in. deep, course S. 80° E.; asc. 235 ft. over S. slope through dense mahogany, pinon and cedar.

101.88 The cor. of secs. 2, 3, 34 and 35 on the N. bdy of the Tp., previously described.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, fir, mahogany, cedar and pinon.

Undergrowth, oak brush, sagebrush and manzanita.

From the cor. of secs. 2, 3, 10 and 11.

N. 89°57' W., bet. secs. 3 and 10.

Over broken mountain land through dense spruce, fir and pine timber.

By triangulation, asc. about 160 ft. over broken NE. slope.

.30 Wash, 6 ft. deep, 30 lks. wide, drains NE.

5.00 Spur, projects NE.; desc. about 40 ft. over NW. slope.

17.00 Ravine, drains NE.; asc. about 480 ft. over broken NE. slope.

30.00 Spur, projects N.; thence along broken N. slope.

40.20 End of triangulation.

The ¼ sec. cor. of secs. 3 and 10, monumented with a sandstone, 14x10x3 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 2½ W.

CHAINS

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R2½W

½ $\frac{S3}{S10}$
1963

from which

A spruce, 16 ins. diam., bears S. 34°30' E., 32 lks. dist., mkd. ½ S10 BT.

A pine, 14 ins. diam., bears N. 44° W., 14 lks. dist., mkd. ½ S3 BT.

deposit the original stone alongside the iron post.

N. 88°44' W., beginning new measurement.

Asc. 50 ft. over N. slope through medium dense pine, spruce, fir and pinon.

2.60 Spur, projects N.; thence by triangulation; desc. about 350 ft. over broken NW. slope.

35.00 Ravine, drains NE.; asc. about 100 ft. over NE. slope.

39.17 The cor. of secs. 3, 4, 9 and 10, monumented with a sandstone, 14x10x7, firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R2½W

$\frac{S4}{S9} \frac{S3}{S10}$
1963

from which

A mahogany, 12 ins. diam., bears N. 28° E., 40 lks. dist., mkd. T22S R2½W S3 BT.

A mahogany, 8 ins. diam., bears S. 24°30' W., 12 lks. dist., mkd. T22S R2½W S9 BT.

A spruce, 5 ins. diam., bears N. 19°30' W., 15 lks. dist., mkd. T22S R2½W S4 BT.

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, fir, spruce, pinon, cedar and mahogany.

Undergrowth, oak brush, sagebrush and manzanita.

N. 0°02' W., bet. secs. 3 and 4.

Over broken mountainous land through medium dense pine, fir, spruce timber by triangulation; desc. about 320 ft. over steep NE. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 2½ W.

CHAINS

35.00 Small canyon; wash, 4 ft. deep, 20 lks. wide, drains E.; asc. about 60 ft. over S. slope.

38.47 End of triangulation.

The ½ sec. cor. of secs. 3 and 4, monumented with a sandstone, 14x8x5 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R2½W

½

S4 | S3

1963

from which

A cedar, 7 ins. diam., bears S. 51°45' E., 68 lks. dist., mkd. T22S R2½W ½ S3 BT.

A spruce, 12 ins. diam., bears S. 43°15' W., 86 lks. dist., mkd. T22S R2½W ½ S4 BT.

Deposit the original stone alongside the iron post.

N. 0°29' W., beginning new measurement.

Asc. 65 ft. over S. slope through dense mahogany and cedar and heavy oak brush.

7.10 Spur, projects SE.; desc. 185 ft. over steep NE. slope.

15.40 Trough Canyon; wash, 8 ft. deep, 50 lks. wide, drains SE.; asc. 125 ft. along W. slope of spur.

20.50 Point for the N. 1/16 sec. cor. of secs. 3 and 4 at proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T22S R2½W

N1/16

S4 | S3

1963

Asc. 205 ft. over W. slope.

41.00 Point for the 1/16 sec. cor. of secs. 3 and 4 at proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R2½W

1/16

S4 | S3

80

1963

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 2½ W.

CHAINS

This cor. is located on the W. edge of the top of a spur that projects S.

42.00 Top of ascent; desc. 40 ft. along W. slope.

47.00 Head of draw, drains SW.; asc. 210 ft. over SW. slope.

62.42 The cor. of secs. 3, 4, 33 and 34 on the N. bdy of the Tp., previously described.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, fir, cedar mahogany and pinon.

Undergrowth, oak brush, sagebrush and manzanita.

From the cor. of secs. 3, 4, 9 and 10.

S. 89°09' W., bet. secs. 4 and 9.

Over mountainous land through dense pine, spruce and fir timber.

Asc. 125 ft. over NE. slope.

7.40 Ridge, bears NW. and SE.; thence by triangulation; desc. about 440 ft. over ledgy and broken SW. slope.

32.00 Wash, 10 ft. deep, 50 lks. wide, drains S.

32.52 The closing cor. of secs. 4 and 9 on the W. bdy. of the Tp., monumented with an iron post, 2½ ins. diam., firmly set, mkd. and witnessed as described in the field notes of the 1963 resurvey of T. 22 S., R. 3 W.

From this cor., the cor. of secs. 12 and 13, T. 22 S., R. 3 W., bears S. 0°31' E., 8.22 chs. dist., monumented with an iron post, 2½ ins. diam., firmly set, mkd. and witnessed as described in the field notes of the 1963 resurvey of T. 22 S., R. 3 W.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, fir, cedar, pinon and mahogany.

Undergrowth, oak brush, sagebrush and manzanita.

GENERAL DESCRIPTION

The land in sections 3 and 4, T. 22 S., R. 2½ W., is entirely mountainous. The elevation of the township ranges from about 7700 ft. above sea level in the lowest reaches of the canyon bottoms on the E. bdy. of sec. 3, to about 9000 ft. above sea level on the ridge top in the SW. corner of sec. 4. Drainage is almost entirely to the SE. Drainage in the SW. cor. of sec. 4 is to the S.

The land is covered with a dense growth of mahogany and oak brush north of Trough Canyon. The land south of Trough Canyon is covered with a dense growth of spruce, fir, pine, mahogany, pinon and cedar.

The soil is rocky and gravelly. There is no water in the area. A trail road enters the area about 5.00 chains W. of the cor. of secs. 3, 4, 33 and 34 on the N. bdy. and runs in a southeasterly direction for about ½ mile, where it ends. There is no other access to the area.

Blank

Page

FIELD ASSISTANTS

[illegible]

CERTIFICATE OF SURVEY

I, **GLEN B. HATCH**, HEREBY CERTIFY upon honor that,
 in pursuance of special instructions bearing date of the 15 day of **MAY**, 1963,
 I have supervised the dependent resurvey of the west 2 miles of the north
 boundary and sec. 3 and 4 of T. 22 S., R. 2½ W.,


of the **Salt Lake** Meridian, in the State of **Utah**, which
 are represented in the foregoing field notes as having been executed ~~by me~~ under my direction;
 and that said survey has been made in strict conformity with said special instructions, the Manual
 of Instructions for the Survey of the Public Lands of the United States, and in specific manner
 described in the foregoing field notes.

(Date)

January 17, 1964

(Date)

(Cadastral Surveyor)

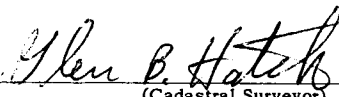

(Cadastral Surveyor)

Glen B. Hatch, Cadastral Surveyor

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date **JAN 27 1965**


BUREAU OF LAND MANAGEMENT,
 Washington, D. C.

The foregoing field notes of the dependent resurvey of the west 2 miles of the
 north boundary and secs. 3 and 4 of T. 22 S., R. 2½ W.,

executed by Gerald W. Hochstrasser, Surveying Technician, under the supervision
 of Glen B. Hatch, Cadastral Surveyor,
 having been critically examined and found correct, are hereby approved.

APR 21 1965

(Date)

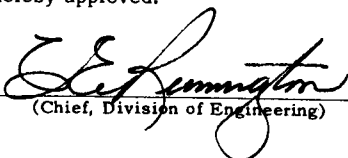

(Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in
 _____, is a true copy of the original field notes.

(Date)

(Chief, Division of Engineering)

Blank Page

Blank

Page

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

47

FIELD NOTES

OF THE
DEPENDENT RESURVEY

OF

THE EAST BOUNDARY,

THE EAST 3 MILES OF THE SOUTH BOUNDARY,

THE EAST 3 MILES OF THE NORTH BOUNDARY,

AND

A PORTION OF THE SUBDIVISIONAL LINES

OF

TOWNSHIP 22 SOUTH, RANGE 3 WEST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

Glen B. Hatch, Cadastral Surveyor

Under special instructions dated May 15, 19 63, which provided for the surveys
included under Group Number 465, approved May 16, 1963,
and assignment instructions dated June 4, 19 63.

Survey commenced June 11, 19 63

Survey completed August 27, 19 63

DEPT. OF THE INTERIOR
BUREAU OF LAND MGMT

1965 JUN 2 AM 10 00 .0

RECEIVED
STAGE & L.A.
SALT LAKE CITY, UTAH

INDEX DIAGRAM

Township 22 South, Range 3 West,

6	5	4	26 69 8 68	25 56 9 55	24 43 1 42	17
7	8	9	67 10 66	54 11 53	40 12 39	14
18	17	16	65 15 64	52 14 50	38 18 37	11
19	20	21	63 22 62	49 23 48	35 24 34	9
30	29	28	61 27 59	47 26 46	32 25 31	6
31	32	33	57 34 23	43 35 21	28 36 19	2

Township 22 South, Range 3 West

CHAINS

The west $\frac{3}{4}$ mile of the north boundary and the north 4 miles of the west boundary were surveyed by A. J. Stewart, Jr. in 1874, and the record appears in the field notes of T. 22 S., R. 3 W. The east $5\frac{1}{2}$ miles of the north boundary, the south and east boundaries, and the south 2 miles of the west boundary were surveyed by John T. Breckon in 1896, and the record appears in the field notes of T. 22 S., R. 3 W. A portion of the subdivision was surveyed by A. J. Stewart, Jr. in 1874 and the remainder was surveyed by John T. Breckon in 1896, and the record appears in the field notes of T. 22 S., R. 3 W.

The following field notes are those of the dependent resurvey of the east 3 miles of the north boundary, the east boundary, and the east 3 miles of the south boundary, and a portion of the subdivision of T. 22 S., R. 3 W.

Before restoring the corners, the lines of the original survey were retraced and a diligent search made for any evidence of the original corners, bearing trees, and other calls of the original field note record.

The rules of proportionate measurement were applied to ascertain the position of the lost corners, but not until exhausting every reasonable possibility of finding direct evidence for the control of each particular corner.

Distances to topography on lines run by traverse or triangulation are approximate as scaled from reliable U.S.G.S. topographic sheets. The details of such traverses and triangulations have been thoroughly checked and verified, and in order to simplify the record, the diagrams and reductions are omitted from these field notes.

The direction of lines of this survey were determined by reference to true meridians established on line by altitude observations on the sun. The lines were carried forward by sustained angulation, being supplemented by other numerous altitude observations on the sun taken throughout the progress of the survey.

The geographic position of the southeast corner of the township is at a latitude $38^{\circ}50'15.4''$ North, and a longitude $112^{\circ}07'58.88''$ West, as adjusted from section line ties to U.S.G.S. triangulation station "White Pine Peak", located S. $67^{\circ}31'20''$ W., 202.36 chs. dist. from the cor. of secs. 21, 22, 27 and 28, Township 22 South, Range 3 West.

The magnetic declination was read at a number of stations throughout the township and the average of these readings was found to be 16° E.

Dependent Resurvey of the East Boundary, T.22 S., R.3 W.

Re-establishment of the survey executed by John T. Breckon in 1896, with establishment of corners for T. 22 S., R. $2\frac{1}{2}$ W. on this line.

Beginning at the cor. of Tps. 22 S., Rs. $2\frac{1}{2}$ and 3 W.,

Dependent Resurvey of the East Boundary, T. 22 S., R. 3 W.

CHAINS

which is monumented with a sandstone, 18x10x7 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A cedar, 6 ins. diam., bears N. 15° E., 77 lks. dist., mkd. T22S R2½W S33 BT. (Record: N. 27° 35' E., 73 lks.)

A pinon, 12 ins. diam., bears N. 25°30' W., 57 lks. dist., mkd. T22S R3W S36 BT. (Record: N. 11°45' W., 53 lks.)

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., on solid sandstone, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T22S
R3W R2½W
S36 | S33
S4
T23S R3W
1963

Deposit the original stone alongside the iron post.

N. 0°16' W. along the E. bdy. of sec. 36.

Over mountainous land through dense pinon and cedar timber.

Asc. 10 ft. over S. slope.

2.60 Top of sandstone ledge, 20 ft. high, bears NW. and SE.; thence by triangulation. Desc. about 160 ft. over ledgy N. slope.

9.20 Bottom of canyon, drains SE.; asc. about 20 ft. over SW. slope. End triangulation.

11.19 Point for the 1/16 sec. cor. of sec. 36 at proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2½W
1/16 S36 |
140 |
1963

Thence by triangulation, asc. about 400 ft. over broken SW. slope of spur through medium dense pinon and cedar.

30.83 Point for the 1/16 sec. cor. of sec. 36 at proportionate dist. End triangulation.

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2½W
1/16 S36 |
120 |
1963

Dependent Resurvey of the East Boundary, T. 22 S., R. 3 W.

CHAINS

From which

A cedar, 8 ins. diam., bears S. 15° W., 45 lks.
dist., mkd. 1/16 S36 BT.

A pinon, 4 ins. diam., bears S. 60° W., 49 lks.
dist., mkd. 1/16 S36 BT.

Asc. 165 ft. over SW. slope through scattered pinon
and cedar timber.

39.86 Point for the W. $\frac{1}{4}$ sec. cor. of sec. 33, T. 22 S., R. $2\frac{1}{2}$
W., at midpoint bet. closing cor. at secs. 28 and 33
and cor. of secs. 33 and 36 on the S. bdy.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

	T22S
R3W	R2 $\frac{1}{2}$ W
	$\frac{1}{4}$
	S33
1963	

From which

A pinon, 14 ins. diam., bears S. 80° E., 29
lks. dist., mkd. $\frac{1}{4}$ S33 BT.

There were no other suitable bearing trees
available.

The 1/16 sec. cor. at 120 chs. T. 22 S.,
R. 3 W., bears S. $0^{\circ}16'$ E. 9.03 chs. dist.

40.40 Spur, projects SE.; asc. 100 ft. over SE. slope of spur;
continue through scattered pinon and cedar timber.

50.46 Point for the 1/16 sec. cor. of sec. 36 at proportionate
dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid
rock and in a mound of stone, 5 ft. base to top, with
brass cap mkd.

	T22S
R3W	R2 $\frac{1}{2}$ W
1/16 S36	
100	
1963	

From which

A pinon, 10 ins. diam., bears N. 65° W., 39
lks. dist., mkd. 1/16 S36 BT.

There were no other suitable bearing trees avail-
able.

Asc. 10' ft. over NE. slope.

51.70 Top of ascent slopes E. thence by triangulation; desc.
160 ft. over broken NE. slope.

58.00 Ravine, drains SE.; asc. 240 ft. over broken ledgy
S. slope through scattered pinon and cedar timber.

Dependent Resurvey of the East Boundary, T. 22 S., R. 3 W.

CHAINS

70.10

Point for the 1/16 sec. cor. of sec. 36 at proportionate dist. End triangulation.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

	T22S	
	R3W	R2 $\frac{1}{2}$ W
1/16	S36	
80		
	1963	

There were no suitable bearing trees available.

Asc. 150 ft. over broken and ledgy S. slope; continue through scattered pinon and cedar timber.

75.60

Spur, projects SE.; asc. 10 ft. over S. slope.

78.20

South Cedar Ridge, bears E. and W.; enter dense mahogany, cedar, spruce, and fir timber; desc. 30 ft. over N. slope.

79.72

The closing cor. of secs. 28 and 33, T. 22 S., R. 2 $\frac{1}{2}$ W., monumented with a limestone, 18x10x7 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A cedar, 10 ins. diam., bears N. 39° E.,
6 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S28 BT.

A dead pinon, 8 ins. diam., bears S. 79° E.,
30 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S33 BT.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

	T22S
R3W	T2 $\frac{1}{2}$ W
S36	S28
	S33
	1963

From which a new bearing tree

A fir, 20 ins. diam., bears S. 40° E.,
66 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S33 BT.

Deposit the original stone alongside the iron post.

The 1/16 sec. cor. of sec. 36 at 80.00, T. 22 S., R. 3 W., bears S. 0°16' E. 9.62 chs. dist.

Thence by triangulation, desc. 360 ft. over steep and broken N. slope through dense fir, pine and cedar timber.

89.73

Point for the S. 1/16 sec. cor. of sec. 36 at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2½W
S 1/16
S36
1963

From which

A spruce, 8 ins. diam., bears N. 65°30' W.,
16 lks. dist., mkd. 1/16 S36 BT.

A spruce, 10 ins. diam., bears N. 25° W.,
29 lks. dist., mkd. 1/16 S36 BT.

Desc. 240 ft. over N. slope.

105.50 S. Cedar Ridge Canyon; wash, 15 ft. deep, 50 lks. wide,
drains E.; leave fir and spruce; enter scattered juniper
and pinon; asc. 200 ft. over steep S. slope.

109.37 Point for the E. ¼ sec. cor. of sec. 36 at proportionate
dist. falls at the base of a small ledge, 4 ft. high,
bears E. and W. There is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., on solid
rock, and in a mound of stone, 5 ft. base to top, with
brass cap mkd.

T22S
R3W R2½W
¼
S36
1963

There were no suitable bearing trees available.

End of triangulation.

Asc. 190 ft. over S. slope, continuing through scattered
juniper and pinon timber.

112.90 Top of sandstone ledge, 30 ft. high, bears E. and W.;
asc. 50 ft. over S. slope.

118.22 Point for the W. ¼ sec. cor. of sec. 28, T. 22 S.,
R. 2½ W., at midpoint bet. closing cors. of secs. 28
and 33 and secs. 21 and 28.

Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

R3W T22S
R2½W
¼
S28
1963

From which

A cedar, 5 ins. diam., bears N. 5°30' E.,
14 lks. dist., mkd. ¼ S28 BT.

A cedar, 12 ins. diam., bears S. 50°15' E.,
18 lks. dist., mkd. ¼ S28 BT.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

The E. $\frac{1}{4}$ sec. cor. of sec. 36, T. 22 S., R. 3 W., bears S. $0^{\circ}16'$ E. 8.85 chs. dist.

Asc. 80 ft. over S. slope.

121.80 Ridge, bears E. and W.; thence by triangulation; desc. 360 ft. over steep N. slope; enter dense fir and spruce.

131.00 Mill Canyon, drains SE.; leave fir and spruce; enter medium dense pinon and juniper; asc. 360 ft. over steep S. slope.

142.60 Point of rocky spur, projects S. 15° E.; end of triangulation. Asc. 80 ft. over S. slope.

148.64 The cor. of secs. 25 and 36, monumented with a sandstone, $14 \times 10 \times 3$ ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A cedar, 8 ins. diam., bears S. $64^{\circ}10'$ W., 10 lks. dist., mkd. T22S R3W S36 BT.
(Record: S. $35^{\circ}15'$ W., 6 lks.)

A pinon, 12 ins. diam., bears N. $36^{\circ}35'$ W., 46 lks. dist., mkd. T22S R3W S25 BT.
(Record: N. $26^{\circ}45'$ W., 52 lks.)

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S	
R3W	R2 $\frac{1}{2}$ W
S25	
S36	S28
1963	

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, spruce, fir, pinon, cedar, and juniper.

Undergrowth, sagebrush and grass in bottom of S. Cedar Ridge and Mill Canyons.

N. $0^{\circ}24'$ W., along E. bdy. of sec. 25.

Over broken mountainous land through dense mahogany, pinon, cedar and juniper timber; asc. 50 ft. over S. slope.

8.09 The closing cor. of secs. 21 and 28, T. 22 S., R. 2 $\frac{1}{2}$ W., monumented with a sandstone, $12 \times 10 \times 6$ ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A fallen pinon, mostly decayed, is NE. of the cor. and is mkd. T22S R2 $\frac{1}{2}$ W CC S21 BT.

A dead cedar, 4 ins. diam., bears S. 33° E., 12 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S28 BT.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
S25 | $\frac{S21}{S28}$ CC
1963

From which new bearing trees:

A cedar, 16 ins. diam., bears N. 35° E.,
20 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S21 BT.

A cedar, 8 ins. diam., bears S. 30° E.,
17 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S28 BT.

The cor. of secs. 25 and 36, T. 22 S., R. 3 W., bears
S. 0°24' E., 8.09 chs. dist.

Deposit the original stone alongside the iron post.

Asc. 50 ft. over S. slope.

12.50 Slope changes to SW.; asc. 30 ft.

18.70 Spur, projects SW.; desc. 30 ft. over NW. slope.

23.30 Draw, drains SW.; asc. 185 ft. over S. slope.

36.10 Ridge, bears NW. and SE.; enter dense fir, spruce and
pine; desc. 100 ft. over NE. slope.

38.89 Point for the E. $\frac{1}{4}$ sec. cor. of sec. 25 at proportionate
dist.; there is no remaining evidence of the original
cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
 $\frac{1}{4}$ |
S25 |
1963

From which

A spruce, 10 ins. diam., bears S. 27° W.,
30 lks. dist., mkd. $\frac{1}{4}$ S25 BT.

A spruce, 26 ins. diam., bears N. 43° W.,
48 lks. dist., mkd. $\frac{1}{4}$ S25 BT.

Desc. 240 ft. over broken NE. slope through dense pine,
spruce and fir.

45.00 Wash, 6 ft. deep, 20 lks. wide, drains NE.; enter dense
cedar and mahogany; desc. 30 ft. along E. slope.

47.03 Point for the W. $\frac{1}{4}$ sec. cor. of sec. 21, T. 22 S.,
R. 2 $\frac{1}{2}$ W., at midpoint bet. closing cors. of secs. 21
and 28 and secs. 16 and 21.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins.
in the ground, and in a mound of stone, 6 ft. base to

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

CHAINS

top, with brass cap mkd.

T22S

R3W R2½W

¼

S21

1963

From which

A spruce, 10 ins. diam., bears N. 48°30' E.,
18 lks. dist., mkd. ¼ S21 BT.

A cedar, 12 ins. diam., bears S. 20°15' E.,
16 lks. dist., mkd. ¼ S21 BT.

The E. ¼ sec. cor. of sec. 25, T. 22 S., R. 3 W., bears
S. 0°24' E. 8.14 chs. dist.

Desc. 40 ft. over E. slope.

49.20 Draw, drains E.; asc. 30 ft. over SE. slope.

53.20 Spur, projects E.; desc. 230 ft. over steep NE. slope;
enter dense pine, spruce and fir.

57.70 Top of ledge, 30 ft. high, bears NE. and SW.; desc. 40
ft. over NE. slope.

58.335 Point for the N. 1/16 sec. cor. of sec. 25 at propor-
tionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S

R3W R2½W

N 1/16

S25

1963

From which

A spruce, 16 ins. diam., bears S. 69° W.,
36 lks. dist., mkd. N 1/16 S25 BT.

A spruce, 16 ins. diam., bears N. 27°15' W.,
21 lks. dist., mkd. N 1/16 S25 BT.

Desc. 20 ft. over N. slope.

59.00 Wash, 10 ft. deep, 30 lks. wide, drains NE.; desc.
125 ft. over broken NE. slope.

63.50 Small spur, projects NE.

70.00 Newt's Canyon with small stream of water, 2 lks. wide,
2 ins. deep, course SE.; asc. 40 ft. over SE. slope.

77.78 The cor. of secs. 24 and 25 on the East boundary, mon-
umented with an iron post, 2½ ins. diam., firmly set
in the ground, mkd. and witnessed as described in the
1961 record of the remonumented corners in T. 22 S.,
R. 3 W.

Land, mountainous.

Soil, mostly sandy and rocky; sandy loam on S. slope.
of Newt's Canyon.

Timber, pine, fir, spruce, pinon, mahogany, red cedar,

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

and juniper; some aspen in bottom of Newt's Canyon.
Undergrowth, sagebrush and grass.

N. $0^{\circ}18'$ E., along E. bdy. of sec. 24.

Over broken mountainous land through medium dense timber.

By triangulation; asc. gradually over S. slope.

1.00 Spur, projects SW.; desc. 40 ft. over NW. slope.

3.50 Base of spur, bears NE. and SW.; asc. 40 ft. over broken SW. slope through medium dense pine, cedar, mahogany and pinon.

8.19 The closing cor. of secs. 16 and 21, T. 22 S., R. $2\frac{1}{2}$ W., monumented with a sandstone, 14x8x6 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A pine, 24 ins. diam., bears N. $76^{\circ}40'$ E.,
113 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S16 BT.
(Record dist. 117 lks.)

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
S24 $\frac{S16}{S21}$ CC
1963

From which a new bearing tree:

A pine, 24 ins. diam., bears S. $80^{\circ}45'$ E.,
89 lks. dist., mkd. T22S R2 $\frac{1}{2}$ W CC S21 BT.

The cor. of secs. 24 and 25, T. 22 S., R. 3 W., bears S. $0^{\circ}18'$ W., 8.19 chs. dist.

Deposit the original stone alongside the iron post.

Asc. 400 ft. over broken SW. slope through dense juniper pinon and cedar and scattering pine.

26.41 Point for the S. 1/16 sec. cor. of sec. 16, T. 22 S., R. $2\frac{1}{2}$ W. at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
S 1/16
S16
1963

31.10 Rocky spur, projects SE.; asc. 40 ft. over NE. slope.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

KIAM

From which

A pinon, 12 ins. diam., bears S. $12^{\circ} 15'$ E.
123 lks. dist., mkd. S $1/16$ S16 BT.

No other suitable bearing trees available.

Asc. 100 ft. along broken E. slope, through medium dense mahogany, pinon and cedar.

36.19

Point for the E. $\frac{1}{4}$ sec. cor. of sec. 24 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
|
 $\frac{1}{4}$
S24
|
1963

From which

A cedar, 30 ins. diam., bears S. 45° W.,
30 lks. dist., mkd. $\frac{1}{4}$ S24 BT.

There were no other suitable bearing trees available.

Asc. 50 ft. along broken E. slope.

44.63

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 16, T. 22 S., R. $2\frac{1}{2}$ W., at midpoint bet. closing cors. of secs. 16 and 21, and secs. 9 and 16.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

-
T22S
R3W R2 $\frac{1}{2}$ W
|
 $\frac{1}{4}$
S16
|
1963

From which

A pinon, 6 ins. diam., bears S. $21^{\circ} 05'$ E.,
90 lks. dist., mkd. $\frac{1}{4}$ S16 BT.

No other suitable bearing trees within limits.

The E. $\frac{1}{4}$ sec. cor. of sec. 24, T. 22 S., R. 3 W., bears S. $0^{\circ} 18'$ W., 8.44 chs. dist.

Asc. 160 ft. along broken E. slope; continue through medium dense pinon, mahogany and cedar.

55.60

Ravine, drains S. 15° E.; asc. 180 ft. over SW. slope.

62.85

Point for the N. $1/16$ sec. cor. of sec. 16, T. 22 S., R. $2\frac{1}{2}$ W., at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

T22S
R3W R2½W
N 1/16
S16
1963

From which

A cedar, 30 ins. diam., bears S. 85° E., 11 lks. dist., mkd. N 1/16 S16 BT.

A pinon, 12 ins. diam., bears S. 45° E., 20 lks. dist., mkd. N 1/16 S16 BT.

Asc. 70 ft. over SW. slope.

65.60 S. crest of ridge, bears NW. and SE.; thence across top of ridge.

66.90 Top of ridge, bears NW. and SE.

68.60 N. crest of ridge, bears NW. and SE.; thence by triangulation; enter scattering pine, spruce and fir; desc. 210 ft. over steep NW. slope.

72.38 The cor. of secs. 13 and 24, monumented with a sandstone, 14x10x6 ins., firmly set, mkd. and witnessed as described in the official record. End triangulation.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T22S
R3W R2½W
S13
S24 S16
1963

From which

A fir, 8 ins. diam., bears S. 51° W., 35 lks. dist., mkd. T22S R3W S24 BT.

There were no other suitable bearing trees available.

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, fir, spruce, mahogany, cedar, pinon and juniper.

Undergrowth, sagebrush and grass.

N. 0°04' E., along the E. bdy. of sec. 13.

Over mountainous land through scattered pine, fir and spruce timber; desc. 275 ft. over broken NW. slope.

8.50 Ravine, drains NE.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

M1480

8.69 The closing cor. of secs. 9 and 16, T. 22 S., R. 2½ W., monumented with an iron post, 2½ ins. diam., firmly set, mkd. and witnessed as described in the 1961 record of the remonumented corners in T. 22 S., R. 2½ W.

The cor. of secs. 13 and 24, T. 22 S., R. 3 W., bears S. 0°04' W., 8.69 chs. dist.

Asc. 20 ft. over SE. slope.

9.50 Small spur, projects NE.; desc. 325 ft. over broken NE. slope; continue through scattering pine, spruce and fir.

10.80 Small draw, drains NE.

14.60 Small spur, projects NE.

28.73 Point for the S. 1/16 sec. cor. of sec. 9, T. 22 S., R. 2½ W., at proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S

R3W

R2½W

S 1/16

S9

1963

29.90 Small spur, projects NE.

31.50 Unimproved road, bears E. and W.

33.00 Bottom of Strawberry Canyon; stream of water 2 ins. deep, 2 lks. wide, course E.; asc. over rocky S. slope through scattering pinon, cedar, juniper and pine.

40.32 Point for the E. ¼ sec. cor. of sec. 13 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S

R3W

R2½W

¼

S13

1963

From which

A cedar, 6 ins. diam., bears S. 37° W., 22 lks. dist., mkd. ¼ S13 BT.

A cedar, 10 ins. diam., bears N. 27°30' W., 73 lks. dist., mkd. ¼ S13 BT.

Asc. 40 ft. over E. slope of low spur, continuing through scattering cedar and heavy sagebrush.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

48.77

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 9, T. 22 S., R. 2 $\frac{1}{2}$ W., at midpoint bet. closing cors. of secs. 9 and 16, and secs. 4 and 9.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
 $\frac{1}{4}$
 S9
1963

From which

A cedar, 6 ins. diam., bears N. 34° E.,
50 lks. dist., mkd. $\frac{1}{4}$ S9 BT.

A cedar, 8 ins. diam., bears S. 13° E.,
18 lks. dist., mkd. $\frac{1}{4}$ S9 BT.

The E. $\frac{1}{4}$ sec. cor. of sec. 13, T. 22 S., R. 3 W., bears S. 0°04' W., 8.45 chs. dist.,

Continue to asc. gradually along E. slope.

60.48

Point for the N. 1/16 sec. cor. of sec. 13, at proportionate dist.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
N 1/16
S13
1963

From which

A cedar, 8 ins. diam., bears N. 50° W.,
28 lks. dist., mkd. N 1/16 S13 BT.

There were no other suitable bearing
trees available.

Asc. 160 ft. over E. slope.

80.64

The cor. of secs. 12 and 13, monumented with a limestone 12x10x3 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A spruce, 18 ins. diam., bears S. 46°30' W.,
35 lks. dist., mkd. T22S R3W S13 BT.

A tree stump, 30 ins. diam., sawed off,
bears N. 30° W., 28 lks. dist. (Record
bearing N. 33°10' W.)

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

T22S
R3W R2½W
S12 | S9
S13 |
1963

From which a new bearing tree:

A spruce, 28 ins. diam., bears N. 20°45' W.,
58 lks. dist., mkd. T22S R3W S12 BT.

Raise a mound of stone, 3 ft. base, 2½ ft.
high, W. of cor. and deposit original stone
alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, fir, cedar, juniper, pinon and
some aspen in Strawberry Canyon.

Undergrowth, heavy sagebrush on N. ½ mile and oak
brush on N. 5.00 chs.

N. 0°31' W., along E. bdy. of sec. 12.

Over mountainous land through dense pine, spruce, fir
and cedar timber; asc. 80 ft. over E. slope; line is
approximately 1.00 ch. W. of a wash 10 ft. deep, 30
lks. wide, draining S.

8.22 The closing cor. of secs. 4 and 9, T. 22 S., R. 2½ W.,
monumented with a limestone, 12x9x6 ins., firmly set,
mkd. and witnessed as described in the official record.

From which the original bearing trees:

A dead cedar, 6 ins. diam., bears N. 24°30' E.,
7 lks. dist., mkd. T22S R2½W S6 BT. (Record:
N. 52° E., 7 lks. dist., mkd. T22S R2½W S4 BT.)

A fallen spruce, mostly decayed, bears S. 26° E.,
14 lks. dist., mkd. T22S R2½W S7 BT. (Record:
S. 17°30' E., 14 lks. dist., mkd. T22S R2½W S9 BT.)

I destroy the markings on these trees.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T22S
R3W R2½W
S12 | S4CC
S9 |
1963

From which new bearing trees:

A spruce, 12 ins. diam., bears N. 7°15' E.,
26 lks. dist., mkd. T22S R2½W CC S4 BT.

A spruce, 18 ins. diam., bears S. 59° E.,
30 lks. dist., mkd. T22S R2½W CC S9 BT.

The cor. of secs. 12 and 13, T. 22 S.,
R. 3 W., bears S. 0°31' E., 8.22 chs. dist.

Raise a mound of stone, 3 ft. base, 2½ ft. high,

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

E. cor. and deposit the original stone
alongside the iron post.

Asc. 205 ft. along an E. slope; continue through dense
timber.

23.00 Head of draw, drains S.; asc. 130 ft. over SW. slope;
enter dense mahogany and pinon.

27.70 Top of ledge, 10 ft. high, bears NW. and SE.; S. crest
of ridge; thence across top of ridge.

35.70 N. crest of ridge, bears NW. and SE.; leave mahogany and
pinon; enter dense pine, fir and spruce. Desc. 130 ft.
over steep N. slope.

40.08 Point for the E. $\frac{1}{4}$ sec. cor. of sec. 12 at proportionate
dist.; there is no remaining evidence of the original
cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
 $\frac{1}{4}$
 S12
 1963

From which

A fir, 14 ins. diam., bears S. 73° W.,
21 lks. dist., mkd. $\frac{1}{4}$ S12 BT.

A fir, 14 ins. diam., bears N. 77° W.,
26 lks. dist., mkd. $\frac{1}{4}$ S12 BT.

Desc. 20 ft. over N. slope; continue through dense
timber.

43.50 Head of draw, drains E.; asc. 30 ft. over SE. slope.

48.18 Point for the W. $\frac{1}{4}$ sec. cor. of sec. 4, T. 22 S.,
R. $2\frac{1}{2}$ W., at proportionate dist. bet. the closing cor.
of secs. 4 and 9, and closing cor. of Tps. 21 and 22 S.,
R. $2\frac{1}{2}$ W.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
 $\frac{1}{4}$
 S4
 1963

From which

A cedar, 8 ins. diam., bears S. 77° E.,
38 lks. dist., mkd. $\frac{1}{4}$ S4 BT.

There were no other suitable bearing trees
available.

The E. $\frac{1}{4}$ sec. cor. sec. 12, T. 22 S., R. 3 W.,
bears S. $0^{\circ}31'$ E., 8.10 chs. dist.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

This cor. is located on a small spur, projecting SE.
Desc. 15 ft. along E. slope.

52.50 Small draw, drains SE.; asc. 15 ft. over SE. slope.

54.10 Spur, projects NE.; desc. 55 ft. over N. slope.

57.80 Leave dense timber; enter scattering cedar and dense oak brush and chokecherry.

60.12 Point for the N. 1/16 sec. cor. of sec. 12 at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
N 1/16 |
S12 |
1963

From which

A fir, 24 ins. diam., bears S. 14° W.,
46 lks. dist., mkd. N 1/16 S12 BT.

A cedar, 20 ins. diam., bears N. 81° W.,
62 lks. dist., mkd. N 1/16 S12 BT.

Desc. 120 ft. over N. slope.

66.50 Draw, drains NE.; asc. 40 ft. over SE. slope.

68.17 Point for the N. 1/16 sec. cor. of sec. 4, T. 22 S.,
R. 2 $\frac{1}{2}$ W., at proportionate dist. bet. closing cor. of
secs. 4 and 9, and closing cor. of Tps. 21 and 22 S.,
R. 2 $\frac{1}{2}$ W.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
R3W R2 $\frac{1}{2}$ W
N 1/16 |
S4 |
1963

From which

A cedar, 15 ins. diam., bears N. 45° E.,
89 lks. dist., mkd. N 1/16 S4 BT.

There were no other suitable bearing trees available.

Asc. 80 ft. over SE. slope.

74.70 Spur, projects E.; desc. 90 ft. over steep NE. slope.

78.50 Enter dense aspen grove.

80.16 The cor. of secs. 1 and 12, monumented with a limestone,
16x10x5 ins., firmly set and dimly mkd. with 5 notches
on the S. edge and 1 notch on the N. edge,

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS

and witnessed with a small mound of stone to West.

From which the original bearing tree:

An aspen, 15 ins. diam., bears S. 85° W.,
87 lks. dist., and was blazed; markings
were illegible. (Record: S. $87^{\circ}30'$ W.,
92 lks.)

There was no remaining evidence of the
other original bearing tree.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins.
in the ground, and in a mound of stone, 2 ft. base to
top, with brass cap mkd.

T22S
R3W R $2\frac{1}{2}$ W
S1
S12 | S4
1963

From which new bearing trees:

An aspen, 10 ins. diam., bears S. $66^{\circ}30'$ W.,
20 lks dist., mkd. T22S R3W S12 BT.

An aspen, 10 ins. diam., bears N. $35^{\circ}15'$ W.,
22 lks. dist., mkd. T22S R3W S1 BT.

Land, mountainous.

Soil, mostly rocky and gravelly; some sandy loam on the
N. slopes.

Timber, pine, spruce, fir, piñon, cedar and juniper.

Undergrowth, oak brush, chokecherry, and sagebrush.

N. $0^{\circ}06'$ W., along the E. bdy. of sec. 1.

Over mountainous land through dense aspen timber; desc.
25 ft. over NE. slope.

1.80 Draw, drains NE.; asc. 15 ft. over SE. slope.

5.30 Spur, projects E.; desc. 50 ft. over NE. slope.

7.99 Point for the 1/16 sec. cor. of sec. 4, T. 22 S.,
R. $2\frac{1}{2}$ W., at proportionate dist. bet. closing cor. of
secs. 4 and 9 and closing cor. of Tps. 21 and 22 S.,
R. $2\frac{1}{2}$ W.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, and in a collar of stone to top, with
brass cap mkd.

T22S
R3W R $2\frac{1}{2}$ W
1/16
S4
80
1963

From which

The cor. of secs. 1 and 12, T. 22 S.,
R. 3 W., bears S. $0^{\circ}06'$ E., 7.99 chs. dist.

Dependent Resurvey of the East Boundary of T. 22 S., R. 3 W.

CHAINS	
	Desc. 25 ft. over NE. slope.
12.70	Draw, drains SE.; asc. 350 ft. over SW. slope.
13.70	Leave aspen; enter dense mahogany and oak brush.
25.90	Leave mahogany and oak brush; continue over SW. slope through dense sagebrush.
28.91	Point for the closing cor. of Tps. 21 and 22 S., R. 2½ W., at proportionate dist.; there is no remaining evidence of the original cor.
	Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.
	<div style="text-align: center;"> T22S T21S R3W R2½W S1 $\frac{S33}{S4}$ CC T22S 1963 </div>
	From which
	The E. ¼ sec. cor. of sec. 1, T. 22 S., R. 3 W., bears N. 0°06' W., 10.18 chs. dist.
	Asc. 100 ft. over SW. slope through heavy sagebrush and scattering juniper.
39.09	The E. ¼ sec. cor. of sec. 1, monumented with an iron post, 2½ ins. diam., firmly set, mkd. and witnessed as described in the 1961 record of the remonumented corners in T. 22 S., R. 3 W.
	N. 0°02' W., beginning new measurement.
	Asc. 140 ft. over SW. slope, changing to S. slope.
10.00	Head of draw, drains SE.; enter medium dense aspen; asc. 100 ft. over SE. slope.
21.00	Road, graded, bears NE. and SW.; this road provides main access to this area; leave aspen.
21.20	Log fence, 4 ft. high, bears NE. and SW.
22.30	Top of ridge, bears NE. and SW.; thence over rolling land along W. crest of ridge, through heavy sagebrush; desc. 15 ft.
29.40	Begin ascent; asc. 30 ft. over SE. slope.
36.60	Small, rocky spur, projects SW.; desc. 20 ft. over NW. slope.
40.57	The cor. of Tps. 21 and 22 S., R. 3 W., monumented with an iron post, 2½ ins. diam., firmly set, mkd. and witnessed as described in the 1961 record of the remonumented corners in T. 22 S., R. 3 W.
	Land, mountainous. Soil, rocky and gravelly. Timber, aspen. Undergrowth, sagebrush.

Dependent Resurvey of a Portion of the South Boundary, T. 22 S., R. 3 W.

CHAINS

Dependent Resurvey of a Portion
of the
South Boundary, T. 22 S., R. 3 W.

Re-establishment of the survey executed by John T. Breckon in 1896 with re-establishment of cors. pertaining to T. 23 S., R. 3 W. on this line.

From the cor. of Tps. 22 S., Rs. 2½ and 3 W., previously described.

S. 88°37' W., along the S. bdy of sec. 36.

Over broken mountainous land through dense juniper and pinon timber. asc. 130 ft. over ledgy NE. slope.

7.97 The N. ¼ sec. cor. of sec. 4, T. 23 S., R. 3 W., monumented with a sandstone, 12x6x4 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S
¼ S4
T23S R3W
1963

From which

A pinon, 15 ins. diam., bears S. 9°00' W., 11 lks. dist., mkd. ¼ S4 BT.

There were no other suitable bearing trees available.

Asc. 275 ft. over ledgy NE. slope; continue through medium dense juniper and pinon.

19.94 Point for the E. 1/16 sec. cor. of sec. 36, at proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 8 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
E1/16 S36
1963

From which

A pinon, 12 ins. diam., bears N. 10°15' E., 15 lks. dist., mkd. E. 1/16 S36 BT.

Asc. 35 ft. over ledgy NE. slope.

23.50 Ridge, bears NW. and SE.; thence by triangulation; desc. 120 ft. over S. slope.

31.50 Draw, drains S.; asc. 120 ft. over SE. slope.

37.56 End of triangulation.

Dependent Resurvey of a Portion of the South Boundary of T. 22 S., R. 3

CHAINS

39.88

The S. $\frac{1}{4}$ sec. cor. of sec. 36, monumented with a sandstone, 16x10x4 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T22S R3W
 $\frac{1}{4}$ S36

T23S R3W
1963

From which

A pinon, 12 ins. diam., bears N. 70° E.,
18 lks. dist., mkd. T22S R3W S36 BT.

A pinon, 6 ins. diam., bears N. $67^{\circ}15'$ W.,
44 lks. dist., mkd. T22S R3W $\frac{1}{4}$ S36 BT.

Deposit the original stone alongside the iron post.

N. $89^{\circ}39'$ W., beginning new measurement.

5.30

Ledge, 10 ft. high, bears NW. and SE.; desc. 70 ft. over SW. slope.

7.92

The closing cor. of secs. 4 and 5, T. 23 S., R. 3 W., monumented with a sandstone, 14x10x6 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
S36

S5|S4

CC

T23S R3W
1963

From which

A cedar, 8 ins. diam., bears S. 86° E.,
19 lks. dist., mkd. T23S R3W CC S4 BT.

A pine, 18 ins. diam., bears S. 34° W.,
49 lks. dist., mkd. T23S R3W CC S5 BT.

Deposit the original stone alongside the iron post.

Thence by triangulation; desc. 40 ft. over SW. slope through scattering juniper and pinon.

11.00

Draw, drains S.; asc. 80 ft. over SE. slope.

16.00

Spur, projects S.; desc. 120 ft. over SW. slope.

23.00

Draw, drains S.; asc. 100 ft. over E. slope.

27.00

Spur, projects SE.; desc. 140 ft. over SW. slope.

Dependent Resurvey of a Portion of the South Boundary of T. 22 S., R. 3 W.

CHAINS

34.00 Ravine, drains SE.; asc. 160 ft. over E. slope.

39.00 End of triangulation.

The cor. of secs. 35 and 36, monumented with a sandstone, 15x10x6 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point.

Set an iron post, 30 ins. long, 2½ ins. diam., 15 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
S35|S36
T23S R3W
S5
1963

From which

A pinon, 10 ins. diam., bears N. 52° E., 43 lks. dist., mkd. T22S R3W S36 BT.

A pinon, 12 ins. diam., bears N. 71° W., 49 lks. dist., mkd. T22S R3W S35 BT.

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, sandy and rocky.

Timber, scattering juniper and pinon.

No undergrowth.

N. 87°30' W., along the S. bdy. of sec. 35.

Over mountainous land through dense pinon and juniper timber; asc. 120 ft. over E. slope.

5.00 Spur, projects S.; desc. 40 ft. over W. slope.

7.85 The N. ¼ sec. cor. of sec. 5, T. 23 S., R. 3 W., monumented with a sandstone, 18x14x10 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 8 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
¼ S5
T23S R3W
1963

From which

A pinon, 12 ins. diam., bears S. 40° W., 54 lks. dist., mkd. T23S R3W ¼ S5 BT.

There were no other suitable bearing trees available.

Deposit the original stone alongside the iron post.

Dependent Resurvey of a Portion of the South Boundary of T. 22 S., R. 3

CHAINS

Thence by triangulation.

Desc. 20 ft. over W. slope.

- 8.50 Draw, drains S.; asc. 50 ft. over E. slope.
- 13.00 Spur, projects S.; desc. 150 ft. over W. slope.
- 18.00 Draw, drains S.; asc. 70 ft. over SE. slope.
- 25.00 Spur, projects S.; desc. 170 ft. over SW. slope.
- 32.00 Draw, drains S.; asc. 280 ft. over ledgy E. slope.
- 37.98 The S. $\frac{1}{4}$ sec. cor. of sec. 35, monumented with a sandstone, 16x13x7 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A cedar, 9 ins. diam., bears N. 31°30' E.,
50 lks. dist., mkd. $\frac{1}{4}$ S BT.

A pinon, 10 ins. diam., bears N. 44° W.,
22 lks. dist., mkd. $\frac{1}{4}$ S BT.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 10 ins.
in the ground, and in a mound of stone, 3 ft. base
to top, with brass cap mkd.

T22S R3W

 $\frac{1}{4}$ S35

T23S R3W

1963

Deposit the original stone alongside the iron post.

S. 89°40' W., beginning new measurement.

By triangulation.

Desc. 150 ft. over ledgy W. slope through scattered
juniper and pinon.

- 5.06 Top of sandstone ledge, 100 ft. high, bears NW. and SE.;
desc. abruptly.

- 7.89 Point for the closing cor. of secs. 5 and 6, T. 23 S.,
R. 3 W., at proportionate dist.; there is no remaining
evidence of the original cor.

The point for the cor. falls at the base of the sand-
stone ledge.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., on
solid sandstone, and in a mound of stone, 4 ft. base
to top, with brass cap mkd.

T22S R3W

S35

86 S35

CC

T23S R3W

1963

Dependent Resurvey of a Portion of the South Boundary of T. 22 S., R. 3 W.

CHAINS

From which

A point on the ledge, 1 ft. up from the base of the ledge, bears West 4 lks. dist., and is mkd. XBO.

20.00 Spur, projects S.; desc. 70 ft. over W. slope.

30.00 Draw, drains SE.; asc. 30 ft. over NE. slope.

39.45 Point for the cor. of secs. 34 and 35, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
S34 S35
 T23S R3W
 S6
 1963

From which

A pinon, 12 ins. diam., bears N. $79^{\circ}50'$ W., 57 lks. dist., mkd. T22S R3W S34 BT.

There were no other suitable bearing trees available.

Land, mountainous.

Soil, rocky and gravelly.

Timber, juniper and pinon.

No undergrowth.

S. $89^{\circ}40'$ W., along the S. bdy. of sec. 34.

Over mountainous land through scattered pinon and juniper timber; asc. 40 ft. over SE. slope.

7.89 Point for the N. $\frac{1}{4}$ sec. cor. of sec. 6, T. 23 S., R. 3 W., at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T22S R3W
 $\frac{1}{4}$ S6
 T23S R3W
 1963

There were no suitable bearing trees available.

Thence by triangulation; asc. 260 ft. over SE. slope through dense juniper and pinon.

25.73 End of triangulation.

30.30 Spur, projects SE.; desc. 200 ft. over SW. slope.

39.45 The S. $\frac{1}{4}$ sec. cor. of sec. 34, monumented with an iron post, 1 in. diam., firmly set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the South Boundary of T. 22 S., R.

CHAINS

- N. $89^{\circ}11'$ W., beginning new measurement.
- Desc. 25 ft. over SW. slope.
- 1.20 Draw, drains SE.; asc. 120 ft. over NE. slope.
- 7.00 The closing cor. of Tps. 23 S., Rs. 3 and 4 W., monumented with an iron post, 3 ins. diam., firmly set, mkd. and witnessed as described in the official record.
- Thence by triangulation. Asc. 160 ft. over NE. slope.
- 14.30 Spur, projects SE.; desc. 140 ft. over SW. slope. End triangulation.
- 19.89 Point for the W. $1/16$ sec. cor. of sec. 34, at proportionate dist.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T22S R3W
W $1/16$ S34
1963
- There were no suitable bearing trees available.
- Thence by triangulation; desc. 80 ft. over SW. slope.
- 23.30 N. Fork of Willow Creek, small stream of water, 1 lk. wide, 1 in. deep, course SE.; asc. 80 ft. over NE. slope.
- 28.50 Spur, projects SE.; desc. 80 ft. over SW. slope.
- 35.30 Ravine, drains SE.; asc. 80 ft. over NE. slope.
- 39.78 End of triangulation.
- The cor. of secs 33 and 34, monumented with an iron post, 3 ins. diam., firmly set, mkd. and witnessed as described in the official record.
- Land, mountainous,
Soil, rocky and gravelly.
Timber, pinon, cedar, juniper, pine, fir and spruce.
Undergrowth, oak brush, sagebrush, and manzanita.

Dependent Resurvey of a Portion
of the
North Boundary of T. 22 S., R. 3 W.

- From the cor. of Tps. 21 and 22 S., R. 3 W., W. bdy. of T. 21 S., R. $2\frac{1}{2}$ W.
- N. $89^{\circ}55'$ W., bet. secs. 1 and 36.
- Over mountainous land through heavy sagebrush; desc. 90 ft. over W. slope.
- 7.90 Small draw, drains SW.; asc. 10 ft.
- 15.20 Spur, projects SW.; enter scattering spruce and mahogany; desc. 300 ft. over SW. slope.
- 26.30 Chokecherry Creek, stream of water 3 ins. deep, 3 lks. wide, flows S.; asc. 345 ft. over E. slope.

Re-survey of a Portion of the North Boundary of T. 22 S., R. 3 W.

38.60

Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 36, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R3W

$$\frac{1}{4} \frac{S36}{S1}$$

T22S

1963

From which

A cedar, 15 ins. diam., bears S. 24° W., 34 lks. dist., mkd, $\frac{1}{4}$ S1 BT.

There were no other suitable bearing trees available.

Asc. 100 ft. over E. slope through scattering mahogany.

47.30

Spur, projects S.; desc. 200 ft. over SW. slope.

50.40

Leave mahogany; thence by triangulation.

62.20

Draw, drains S.; medium dense aspen in bottom of draw; asc. 120 ft. over SE. slope.

67.20

Spur, projects SE.; desc. 80 ft. over SW. slope.

71.60

End of triangulation.

75.00

Draw, drains SE.; enter medium dense aspen; asc. 100 ft. over SE. slope.

77.20

Point for the cor. of secs. 1, 2, 35 and 36, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T21S R3W

$$\frac{S35}{S2} \frac{S36}{S1}$$

T22S

1963

There were no suitable bearing trees available.

Land, mountainous.

Soil, rocky and gravelly clay.

Timber, spruce and mahogany on slopes of Chokecherry Canyon; aspen in main draws.

Undergrowth, sagebrush.

N. $89^{\circ}55'$ W., bet. secs. 2 and 35.

Over mountainous land through scattered aspen; asc. 200 ft. over SE. slope.

8.60

Leave aspen.

13.10

Ridge, bears NE. and SW.; desc. 230 ft. over W. slope

Dependent Resurvey of a Portion of the North Boundary of T. 22 S., R. 3 E.

CHAINS

through heavy sagebrush.

14.80 Main access road, unimproved, bears NE. and SW.

15.30 Barbed wire fence, bears NE. and SW.

24.10 Enter medium dense aspen.

31.10 Draw, drains NE.; asc. 120 ft. over SE. slope, continuing through medium dense aspen.

38.60 Point for the $\frac{1}{4}$ sec. cor. of secs. 2 and 35, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R3W

 $\frac{1}{4}$ $\frac{S35}{S2}$ T22S
1963

There were no suitable bearing trees available.

Asc. 155 ft. over SE. slope through medium dense aspen.

46.60 Spur, projects SE.; top of steep ascent; asc. gradually to top of ridge.

70.80 Pole fence, bears NW. and SE.; top of ridge; desc. 25 ft. over SW. slope.

74.40 Unimproved dirt road, bears irregularly NW. and SE.

77.20 Point for the cor. of secs. 2, 3, 34 and 35, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R3W

 $\frac{S34}{S3}$ $\frac{S35}{S2}$ T22S
1963

Land, mountainous.

Soil, mostly rocky and gravelly.

Timber, aspen.

Undergrowth, sagebrush and grass.

N. $89^{\circ}55'$ W., bet. secs. 3 and 34.

Over mountainous land through dense sagebrush; desc. 365 ft. over SW. slope.

2.30 Enter aspen grove and heavy chokecherry.

10.30 Leave aspen and chokecherry.

38.60 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 34, at proportionate dist.; there is no remaining evidence of the original cor.

Dependent Resurvey of a Portion of the North Boundary of T. 22 S., R. 3 W.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R3W

$\frac{1}{4}$ $\frac{S34}{S3}$

T22S

1963

From which

An aspen, 10 ins. diam., bears N. 55° E., 80 lks. dist., mkd. $\frac{1}{4}$ S34 BT.

An aspen, 6 ins. diam., bears S. $81^{\circ}30'$ E., 66 lks. dist., mkd. $\frac{1}{4}$ S3 BT.

This cor. falls on top of a rocky spur that projects S.

Desc. 100 ft. over rocky SW. slope through medium sagebrush.

51.70 Draw, drains SE.; aspen in bottom of draw; asc. 40 ft. over NE. slope.

56.90 Small spur, projects S.; desc. 20 ft. over SW. slope; enter dense aspen.

69.30 Draw, drains SE.; asc. 220 ft. over rocky NE. slope, changing to E. slope; continue through dense aspen and chokecherry.

77.20 The cor. of secs. 3, 4, 33, and 34, monumented with a sandstone, 16x10x6 ins., firmly set and mkd. as described in the official record.

There was no remaining evidence of the original aspen bearing trees.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R3W

$\frac{S33}{S4} \frac{S34}{S3}$

T22S

1963

From which

An aspen, 8 ins. diam., bears N. $59^{\circ}15'$ E., 30 lks. dist., mkd. T21S R3W S34 BT.

An aspen, 6 ins. diam., bears S. 66° E., 25 lks. dist., mkd. T22S R3W S3 BT.

An aspen, 14 ins. diam., bears S. $3^{\circ}30'$ W., 12 lks. dist., mkd. T22S R3W S4 BT.

An aspen, 7 ins. diam., bears N. 32° W., 23 lks. dist., mkd. T21S R3W S33 BT.

Land, mountainous.

Dependent Resurvey of a Portion of the North Boundary of T. 22 S., R. 3 W.

CHAINS

MILAN

Soil, rocky and gravelly.
 Timber, aspen.
 Undergrowth, sagebrush and chokecherry.

Dependent Resurvey of a Portion
 of the
 Subdivision of T. 22 S., R. 3 W.

Re-establishment of the Survey Executed by John T.
 Brecken in 1896.

From the cor. of secs. 35 and 36, on the S. bdy. of the
 Tp. previously described.

N. 0°04' W., bet. secs. 35 and 36.

Over broken mountainous land through medium dense
 pinon and juniper; asc. 120 ft. over broken and ledgy
 E. slope.

11.04 Point for the 1/16 sec. cor. of secs. 35 and 36, at
 proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins.
 in the ground, and in a mound of stone, 3 ft. base to
 top, with brass cap mkd.

T22S R3W

1/16

S35|S36

140

1963

From which

A pinon, 14 ins. diam., bears S. 40° E., 41
 lks. dist., mkd. 1/16 140 S36 BT.

There were no other suitable bearing trees
 available.

Asc. 180 ft. over E. slope.

21.60 Head of draw, drains SE.; asc. 240 ft. over SW. slope.

29.60 Spur, projects SE.; desc. 20 ft. over NE. slope.

30.41 Point for the 1/16 sec. cor. of secs. 35 and 36, at
 proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., on
 solid rock, and in a mound of stone, 4 ft. base to
 top, with brass cap mkd.

T22S R3W

1/16

S35|S36

120

1963

Thence by triangulation. Desc. 40 ft. over NE. slope,
 through medium dense pinon and juniper.

36.00 Draw, drains SE.; asc. 240 ft. over SE. slope.

45.00 Ridge, bears NE. and W.; desc. 120 ft. over NW. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS		
49.78	<p>Point for the 1/16 sec. cor. of secs. 35 and 36, at proportionate dist.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T22S R3W 1/16 S35 S36 100 1963</p> <p>From which</p> <p>A pinon, 14 ins. diam., bears N. 45° W., 53 lks. dist., mkd. 1/16 100 S35 BT.</p> <p>There were no other suitable bearing trees available.</p> <p>Desc. 160 ft. along W. slope of spur; continue through medium dense pinon and juniper.</p>	
60.60	Top of spur, projects NW.; desc. 200 ft. over NE. slope.	
66.60	S. Cedar Ridge Canyon, drains NE.; asc. 80 ft. over SE. slope.	
69.15	<p>Point for the 1/16 sec. cor. of secs. 35 and 36 at proportionate dist.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T22S R3W 1/16 S35 S36 80 1963</p> <p>From which</p> <p>A pinon, 10 ins. diam., bears S. 55°30' E., 17 lks. dist., mkd. 1/16 80 S36 BT.</p> <p>There were no other suitable bearing trees available.</p> <p>Asc. 200 ft. over SE. slope.</p>	
80.00	Spur, projects E.; desc. 120 ft. over NE. slope.	
86.00	Draw, drains S. 70° E.; asc. 320 ft. over SW. slope.	
100.10	End of triangulation; spur, projects E.; desc. 180 ft. over NE. slope.	
106.50	Draw, drains E.; asc. 20 ft. over SE. slope.	
107.90	<p>Point for the ¼ sec. cor. of secs. 35 and 36, at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p>	

Dependent Resurvey of a Portion of the Subdivision of T. 22S, R. 3W, S. 35 & 36

CHAINS

T22S R3W

S35|S36
1963

From which

A cedar, 6 ins. diam., bears N. 88° E., 33
lks. dist., mkd. $\frac{1}{2}$ S36 BT.A cedar, 6 ins. diam., bears N. 85°45' W.,
27 lks. dist., mkd. $\frac{1}{2}$ S35 BT.

Asc. 80 ft. over SE. slope.

110.80 Spur, projects E.; desc. 80 ft. over NW. slope through
scattered spruce, cedar and pinon.

117.60 Draw, drains S. 80° E.; asc. 40 ft. over S. slope.

121.70 Point of ledge, 15 ft. high, bears E. and W.; asc.
200 ft. over SW. slope.127.27 Point for the N. 1/16 sec. cor. of secs. 35 and 36, at
proportionate dist.Set an iron post, 30 ins. long, 2½ ins. diam., 12 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S R3W

N 1/16
S35|S36
1963

From which

A cedar, 10 ins. diam., bears S. 20° W.,
20 lks. dist., mkd. N 1/16 S35 BT.There were no other suitable bearing trees
available.Asc. 140 ft. over SW. slope through medium pinon,
mahogany and cedar.133.90 Ridge, bears E. and W.; enter scattering spruce; desc.
360 ft. over N. slope.146.64 Point for the cor. of secs. 25, 26, 35 and 36, as
determined from the remaining original bearing trees:A dead pinon, 12 ins. diam., bears N. 80° W.,
16 lks. dist., scribe marks illegible.A spruce, 18 ins. diam., bears N. 18° E., 12
lks. dist., mkd. T22S R3W S25 BT.A pinon, 14 ins. diam., bears S. 15° W., 8
lks. dist., mkd. T22S R3W S35 BT.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 15 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

T22S R3W

S26 | S25S35 | S36

1963

From which new bearing trees:

A cedar, 10 ins. diam., bears S. 73°15' E.,
18 lks. dist., mkd. T22S R3W S36 BT.

A cedar, 14 ins. diam., bears N. 73°15' W.,
25 lks. dist., mkd. T22S R3W S26 BT.

Land, mountainous.

Soil, rocky and gravelly.

Timber, mostly pinon and juniper; spruce, pine and fir
in the canyons; mahogany on the higher ridges.

Undergrowth, sagebrush, oak brush and manzanita.

From the cor. of secs. 25 and 36, on the E. bdy. of the
Tp. previously described.

S. 85°50' W., bet. secs. 25 and 36.

Over mountainous and broken land through scattered pinon
and juniper; by triangulation; desc. 320 ft. over ledgy
SW. slope.

11.00 Ravine, drains S.; asc. 80 ft. over SE. slope.

14.50 Spur, projects S.; desc. 200 ft. over SW. slope.

28.00 Mill Canyon; wash, 10 ft. deep, 50 lks. wide, drains
SE.; enter dense spruce, pine and fir; asc. 150 ft.
over NE. slope.

39.56 End of triangulation.

The $\frac{1}{4}$ sec. cor. of secs. 25 and 36, monumented with a
sandstone, 26x10x3 ins., firmly set, mkd. and witnessed
as described in the official record.

From which the original bearing trees:

A fir, 40 ins. diam., bears S. 54°30' W., 12
lks. dist.; scribe marks were grown over and
illegible. (Record: S. 20° W., 18 lks.)

There was no remaining evidence of the other
bearing tree.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S R3W

 $\frac{1}{4}$ S25S36

1963

From which a new bearing tree:

A fir, 12 ins. diam., bears N. 34°30' E.,
32 lks. dist., mkd. T22S R3W $\frac{1}{4}$ S25 BT.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3

CHAINS

Deposit the original stone alongside the iron post.

N. 89°24' W., beginning new measurement.

Asc. over broken NE. slope of ridge through dense pine, spruce and fir.

Asc. 10 ft.

- 1.00 Spur, projects NE.; desc. 45 ft. over NW. slope.
- 2.30 Draw, drains N.; asc. 75 ft. over NE. slope.
- 7.90 Spur, projects N.; desc. 45 ft. over NW. slope.
- 12.10 Draw, drains N.; asc. 180 ft. over NE. slope.
- 19.50 Spur, projects N.; desc. 95 ft. over NW. slope.
- 25.10 Draw, drains N.; asc. 50 ft. over NE. slope,
- 28.80 Spur, projects N.; desc. 90 ft. over NW. slope.
- 34.40 Draw, drains N.; asc. 110 ft. over NE. slope.
- 38.40 Spur, projects N.; enter scattering mahogany, pinon, and cedar; desc. 10 ft. over NW. slope.
- 38.82 The cor. of secs. 25, 26, 35 and 36.

Land, mountainous.

Soil, rocky on E. slope of Mill Canyon; sandy loam and gravelly on W. slope.

Timber, scattered juniper, cedar, pinon and mahogany on E. slope of canyon; dense aspen in bottom of canyon; dense pine, spruce and fir on W. slope of canyon. Undergrowth, sagebrush and manzanita.

N. 2°30' W., bet. secs. 25 and 26.

Over mountainous land through dense pine, fir, spruce and mahogany; desc. 360 ft. over NW. slope, changing to N. slope.

- 12.30 Leave dense timber; continue through medium dense manzanita and scattering timber.
- 15.20 Mill Canyon; stream of water, 1 in. deep, 3 lks. wide, course, SE.; dense pine, fir and spruce in bottom of canyon; asc. 60 ft. over SW. slope.
- 19.87 Point for the S. 1/16 sec. cor. of secs. 25 and 26, at proportionate dist.
- Set an iron post, 30 ins. long, 2½ ins. diam., 8 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
- T22S R3W
S 1/16
S26/S25
1963
- Asc. 320 ft. over SW. slope.
- 32.70 Spur, projects SW.; desc. 50 ft. over NW. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

39.74 The $\frac{1}{4}$ sec. cor. of secs. 25 and 26, monumented with a limestone, 14x10x4 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$
S26 | S25
1963

From which

A cedar, 18 ins. diam., bears N. 80° E.,
13 lks. dist., mkd. $\frac{1}{4}$ S25 BT.

A cedar, 10 ins. diam., bears S. 45° W.,
15 lks. dist., mkd. $\frac{1}{4}$ S26 BT.

Deposit the original stone alongside the iron post.

N. 2°07' E., beginning new measurement.

Desc. 30 ft. over NW. slope through dense mahogany,
scattering cedar, and oak brush.

2.00 Draw, drains SW.; asc. 470 ft. over S. slope.

19.85 Point for the N. 1/16 sec. cor. of secs. 25 and 26, at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

N1/16
S26 | S25
1963

From which

A cedar, 8 ins. diam., bears N. 42° E.,
12 lks. dist., mkd. N1/16 S25 BT.

A cedar, 12 ins. diam., bears N. 85° W.,
24 lks. dist., mkd. N1/16 S26 BT.

Asc. 170 ft. over S. slope through dense mahogany and
scattering cedar.

25.70 Ridge, bears E. and W.; desc. 380 ft. over rocky N.
slope through scattering mahogany.

31.10 Sandstone ledge, 15 ft. high, bears E. and W.

33.00 Enter dense pine, spruce and fir.

39.70 The cor. of secs. 23, 24, 25 and 26, monumented with a limestone, 14x9x7 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

A spruce, 20 ins. diam., bears N. 85° E.,
18 lks. dist., mkd. T22S R3W S24 BT.

A pine, 22 ins. diam., bears S. 8° W., 33
lks. dist., mkd. T22S R3W S26 BT.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S R3W
S23 | S24
S26 | S25
1963

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, fir, spruce, mahogany and cedar.

Undergrowth, oak brush, sagebrush and manzanita.

From the cor. of secs. 24 and 25, on the E. bdy. of the
Tp. previously described.

S. 89°12' W., bet. secs. 24 and 25.

Over mountainous land through scattered mahogany and
pine; by traverse; asc. 10 ft. over E. slope.

.60 Spur, projects SW.; desc. 80 ft. over W. slope.

3.00 Base of spur, bears NE. and SW.; desc. gradually along
S. slope along bottom of Newt's Canyon, through medium
dense cedar.

19.57 Point for the E. 1/16 sec. cor. of secs. 24 and 25, at
proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins.
in the ground, and in a mound of stone, 5 ft. base to
top, with brass cap mkd.

T22S R3W
E1/16 S24
S25
1963

From which

A cedar, 12 ins. diam., bears S. 37°15' W.,
51 lks. dist., mkd. E1/16 S25 BT.

The cor. is located on the N. side of Newt's Canyon
which drains irregularly SE., and is 6 ft. deep, 20
lks. wide.

Continue along bottom of canyon.

23.50 Newt's Canyon, drains SE.; asc. 245 ft. over broken NE.
slope through dense pine, spruce, fir and cedar.

34.60 Small draw, drains NE.; continue to asc.

36.00 Small draw, drains NE.; continue to asc.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

39.14 Point for the $\frac{1}{4}$ sec. cor. of secs. 24 and 25, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$ $\frac{S24}{S25}$
1963

From which

A spruce, 18 ins. diam., bears N. 15° E., 24 lks. dist., mkd. $\frac{1}{4}$ S24 BT.

A spruce, 24 ins. diam., bears S. 10° W., 29 lks. dist., mkd. $\frac{1}{4}$ S25 BT.

Asc. 150 ft. over NE. slope through dense spruce, pine, fir and cedar.

50.70 Spur, projects NE.; desc. 30 ft. over NW. slope.

55.30 Draw, drains NE.; asc. 65 ft. over NE. slope.

58.71 Point for the W. $1/16$ sec. cor. of secs. 24 and 25, at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

W1/16 $\frac{S24}{S25}$
1963

From which

A spruce, 12 ins. diam., bears S. 5° W., 42 lks. dist., mkd. W1/16 S25 BT.

Asc. 125 ft. over NE. slope through dense pine, fir, spruce and cedar.

78.28 End of traverse.

The cor. of secs. 23, 24, 25 and 26.

Land, mountainous.

Soil, mostly rocky and gravelly.

Timber, pine, fir, spruce and cedar.

Undergrowth, sagebrush, oak brush and manzanita.

N. $4^{\circ}40'$ E., bet. secs. 23 and 24.

Desc. 200 ft. over steep N. slope through dense pine, spruce, fir and cedar, and scattering mahogany.

9.00 Bottom of canyon, drains E.; asc. 200 ft. over steep S. slope; continue through dense timber.

18.87 Point for the S. $1/16$ sec. cor. of secs. 23 and 24, at proportionate dist.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
S1/16
S23|S24
1963

From which

A mahogany, 6 ins. diam., bears S. 72° E., 5 lks. dist., mkd. S1/16 S24 BT.

A cedar, 5 ins. diam., bears N. 63° W., 11 lks. dist., mkd. S1/16 S23 BT.

Asc. 40 ft. over S. slope.

21.50 Spur, projects E.; thence by triangulation; desc. 200 ft. over steep NE. slope.

33.00 Newt's Canyon; small stream of water, course SE.; leave dense timber; enter scattering mahogany and cedar; asc. 240 ft. over steep SE. slope.

37.74 Point for the $\frac{1}{4}$ sec. cor. of secs. 23 and 24, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
 $\frac{1}{4}$
S23|S24
1963

From which

A cedar, 10 ins. diam., bears S. 62° E., 19 lks. dist., mkd. $\frac{1}{4}$ S BT.

There were no other suitable bearing trees available.

Asc. 200 ft. over SE. slope.

53.00 Ridge, bears SE. and NW.; thence across top of ridge.

56.61 End of triangulation.

Point for the N. 1/16 sec. cor. of secs. 23 and 24, at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
N1/16
S23|S24
1963

From which

A cedar, 10 ins. diam., bears S. 75° E., 34 lks. dist., mkd. N1/16 S24 BT.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS	<p>There were no other suitable bearing trees available.</p> <p>Desc. 180 ft. over NE. slope; enter dense spruce, fir, pine and cedar.</p> <p>75.48 The cor. of secs. 13, 14, 23 and 24, monumented with an iron post, 2½ ins. diam., firmly set, mkd. and witnessed as described in the 1961 record of the remonumented corners in T. 22 S., R. 3 W.</p> <p>Land, mountainous. Soil, rocky and gravelly. Timber, pine, spruce, fir, cedar, mahogany and pinon. Undergrowth, sagebrush, oak and manzanita.</p>
	<p>From the cor. of secs. 13 and 24 on the E. bdy. of the Tp., previously described.</p> <p>N. 88°44' W., bet. secs. 13 and 24.</p> <p>Over broken mountainous land through medium dense timber; by triangulation; asc. 240 ft. over N. slope through head of draw.</p> <p>6.00 Wash, 10 ft. deep, 20 lks. wide, drains NE.; slope changes to NE.</p> <p>11.60 End of triangulation; ridge, bears NW. and SE.; desc. 80 ft. over SW. slope through medium dense mahogany and juniper.</p> <p>15.20 Sandstone ledge, 15 ft. high, bears NW. and SE.</p> <p>17.20 Head of draw, drains S.; asc. 30 ft. over ledgy E. slope.</p> <p>24.20 Spur, projects S.; desc. 100 ft. over SW. slope.</p> <p>28.40 Head of draw, drains SW.; desc. 125 ft. along ledgy S. slope.</p> <p>33.20 Point of spur, projects W.; desc. 140 ft. over W. slope.</p> <p>34.20 Top of ledge, 20 ft. high, bears N. and S.</p> <p>36.32 Point for the ¼ sec. cor. of secs. 13 and 24, at proportionate dist.; there was no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 2 ft. base to top, with brass cap mkd.</p>
	<p style="text-align: center;">T22S R3W ¼ $\frac{S13}{S24}$ 1963</p> <p>This cor. falls on the point of a small spur that projects W.; there were no suitable bearing trees available.</p> <p>Desc. 340 ft. over W. slope through medium dense mahogany, cedar, juniper, spruce, pine and fir.</p> <p>50.00 Draw, drains S.; asc. 80 ft. over SE. slope.</p> <p>54.10 Dirt road, unimproved, bears irregularly N. and S.</p> <p>54.48 Point for the W. 1/16 sec. cor. of secs. 13 and 24, at proportionate dist.</p>

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W

CHAINS	
	<p>Set an iron post, 30 ins. long, 2½ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T22S R3W W1/16 S13 S24 1963</p> <p>There were no suitable bearing trees available.</p> <p>Asc. 80 ft. over SE. slope; continuing through medium dense timber.</p>
56.90	Spur, projects SW.; desc. 40 ft. over W. slope.
60.00	Draw, drains S.; asc. 40 ft. over SE. slope.
63.60	Spur, projects S.; desc. 90 ft. over SW. slope.
70.80	Draw, drains SE.; asc. 50 ft. over NE. slope.
72.64	The cor. of secs. 13, 14, 23 and 24.
	<p>Land, mountainous. Soil, rocky and gravelly. Timber, pinon, cedar, juniper and mahogany on entire mile pine, spruce and fir on W. ½ mile. Undergrowth, oak brush, sagebrush and manzanita.</p>
	<p>N. 0°10' E., bet. secs. 13 and 14.</p> <p>Over mountainous land through dense pine, spruce, fir, cedar and mahogany.</p> <p>Desc. 70 ft. over NE. slope.</p>
5.50	Draw, drains irregularly SE.; asc. 280 ft. over steep SE. slope.
19.55	<p>Point for the S. 1/16 sec. cor. of sec. 13 and 14, at proportionate dist.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T22S R3W S1/16 S14 S13 1963</p> <p>From which</p> <p style="padding-left: 40px;">A cedar, 10 ins. diam., bears S. 45°10' E., 19 lks. dist., mkd. S1/16 S13 BT.</p> <p style="padding-left: 40px;">A cedar, 14 ins. diam., bears N. 58°20' W., 15 lks. dist., mkd. S1/16 S14 BT.</p> <p>Asc. 310 ft. over SE. slope; continue through dense timber.</p>
25.00	Road, unimproved, bears NE. and SW. approximately 3 chs. thence curves NE.
26.40	Same road, bears SE. approximately 4.00 chs., and NE.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

- 37.80 Small spur, projects E.; desc. 10 ft. over gentle NE. slope.
- 39.10 The $\frac{1}{4}$ sec. cor. of secs. 13 and 14, monumented with an iron post, $2\frac{1}{2}$ ins. diam., firmly set, mkd. and witnessed as described in the 1961 record of remonumented corners in T. 22 S., R. 3 W.
- N. $0^{\circ}08'$ W., beginning new measurement.
- Desc. gradually over gentle NE. slope.
- 1.50 Small draw, drains E.; asc. 65 ft. over S. slope.
- 7.10 Ridge, bears E. and W.; desc. 120 ft. over NE. slope.
- 10.10 Leave timber; thence through heavy sagebrush.
- 17.50 Enter dense aspen, spruce, cedar, fir and pine.
- 20.50 Leave dense timber; road, unimproved, bears W. and E. to Strawberry Canyon; thence through scattering juniper and cedar.
- 26.50 Head of draw, drains E.; asc. 140 ft. over SE. slope.
- 40.01 The cor. of secs. 11, 12, 13 and 14, monumented with an iron post, $2\frac{1}{2}$ ins. diam., firmly set, mkd. and witnessed as described in the 1961 record of the remonumented corners in T. 22 S., R. 3 W.
- Land, mountainous.
Soil, mostly rocky and gravelly; sandy loam in timbered areas.
Timber, pine, spruce, fir, cedar and aspen.
Undergrowth, chokecherry, sagebrush and manzanita.
- From the cor. of secs. 12 and 13, on the E. bdy. of the Tp., previously described.
- West, bet. secs. 12 and 13.
- Over mountainous land through scattering fir, spruce, pine, and dense mahogany, oak brush and manzanita; asc. 40 ft. over E. slope.
- 6.50 Spur, projects S.; desc. 60 ft. over SW. slope.
- 14.00 Draw, drains S.; asc. 40 ft. over SE. slope.
- 18.17 Point for the E. $1/16$ sec. cor. of secs. 12 and 13, at proportionate dist.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T22S R3W
E1/16 $\frac{S12}{S13}$
1963
- This cor. is located on the E. edge of a small spur and at the base of a small ledge, 3 ft. high that bears N. and S.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

- 20.00 Spur, projects S.; desc. 45 ft. over W. slope.
- 26.28 Draw, drains S.; asc. 50 ft. over E. slope.
- 30.10 Spur, projects S.; desc. 110 ft. over W. slope.
- 35.00 Ravine, drains SE.; enter dense pine, spruce, fir and aspen; asc. 25 ft. over E. slope.
- 36.34 Point for the $\frac{1}{4}$ sec. cor. of secs. 12 and 13, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$ $\frac{S12}{S13}$

1963

From which

A spruce, 10 ins. diam., bears S. 15° E., 33 lks. dist., mkd. T22S R3W $\frac{1}{4}$ S13 BT.

A spruce, 8 ins. diam., bears N. 50° W., 24 lks. dist., mkd. T22S R3W $\frac{1}{4}$ S12 BT.

Asc. 145 ft. over E. slope.

- 41.90 Spur, projects SE.; desc. 15 ft. over SW. slope.
- 46.60 Draw, drains SE.; asc. 135 ft. over steep E. slope.
- 51.00 Top of steep ascent; leave dense timber; asc. 160 ft. over SE. slope through scattering juniper and heavy sagebrush.
- 64.80 Wash, 3 ft. deep, 10 lks. wide, drains SE.
- 66.90 Enter dense mahogany, cedar and aspen.
- 72.68 The cor. of secs. 11, 12, 13 and 14.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, fir, spruce, cedar, mahogany, aspen and juniper.

Undergrowth, sagebrush, oak brush and manzanita.

N. $0^{\circ}24'$ E., bet. secs. 11 and 12.

Over mountainous land through dense aspen timber; asc. 155 ft. over SE. slope.

- 9.90 Leave timber.
- 15.80 Barbed wire fence, bears NE. and SW.
- 17.80 Small wash, drains NE.
- 20.14 Point for the S. $1/16$ sec. cor. of secs. 11 and 12, at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

T22S R3W

S1/16

S11|S12

1963

Raise a mound of stone, 3 ft. base, 3 ft. high, W. of cor.

Asc. 160 ft. over SE. slope through dense sagebrush.

23.20 Road, graded, bears NE. and SW.

40.28 The $\frac{1}{4}$ sec. cor. of secs. 11 and 12, monumented with a sandstone, 14x8x5 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T22S R3W

 $\frac{1}{4}$

S11|S12

1963

Deposit the original stone alongside the iron post and raise a mound of stone, 3 ft. base, 3 ft. high, W. of cor.

N. $1^{\circ}01'$ E., beginning new measurement.

Asc. 20 ft. over SE. slope.

3.80 Ridge, bears NE. and SW.; thence by triangulation; desc. 320 ft. over NW. slope through dense spruce and pine.

34.50 The cor. of secs. 1, 2, 11 and 12, monumented with a sandstone, 16x10x6 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A spruce, 12 ins. diam., bears N. $0^{\circ}40'$ E., 82 lks. dist., mkd. T22S R3W S1 BT. (Record bearing: N. 16° E.)

A spruce, 30 ins. diam., bears S. $27^{\circ}45'$ W., 43 lks. dist., mkd. T22S R3W S11 BT. (Record: S. $34^{\circ}45'$ W., 30 lks.)

A spruce, 20 ins. diam., bears N. $4^{\circ}15'$ W., 61 lks. dist., mkd. T22S R3W S2 BT. (Record: N. $2^{\circ}40'$ W., 64 lks.)

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

S2|S1

S11|S12

1963

From which a new bearing tree:

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

A spruce, 6 ins. diam., bears S. 75°45' E.,
39 lks. dist., mkd. T22S R3W S12 BT.

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, aspen, spruce, pine and scattering mahogany.

Undergrowth, sagebrush.

From the cor. of secs. 1 and 12, on the E. bdy. of
the Tp., previously described.

S. 85°45' W., bet. secs. 1 and 12.

Over mountainous land through dense aspen timber.

Asc. 300 ft. over N. slope.

9.60 Head of draw, drains E.; continue ascent over E. slope.

17.80 Point for the E. 1/16 sec. cor of secs. 1 and 12, at
proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S R3W
E1/16 $\frac{S1}{S12}$
1963

Asc. 90 ft. over E. slope; leave aspen.

24.50 Ridge, bears N. and S.; scattering mahogany along top
or ridge; desc. 115 ft. over W. slope through dense
sagebrush.

24.80 Old fence line, bears N. and S.

25.40 Road, graded, bears N. and S.

27.40 Barbed wire fence, bears N. and S.

35.60 Point for the ¼ sec. cor. of secs. 1 and 12, at propor-
tionate dist.; there is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S R3W
¼ $\frac{S1}{S12}$
1963

Desc. 260 ft. over W. slope.

51.50 Branch of Chokecherry Creek; stream 2 lks. wide, 3 ins.
deep, course NW.; asc. 120 ft. over N. slope; enter
dense spruce, pine, and aspen.

69.00 Spur, projects NW.; desc. 80 ft. over W. slope.

71.20 The cor. of sec's. 1, 2, 11 and 12.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS	Land, mountainous. Soil, rocky and gravelly. Timber, spruce, pine, aspen and mahogany. Undergrowth, sagebrush, chokecherry, manzanita and grass.
	N. 4°14' W., bet. secs. 1 and 2. Over mountainous land through dense pine and spruce; by triangulation; desc. 160 ft. over W. slope.
10.50	Branch of Chokecherry Creek; stream of water, 2 lks. wide, 3 ins. deep, course W.; leave pine and spruce; enter scattering cedar and mahogany; asc. 80 ft. over S. slope.
13.50	Spur, projects W.; desc. 80 ft. over NW. slope.
21.00	Chokecherry Creek; stream of water, 3 lks. wide, 3 ins. deep, course SW.; asc. 320 ft. over SE. slope.
38.00	Spur, projects E.; desc. 40 ft. over NE. slope.
	End of triangulation.
42.54	Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 2, at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T22S R3W $\frac{1}{4}$ S2 S1 1963
	From which An aspen, 12 ins. diam., bears S. 26° E., 56 lks. dist., mkd. $\frac{1}{4}$ S1 BT. An aspen, 10 ins. diam., bears N. 23° W., 25 lks. dist., mkd. $\frac{1}{4}$ S2 BT.
43.00	Draw, drains SE.; asc. 150 ft. over SW. slope.
50.00	Spur, projects SE.; asc. 520 ft. over broken SE. slope.
63.50	Draw, drains SE.
85.28	The cor. of secs. 1, 2, 35 and 36 on the N. bdy. of the Tp., previously described. Land, mountainous. Soil, rocky and gravelly. Timber, spruce, pine, aspen, mahogany and cedar. Undergrowth, sagebrush, chokecherry, manzanita and grass.
	From the cor. of secs. 34 and 35 on the S. bdy. of the Tp., previously described. N. 0°22' W., bet. secs. 34 and 35. Over mountainous land through scattered pinon and cedar timber; asc. 40 ft. over S. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

- 2.30 Spur, projects SE.; thence by triangulation; desc. 100 ft. over NE. slope.
- 8.50 Ravine, drains SE.; asc. 40 ft. over SW. slope.
- 11.08 Point for the 1/16 sec. cor. of secs. 34 and 35 at proportionate dist.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock and in a mound of stone, 5 ft. base to top, with brass cap mkd.
- T22S R3W
1/16
S34|S35
140
1963
- Asc. 160 ft. over SW. slope.
- 19.50 Spur, projects SE.; desc. 80 ft. over NE. slope.
- 30.00 Draw, drains SE.; asc. 20 ft. over S. slope.
- 30.51 Point for the 1/16 sec. cor. of secs. 34 and 35 at proportionate dist.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T22S R3W
1/16
S34|S35
120
1963
- Asc. 480 ft. over S. slope.
- 49.95 Point for the 1/16 sec. cor. of secs. 34 and 35 at proportionate dist.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T22S R3W
1/16
S34|S35
100
1963
- Asc. 200 ft. over S. slope.
- 55.50 Ridge, bears E. and W.; desc. 400 ft. over N. slope.
- 68.00 South Cedar Ridge Canyon; stream of water, 2 lks. wide, 1 in. deep, course E.; asc. 40 ft. over S. slope.
- 69.39 Point for the 1/16 sec. cor. of secs. 34 and 35 at proportionate dist.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS		
88.82	<p style="text-align: center;">T22S R3W 1/16 S34 S35 80 1963</p> <p>Asc. 280 ft. over SW. slope.</p> <p>Point for the S. 1/16 sec. cor. of secs. 34 and 35, at proportionate dist.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 15 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p>	
108.26	<p style="text-align: center;">T22S R3W S1/16 S34 S35 1963</p> <p>Asc. 480 ft. over SW. slope.</p> <p>End of triangulation.</p> <p>Point for the ¼ sec. cor. of secs. 34 and 35 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 8 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p>	
118.70	<p style="text-align: center;">T22S R3W ¼ S34 S35 1963</p> <p>Asc. 160 ft. over SW. slope.</p> <p>Ridge, bears E. and W.; enter scattering spruce, pine, cedar, and mahogany; desc. 360 ft. along W. slope along E. side of wash in bottom of draw draining irregularly N.</p>	
127.69	<p>Point for the N. 1/16 sec. cor. of secs. 34 and 35 at proportionate dist.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 5 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.</p>	
132.00 147.13	<p style="text-align: center;">T22S R3W N1/16 S34 S35 1963</p> <p>From which</p> <p style="padding-left: 40px;">A spruce, 12 ins. diam., bears S. 58° E., 24 lks. dist., mkd. N1/16 S35 BT.</p> <p style="padding-left: 40px;">A spruce, 24 ins. diam., bears N. 58° W., 17 lks. dist., mkd. N1/16 S34 BT.</p> <p>Desc. 240 ft. over N. slope.</p> <p>Enter dense spruce, mahogany, cedar and aspen.</p> <p>The cor. of secs. 26, 27, 34 and 35, monumented with a sandstone, 20x14x6 ins., firmly set, mkd. and witnessed as described in the official record.</p>	

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

From which the original bearing trees:

An aspen, 12 ins. diam., bears N. 85° E.,
10 lks. dist., mkd. T22S R3W S26 BT.

An aspen, 10 ins. diam., bears S. 4° W.,
6 lks. dist., mkd. T22S R3W S34 BT.

An aspen, 12 ins. diam., bears N. 46° W.,
45 lks. dist.; scribe marks are illegible.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in
the ground, and in a mound of stone, 3 ft. base to top,
with brass cap mkd.

T22S R3W
S27 | S26
S34 | S35
1963

From which a new bearing tree:

A pine, 24 ins. diam., bears N. 48° W.,
57 lks. dist., mkd. T22S R3W S27 BT.

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, spruce, pine, aspen, mahogany and cedar.

Undergrowth, sagebrush, chokecherry, manzanita and grass.

From the cor. of secs. 25, 26, 35 and 36.

N. 88°28' W., bet. secs. 26 and 35.

Over mountainous land through dense spruce, pine, pinon,
cedar and mahogany; desc. 33 ft. over NW. slope.

- 1.60 Draw, drains NE.; asc. 235 ft. over broken NE. slope.
3.90 Spur, projects NE.
7.00 Draw, drains NE.
16.70 Spur, projects NE.; desc. 15 ft. over NW. slope.
19.58 Point for the E. 1/16 sec. cor. of secs. 26 and 35 at
proportionate dist.

Set an iron post, 30 ins. long, 2½ ins. diam., 5 ins. in
the ground, and in a mound of stone, 4 ft. base to top,
with brass cap mkd.

T22S R3W
E1/16 S26
S35
1963

There were no suitable bearing trees available.

Desc. 15 ft. over NW. slope.

- 20.80 Draw, drains N.; asc. 20 ft. over NE. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS	
21.90	Spur, projects N.; thence by triangulation; desc. 160 ft. over NW. slope.
30.50	Draw, drains N.; asc. 200 ft. over NE. slope.
39.16	<p>Point for the $\frac{1}{2}$ sec. cor. of secs. 26 and 35 at proportionate dist.; there is no remaining evidence of the original cor. End triangulation.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 2 ins. in the ground to solid rock, and in a mound of stone, 6 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T22S R3W $\frac{1}{2}$ $\frac{S26}{S35}$ 1963</p> <p>From which</p> <p>A cedar, 24 ins. diam., bears S. 40° W., 46 lks. dist., mkd. $\frac{1}{2}$ S BT.</p> <p>There were no other suitable bearing trees available.</p>
39.80	Spur, projects NE.; desc. 160 ft. over broken NW. slope.
54.00	Ravine, drains NE.; asc. 240 ft. over broken NE. slope.
60.30	Spur, projects NE.; desc. 145 ft. over broken NW. slope.
70.00	Small draw, drains NE.
71.60	Small spur, projects N.
78.32	<p>The cor. of secs. 26, 27, 34 and 35.</p> <p>Land, mountainous. Soil, rocky and gravelly. Timber, spruce, pine, cedar, pinon and mahogany. Undergrowth, sagebrush, chokecherry, manzanita and grass.</p>
	N. $0^\circ 16'$ E., bet. secs. 26 and 27.
	Over mountainous land through medium dense aspen and spruce timber. By triangulation; desc. gradually along bottom of draw on E. side, of small wash, drains N.
1.00	Same wash, drains NE.; asc. 60 ft. over SE. slope through medium dense spruce, pine, cedar, aspen and mahogany.
7.50	Spur, projects NE.; desc. 200 ft. over N. slope.
16.00	Mill Canyon; stream of water, 2 lks. wide, 2 ins. deep, course E.; asc. 80 ft. over S. slope.
19.32	<p>Point for the S. $\frac{1}{16}$ sec. cor. of secs. 26 and 27 at proportionate dist.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T22S R3W S1/16 S27/S26 1963</p>
20.50	Spur, projects E.; desc. 80 ft. over NE. slope. End triangulation.
25.00	Small canyon, drains SE.; asc. 360 ft. over SW. slope.
38.64	<p>The $\frac{1}{2}$ sec. cor. of secs. 26 and 27, monumented with a sandstone, 20x9x6 ins., firmly set, mkd. and witnessed as described in the official record.</p> <p>From which the original bearing tree:</p> <p>A dead pinon, 12 ins. diam., bears S. 40° W., 22 lks. dist., mkd. $\frac{1}{2}$ S BT.</p>

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T22S R3W

 $\frac{1}{4}$
 S27|S26
 1963

From which a new bearing tree:

A cedar, 24 ins. diam., bears S. 80° E., 20 lks. dist., mkd. $\frac{1}{4}$ SBT.

Deposit the original stone alongside the iron post.

N. $8^{\circ}33'$ W., beginning new measurement.

Asc. 200 ft. over SW. slope.

12.50

Spur, projects SE.; asc. 200 ft. over NE. slope.

39.74

The cor. of secs. 22, 23, 26 and 27, monumented with a limestone, 12x10x6 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

 $\frac{1}{4}$
 S22|S23
 S27|S26
 1963

From which

A spruce, 14 ins. diam., bears N. $72^{\circ}50'$ E., 226 lks. dist., mkd. T22S R3W S23 BT.

There were no other suitable bearing trees available.

Deposit the original stone alongside the iron post.
Cor. falls in old E. - W. fence line.

Land, mountainous.

Soil, rocky and gravelly.

Timber, spruce, pine, cedar, mahogany and aspen.

Undergrowth, sagebrush, chokecherry and manzanita.

Re-establishment of the survey Executed by John T. Brecken in 1896

From the cor. of secs. 23, 24, 25 and 26.

N. $89^{\circ}20'$ W., bet. secs. 23 and 26.

Over mountainous land through dense pine, spruce, fir and cedar timber; desc. 60 ft. over N. slope.

2.60

Draw, drains NE.; asc. 280 ft. over NE. slope.

16.00

Ridge, bears NW. and SE.; asc. 120 ft. over SE. slope.
Cor. of fence bears N. 12 lks. dist., with fence bearing SE. and irregularly W.; thence parallel to fence.

33.30

Enter dense mahogany.

38.20

Spur, projects SE.; desc. 50 ft. over SW. slope.

40.46

The $\frac{1}{4}$ sec. cor. of secs. 23 and 26, monumented with a limestone, 18x14x8 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

T22S R3W

 $\frac{1}{2}$ $\frac{S23}{S26}$
1963

From which

A mahogany, 10 ins. diam., bears S. 12° W., 24 lks. dist., mkd. $\frac{1}{2}$ S26 BT.

A mahogany, 5 ins. diam., bears N. 29° W., 24 lks. dist., mkd. $\frac{1}{2}$ S23 BT.

Deposit the original stone alongside the iron post.

N. 89°53' W., beginning new measurement.

Desc. 40 ft. over SW. slope through dense mahogany; along fence line.

2.00 Head of draw, drains S.; asc. 40 ft. over SE. slope.

6.30 Spur, projects SE.; thence by triangulation; desc. 120 ft. over SW. slope.

16.50 Ravine, drains SE.; asc. 120 ft. over NE. slope.

21.58 Point for the W. 1/16 sec. cor. of secs. 23 and 26 at proportionate dist. End triangulation.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T22S R3W

 $\frac{W1}{16}$ $\frac{S23}{S26}$
1963

From which

A fir, 18 ins. diam., bears N. 1°45' E., 82 lks. dist., mkd. W1/16 S23 BT.

A fir, 12 ins. diam., bears S. 15°30' W., 39 lks. dist., mkd. W1/16 S26 BT.

Asc. 160 ft. over NE. slope through dense fir, spruce and cedar.

29.00 Slope changes to E.; asc. 320 ft.

43.16 The cor. of secs. 22, 23, 26 and 27.

Land, mountainous.

Soil, rocky and gravelly.

Timber, fir, pine, spruce, cedar and mahogany.

Undergrowth, sagebrush, oak brush, chokecherry, manzanita.

Re-establishment of the Survey Executed by A. J. Stewart, Jr. in 1874

N. 6°54' E., bet. secs. 22 and 23.

Over mountainous land along E. slope through dense aspen scattering spruce, fir, pine and cedar, and heavy undergrowth of oak and chokecherry.

15.00 Head of small draw, drains E.

22.00 Head of draw, drains SE.; asc. 80 ft. over SE. slope.

37.47 Point for the $\frac{1}{2}$ sec. cor. of secs. 22 and 23 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T22S R3W

 $\frac{1}{2}$ $\frac{S22}{S23}$

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

From which

An aspen, 8 ins. diam., bears N. 3° E., 19 lks. dist., mkd. $\frac{1}{4}$ S23 BT.

An aspen, 10 ins. diam., bears N. 70°15' W., 38 lks. dist., mkd. $\frac{1}{4}$ S22 BT.

Asc. 50 ft. over SE. slope.

49.50 Road, graded, bears NE. and SW.

57.50 Spur, projects E.; desc. 280 ft. over NW. slope.

74.94 The cor. of secs. 14, 15, 22 and 23, monumented with a sandstone, 16x10x6 ins., firmly set, mkd. and witnessed as described in the official record; there is no remaining evidence of the original bearing trees.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T22S R3W

S15 | S14

S22 | S23

1963

From which

An aspen, 10 ins. diam., bears N. 12°30' E., 47 lks. dist., mkd. T22S R3W S14 BT.

A spruce, 20 ins. diam., bears S. 26°10' E., 72 lks. dist., mkd. T22S R3W S23 BT.

An aspen, 8 ins. diam., bears S. 54°40' W., 5 lks. dist., mkd. T22S R3W S22 BT.

An aspen, 10 ins. diam., bears N. 77° W., 29 lks. dist., mkd. T22S R3W S15 BT.

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, dense aspen and scattering spruce, fir, pine and cedar.

Undergrowth, sagebrush, chokecherry, oak brush and manzanita.

Re-establishment of the Survey Executed by John T. Brecken in 1896

From the cor. of secs. 13, 14, 23 and 24, previously described.

N. 89°57' W., bet. secs. 14 and 23.

Over mountainous land; asc. 320 ft. over NE. slope through dense pine, spruce, fir and cedar.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

- 16.40 Low ridge, bears NW. and SE.; desc. 15 ft. over SW. slope.
- 19.70 Small draw, drains SE.
- 19.89 Point for the E. 1/16 sec. cor. of secs. 14 and 23 at proportionate dist.
- Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
E1/16 $\frac{S14}{S23}$
1963

From which

A cedar, 10 ins. diam., bears S. 33°30' W.,
116 lks. dist., mkd E1/16 S23 BT.

A cedar, 8 ins. diam., bears N. 25°50' W.,
16 lks. dist., mkd. E1/16 S14 BT.

Asc. 170 ft. over broken SE. slope.

- 22.30 Small spur, projects SE.
- 25.50 Small draw, drains SE.
- 28.70 Small spur, projects SE.
- 35.80 Wash, 6 ft. deep, 30 lks. wide, drains SE.
- 39.78 The ¼ sec. cor. of secs. 14 and 23, monumented with a sandstone, 12x12x2 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing tree:

A spruce, 24 ins. diam., bears S. 13°20' E.,
50 lks. dist., mkd. ¼ S BT. (Record bearing:
S. 15° E.)

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T22S R3W
¼ $\frac{S14}{S23}$
1963

From which a new bearing tree:

A cedar, 8 ins. diam.; bears N. 54°50' W.,
124 lks. dist., mkd. ¼ S14 BT.

Deposit the original stone alongside the iron post.

S. 89°25' W., beginning new measurement.

Asc. 80 ft. over SE. slope; leave timber which bears N. & S.; enter dense sagebrush.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S. R. 3 W.

CHAINS

0.30	Fence, bears NW. and SE.
7.90	Low spur, projects SW.; thence by triangulation; asc. 80 ft. over SE. slope.
13.00	Ridge, bears NE. and SW.
13.10	Barbed wire fence, bears NE. and SW.
13.30	Road, graded, bears irregularly NE. and SW.; desc. 80 ft. over SW. slope. Enter dense aspen timber.
15.90	Head of Nephi Canyon, drains NW.; asc. 160 ft. over NE. slope.
34.00	Point of spur, projects N.; end of triangulation; desc. 80 ft. over NW. slope.
34.85	Road, graded, curves SE. and SW.
40.85	The cor. of secs. 14, 15, 22 and 23. Land, mountainous. Soil, rocky and gravelly. Timber, fir, spruce, pine, cedar and aspen. Undergrowth, chokecherry, oak brush, sagebrush and manzanita.
	N. 0°23' E., bet. secs. 14 and 15. Over mountain land through dense aspen timber. By triangulation; desc. 240 ft. over NW. slope.
7.40	Draw, drains NE.; asc. 200 ft. over SE. slope.
20.00	Spur, projects NE.; desc. 480 ft. over NE. slope; enter medium dense pine, spruce, fir and cedar.
38.68	End of triangulation. Point for the $\frac{1}{2}$ sec. cor. of secs. 14 and 15 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2½ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd. T22S R3W $\frac{1}{2}$ S15 S14 1963 From which A pine, 16 ins. diam., bears S. 34°05' E., 34 lks. dist., mkd. $\frac{1}{2}$ S14 BT. A pine, 12 ins. diam., bears N. 23°55' W., 24 lks. dist., mkd. $\frac{1}{2}$ S15 BT. Desc. 120 ft. over NE. slope.
41.50	Nephi Canyon; stream of water, 3 lks. wide, 2 ins. deep, course NW.; asc. 140 ft. over SW. slope.
50.40	Spur, projects W.; desc. 20 ft. over N. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

53.50 Draw, drains SW.; asc. 250 ft. over SE. slope.

77.00 Spur, projects W.; desc. 15 ft. over NW. slope.

77.36 The cor. of secs. 10, 11, 14 and 15, monumented with a sandstone, 16x6x3 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A spruce, 20 ins. diam., bears N. 20° E., 30 lks. dist., mkd T22S R3W S11 BT. (Record: N. 10° E., 27 lks. dist.)

A spruce, 10 ins. diam., bears S. 88° E., 32 lks. dist., mkd T22S R3W S14 BT.

A spruce, fallen and decayed, bears S. 15° W., 30 lks. dist., mkd T22S R3W S15 BT.

There is no remaining evidence of the other original bearing tree.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T22S	R3W
S10	S11
S15	S14
1963	

From which a new bearing tree:

A spruce, 8 ins. diam., bears S. 48° W., 46 lks. dist., mkd T22S R3W S15 BT.

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, fir, pine, spruce, cedar and aspen.

Undergrowth, chokecherry, sagebrush, oak brush and manzanita.

From the cor. of 11, 12, 13 and 14.

S. 88°33' W., bet. secs. 11 and 14.

Over mountainous land through scattered aspen timber; asc. 35 ft. over SE. slope.

1.50 Barbed wire fence, bears N. and S.; leave aspen.

6.70 Road, graded, bears N. and SE.

11.30 Ridge, bears N. and S.; desc. 485 ft. over broken SW. slope.

25.00 Enter dense mahogany and spruce.

40.06 Point for the ¼ sec. cor. of secs. 11 and 14 at proportionate dist.; there is no remaining evidence of the original cor.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$ $\frac{S11}{S14}$

1963

From which

A cedar, 24 ins. diam., bears N. $22^{\circ}35'$ E., 92 lks. dist., mkd. $\frac{1}{4}$ S11 BT.

A pine, 12 ins. diam., bears S. $46^{\circ}55'$ E., 56 lks. dist., mkd. $\frac{1}{4}$ S14 BT.

Thence by triangulation; desc. 160 ft. over SW. slope.

47.00 Canyon, drains NW.; asc. 480 ft. over NE. slope.

77.20 Point of spur, projects N. 70° W.; desc. 40 ft. along N. slope. End triangulation.

80.12 The cor. of secs. 10, 11, 14 and 15.

Land, mountainous.

Soil, rocky and gravelly.

Timber, fir, spruce, pine, cedar and mahogany.

Undergrowth, chokecherry, sagebrush, manzanita and oak brush.

N. $0^{\circ}27'$ W., bet. secs. 10 and 11.

Over mountainous land. By triangulation; desc. 800 ft. over steep NW. slope through medium dense spruce, pine, fir and cedar.

23.00 Chokecherry Creek; stream of water, 5 lks. wide, 4 ins. deep, course SW.; asc. 640 ft. over SE. slope.

39.98 Point for the $\frac{1}{4}$ sec. cor. of secs. 10 and 11 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$ $\frac{S10}{S11}$

1963

There were no suitable bearing trees available.

Asc. 80 ft. over SE. slope.

42.30 High spur, projects SW.; desc. 320 ft. over NW. slope.

66.00 Water Canyon; stream of water, 2 lks. wide, 3 ins. deep, course SW.; asc. 440 ft. over SE. slope.

79.96 End of triangulation.

The cor. of secs. 2, 3, 10 and 11, monumented with a sandstone, 20x12x6 ins., firmly set, mkd. and witnessed

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T22S R3W
 $\frac{S3}{S10} \frac{S2}{S11}$
 1963

From which

A cedar, 14 ins. diam., bears S. 18° E., 22 lks. dist., mkd. T22S R3W S11 BT.

There were no other suitable bearing trees available.

Deposit the original stone alongside the iron post.

The cor. is located at the base of a sandstone ledge, 10 ft. high, bearing N. and S.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, fir, spruce and cedar.

Undergrowth, chokecherry, oak brush, manzanita and sagebrush.

From the cor. of secs. 1, 2, 11 and 12.

N. $87^\circ 45'$ W., bet. secs. 2 and 11.

Over mountainous land. By triangulation; desc. 700 ft. over NW. slope through dense fir, spruce, pine and aspen.

16.00 Chokecherry Creek; stream of water, 5 lks. wide, 3 ins. deep, course SW.; leave dense timber; enter heavy oak brush and chokecherry; asc. 320 ft. over broken SE. slope.

20.00 Draw, drains SE.

27.00 Spur, projects SE.; desc. 80 ft. over SW. slope.

34.50 Ravine, drains SE.; enter scattering mahogany and cedar; asc. 200 ft. over E. slope.

39.50 Spur, projects S. End triangulation; desc. 20 ft. over W. slope.

40.94 Point for the $\frac{1}{4}$ sec. cor. of secs. 2 and 11 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
 $\frac{1}{4} \frac{S2}{S11}$
 1963

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

From which

A mahogany, 8 ins. diam., bears N. 26°10' E.,
60 lks. dist., mkd. $\frac{1}{4}$ S2 BT.

A cedar, 12 ins. diam., bears S. 85°30' E.,
39 lks. dist., mkd. $\frac{1}{4}$ S11 BT.

Continue by triangulation. Desc. 200 ft. over W. slope.

48.50 Ravine, drains S.; asc. 400 ft. over E. slope.

64.00 Spur, projects S.; desc. 360 ft. over W. slope.

75.00 Ravine, drains S.; asc. 240 ft. over E. slope.

81.88 End of triangulation.

The cor. of secs. 2, 3, 10 and 11.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, fir, spruce, cedar and mahogany.

Undergrowth, sagebrush, chokecherry, oak brush and
manzanita.

N. 0°55' W., bet. secs. 2 and 3.

Over mountainous land; asc. 720 ft. along E. slope
through heavy oak brush and sagebrush.

32.00 Spur, projects S. 10° W.; enter dense aspen; asc. 40
ft. along W. slope.

40.90 Point for the $\frac{1}{4}$ sec. cor. of secs. 2 and 3 at propor-
tionate dist.; there is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$
S3|S2
1963

From which

An aspen, 4 ins. diam., bears S. 15° E., 47
lks. dist., mkd. $\frac{1}{4}$ S2 BT.

An aspen, 4 ins. diam., bears N. 17° W., 58
lks. dist., mkd. $\frac{1}{4}$ S3 BT.

Thence along W. slope through dense aspen, ascending
gradually.

67.60 Leave aspen; asc. 80 ft. along W. slope.

82.04 The cor. of secs. 2, 3, 34 and 35 on the N. bdy. of
the Tp., previously described.

Land, mountainous.

Soil, rocky and gravelly.

Timber, aspen on N. 60 chs.

Undergrowth, oak brush and sagebrush.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

From the cor. of secs. 33 and 34 on the S. bdy. of the Tp., previously described.

N. $0^{\circ}20'$ W., bet. secs. 33 and 34.

Over broken, mountainous land; desc. 20 ft. over N. slope.

3.00

Creek, intermittent stream of water in bottom of wash, 4 ft. deep, 50 lks. wide, course SE.; enter medium dense pine, spruce and cedar; asc. 100 ft. over S. slope.

11.18

Point for the 1/16 sec. cor. of secs. 33 and 34 at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

1/16

S33|S34

140

1963

From which

A cedar, 8 ins. diam., bears S. $56^{\circ}15'$ W., 12 lks. dist., mkd. 1/16 S33 BT.

There were no other suitable bearing trees available.

Continue by triangulation; asc. 60 ft. over S. slope.

18.90

Spur, projects SE.; end of triangulation; asc. 80 ft. along E. slope.

25.90

Spur, projects SE.; desc. 80 ft. over NE. slope.

30.79

Point for the 1/16 sec. cor. of secs. 33 and 34 at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

1/16

S33|S34

120

1963

From which

A spruce, 14 ins. diam., bears N. $84^{\circ}40'$ E., 37 lks. dist., mkd. 1/16 S34 BT.

There were no other suitable bearing trees available.

Desc. 80 ft. over NE. slope.

42.70

N. Fork of Willow Creek Canyon, drains SE.; leave dense timber; asc. 100 ft. over SW. slope.

50.40

Point for the 1/16 sec. cor. of secs. 33 and 34 at proportionate dist.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., E. 3 W.

CHAINS

Set an iron post, 30 ins. long; $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T22S R3W

1/16

S33 | S34

100

1963

Asc. 280 ft. over SW. slope.

70.01

Point for the 1/16 sec. cor. of secs. 33 and 34 at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

1/16

S33 | S34

80

1963

From which

A spruce, 10 ins. diam., bears N. 45° E., 4 lks. dist., mkd. 1/16 S34 BT.

There were no other suitable bearing trees available.

Asc. 240 ft. over SW. slope through dense mahogany and scattering pine and cedar.

79.90

Ridge, bears NW. and SE.; desc. 120 ft. over broken NE. slope.

85.00

Draw, drains E.; asc. 120 ft. over SE. slope.

89.62

Point for the S. 1/16 sec. cor. of secs. 33 and 34 at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

S1/16

S33 | S34

1963

From which

A mahogany, 8 ins. diam., bears E., 21 lks. dist., mkd. S1/16 S34 BT.

There were no other suitable bearing trees available.

Asc. 80 ft. over SE. slope.

92.50

Small ridge, bears E. and W.; enter scattering pine and mahogany; desc. 40 ft. over NE. slope.

96.50

Draw, drains NE.; asc. 140 ft. over SE. slope.

104.80

Spur, projects NE.; desc. 40 ft. over N. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS		
109.23	Point for the $\frac{1}{4}$ sec. cor. of secs. 33 and 34 at proportionate dist.; there is no remaining evidence of the original cor.	
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.	
	<div style="text-align: center;"> T22S R3W $\frac{1}{4}$ S33 S34 1963 </div>	
	Thence by triangulation; desc. 240 ft. over NE. slope.	
124.00	N. Fork of South Cedar Ridge Canyon, drains SE.; asc. 500 ft. over S. slope.	
139.64	End of triangulation.	
146.45	Ridge, bears NW. and SE.; enter aspen; desc. 40 ft. over N. slope.	
148.45	The cor. of secs. 27, 28, 33 and 34, monumented with a sandstone, 20x10x4 ins., firmly set and mkd. as described in the official record; there is no remaining evidence of the original aspen bearing trees.	
	At the cor. point	
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.	
	<div style="text-align: center;"> T22S R3W S28 S27 S33 S34 1963 </div>	
	From which	
	An aspen, 5 ins. diam., bears N. 21° E., 38 lks. dist., mkd. T22S R3W S27 BT.	
	An aspen, 8 ins. diam., bears S. 58° E., 23 lks. dist., mkd. T22S R3W S34 BT.	
	There were no other suitable bearing trees available.	
	Land, mountainous. Soil, rocky and gravelly. Timber, pine, fir, spruce, cedar, pinon and mahogany. Undergrowth, chokecherry, manzanita, oak brush and sagebrush.	
	From the cor. of secs. 26, 27, 34 and 35.	
	N. $88^{\circ}47'$ W., bet. secs. 27 and 34.	
	Over mountainous land; desc. 15 ft. over W. slope.	
.50	Small wash in bottom of draw, drains N.; asc. 95 ft. over E. slope through dense aspen and scattering pine.	
10.10	Spur, projects N.; desc. 95 ft. over NW. slope.	

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R.

CHAINS

19.77

Point for the E. 1/16 sec. cor. of secs. 27 and 34 at proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
E1/16 $\frac{S27}{S34}$
1963

From which

A pine, 10 ins. diam., bears N. 5° E., 25 lks. dist., mkd. E1/16 S27 BT.

A pine, 12 ins. diam., bears S. 25° W., 26 lks. dist., mkd. E1/16 S34 BT.

Desc. 50 ft. over NW. slope.

23.10

Draw, drains N.; asc. 220 ft. over NE. slope through dense pine, spruce and fir.

28.80

Spur, projects N.; asc. gradually along N. slope.

39.54

Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
 $\frac{1}{4}$ $\frac{S27}{S34}$
1963

From which

A pine, 20 ins. diam., bears N. 40° E., 40 lks. dist., mkd. T22S R3W $\frac{1}{4}$ S27 BT.

A pine, 24 ins. diam., bears S. 2° E., 49 lks. dist., mkd. T22S R3W $\frac{1}{4}$ S34 BT.

Continue along N. slope.

42.10

Small draw, drains NE.; asc. 445 ft. over N. slope, changing to NE. slope.

56.60

Leave dense timber.

62.40

Enter dense aspen.

79.08

The cor. of secs. 27, 28, 33 and 34.

Land, mountainous.
Soil, rocky and gravelly.
Timber, pine, fir and aspen.
Undergrowth, chokecherry, sagebrush, oak and manzanita.

Re-establishment of the Survey Executed by A. J. Stewart, Jr., in 1874.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

N. 0°18' E., bet. secs. 27 and 28.

Over mountainous land; by triangulation; desc. 120 ft. over NE. slope through dense aspen and scattering pine, spruce, fir and cedar.

15.00 Ravine, drains SE.; enter scattering mahogany; asc. 80 ft. over SW. slope.

19.94 Point for the S. 1/16 sec. cor. of secs. 27 and 28 at proportionate dist. End triangulation.

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W
S1/16
S28|S27
1963

From which

A mahogany, 5 ins. diam., bears S. 36° E., 80 lks. dist., mkd. S1/16 BT.

There were no other suitable bearing trees available.

Continue by triangulation.

20.50 Spur, projects SE.; asc. 80 ft. over E. slope, changing to SE. slope.

33.00 Spur, projects E.; desc. 40 ft. over NE. slope. End triangulation.

39.88 The ¼ sec. cor. of secs. 27 and 28, monumented with a sandstone, 15x6x4 ins., firmly set and mkd. as described in the official record; there was no remaining evidence of the original aspen bearing tree.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone, 2 ft. base to top, with brass cap mkd.

T22S R3W
¼
S28|S27
1963

From which

An aspen, 8 ins. diam., bears S. 70° E., 8 lks. dist., mkd. ¼ S27 BT.

An aspen, 12 ins. diam., bears N. 20° W., 5 lks. dist., mkd. ¼ S28 BT.

Deposit the original stone alongside the iron post.

N. 0°09' E., beginning new measurement.

By triangulation. Asc. 280 ft. over SE. slope.

5.00 Road, graded, bears NE. and SW.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3

CHAINS	
17.00	Ridge, bears NE. and SW.; thence over top of ridge.
27.70	Sandstone ledge, 10 ft. high, bears NE. and SW.; end triangulation; desc. 160 ft. over top of spur, projects N.
41.01	The cor. of secs. 21, 22, 27 and 28, monumented with a sandstone, 14x10x3 ins., firmly set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	<div style="text-align: center;"> T22S R3W <u>S21 S22</u> <u>S28 S27</u> 1963 </div>
	From which
	A pine, 6 ins. diam., bears N. 38° W., 78 lks. dist., mkd. T22S R3W S21 BT.
	There were no other suitable bearing trees available.
	From this cor., U.S.G.S. triangulation station "White Pine Peak", bears S. 67°31'20" W., 202.36 chs. dist.
	Land, mountainous. Soil, rocky and gravelly. Timber, aspen, pine, spruce, fir, cedar and mahogany. Undergrowth, chokecherry, sagebrush, oak brush and manzanita.
	From the cor. of secs. 22, 23, 26 and 27.
	N. 86°16' W., bet. secs. 22 and 27.
	Over mountainous land; asc. 160 ft. over E. slope through scattering pine and mahogany; along old fence line.
6.80	Spur, projects S.; desc. 120 ft. over W. slope; end of fence line.
13.10	Enter dense aspen.
17.30	Road, graded, bears N. and S.; slope changes to NW.; desc. 120 ft. over broken NW. slope.
26.10	Head of draw, drains NW.
28.10	Leave aspen.
36.56	Point for the ¼ sec. cor. of secs. 22 and 27 at proportionate dist.; there is no remaining evidence of the original cor.
	Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	<div style="text-align: center;"> T22S R3W <u>¼ S22</u> <u>S27</u> 1963 </div>

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

From which

A spruce, 12 ins. diam., bears N. 2° E.,
3 lks. dist., mkd. $\frac{1}{4}$ S22 BT.

A spruce, 6 ins. diam., bears S. 1°30' W.,
12 lks. dist., mkd. $\frac{1}{4}$ S27 BT.

Desc. 80 ft. over NW. slope.

40.00 Draw, drains N.; asc. 240 ft. over NE. slope.

55.00 Spur, projects N.; desc. 80 ft. over NW. slope.

60.00 Head of draw, drains N.; asc. 360 ft. over NE. slope.

73.12 The cor. of secs. 21, 22, 27 and 28.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, fir, aspen and cedar.

Undergrowth, chokecherry, sagebrush and oak brush.

N. 7°10' E., bet. secs. 21 and 22.

Over broken mountainous land; desc. 1040 ft. over
broken N. slope through dense pine, spruce and cedar.

33.00 Bottom of canyon; stream of water, 2 lks. wide, 3 ins.
deep, course NE.; asc. 70 ft. over SE. slope.

36.47 Point for the $\frac{1}{4}$ sec. cor. of secs. 21 and 22 at propor-
tionate dist.; there is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$
S21 | S22
1963

From which

A cedar, 24 ins. diam., bears S. 56°30' W.,
24 lks. dist., mkd. $\frac{1}{4}$ S21 BT.

There were no other suitable bearing trees
available.

Asc. 40 ft. over SE. slope.

39.00 Spur, projects NE.; thence by triangulation; desc. 120
ft. over NE. slope.

43.50 Chalk Creek, with stream of water, 3 lks. wide, 3 ins.
deep, course NW.; asc. 240 ft. over SW. slope.

52.00 Spur, projects NW.; desc. 200 ft. over N. slope.

56.50 Canyon, drains W.; asc. 240 ft. over S. slope.

64.00 Spur, projects SW.; asc. 80 ft. along W. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

72.94

End of triangulation.

The cor. of secs. 15, 16, 21 and 22, monumented with a sandstone, 32x12x5 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing tree:

A dead mahogany, fallen and decayed, bears
N. 80° W., 20 lks. dist., scribe mks.
illegible. (Record: N. 80° W., 10 lks. dist.)

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

S16 S15

S21 S22

1963

From which new bearing trees:

A spruce, 16 ins. diam., bears N. 34° E.,
21 lks. dist., mkd. T22S R3W S15 BT.

A cedar, 10 ins. diam., bears S. 80° W.,
22 lks. dist., mkd. T22S R3W S21 BT.

There were no other suitable bearing
trees available.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, fir, cedar, mahogany and aspen.

Undergrowth, chokecherry, sagebrush, oak brush and
manzanita.

From the cor. of secs. 14, 15, 22 and 23, previously
described.

N. 87°52' W., bet. secs. 15 and 22.

Over mountainous land through dense aspen and scattered
spruce and pine; by triangulation; asc. 400 ft. over
NE. slope.

21.15 End of triangulation; top of ascent; thence across top
of ridge. Leave timber; enter dense sagebrush.

23.50 Ridge, bears N. and S.; desc. gradually over top of
ridge.

29.95 Aspen log fence, bears NW. and SE.

35.00 Begin steep descent; desc. 25 ft. over NW. slope.

36.47 Point for the ¼ sec. cor. of secs. 15 and 22 at propor-
tionate dist.; there is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 5 ins.
in the ground, and in a mound of stone, 5 ft. base to
top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

T22S R3W

 $\frac{1}{4}$ $\frac{S15}{S22}$

1963

Desc. 30 ft. over NW. slope.

42.50 Small draw, drains SW.; asc. 25 ft. over SE. slope.

45.20 Spur, projects SW.; desc. 160 ft. over SW. slope. Enter dense mahogany and oak brush.

52.70 Draw, drains S.; asc. 80 ft. over SE. slope.

59.80 Spur, projects SW.; desc. 600 ft. over broken W. slope through medium dense pine, spruce and cedar.

71.00 Small draw, drains SW.

72.94 The cor. of secs. 15, 16, 21 and 22.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, fir, spruce, cedar, mahogany and aspen.

Undergrowth, dense sagebrush and oak brush.

Re-establishment of the Survey Executed by John T. Brecken in 1896.

N. 0°07' W., bet. secs. 15 and 16.

Over mountainous land; by triangulation; desc. 40 ft. over NW. slope through medium dense pine, spruce, cedar and mahogany.

2.00 Canyon, drains SW.; asc. 400 ft. over SE. slope.

15.00 Spur, projects SW.; asc. 80 ft. along W. slope, changing to SW. slope.

22.00 Spur, projects W.; desc. 200 ft. over NW. slope.

30.00 Ravine, drains W.; asc. 210 ft. over SW. slope.

36.78 Point for the $\frac{1}{4}$ sec. cor. of secs. 15 and 16 at proportionate dist.; there is no remaining evidence of the original cor.Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 5 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T22S R3W

 $\frac{1}{4}$ $\frac{S16}{S15}$
1963

From which

A pine, 18 ins. diam., bears S. 85° E., 38 lks. dist., mkd. $\frac{1}{4}$ S15 BT.

There were no other suitable bearing trees available.

Continue by triangulation; asc. 160 ft. over SW. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

- 44.50 Ridge, bears NW. and SE.; end of triangulation; desc. 560 ft. over broken N. slope, changing to NW. slope.
- 56.00 Head of draw, drains NW.; slope changes to NW.
- 73.56 The cor. of secs. 9, 10, 15 and 16, monumented with a sandstone, 14x10x6 ins., firmly set, mkd. and witnessed as described in the official record.

From which the original bearing trees:

A pine, 24 ins. diam., bears N. 10°30' E.,
25 lks. dist., mkd. T22S R3W S10 BT.

A pine, 24 ins. diam., bears S. 40° W., 10
lks. dist., mkd. T22S R3W S16 BT.

A spruce, 30 ins. diam., bears N. 10°15' W.,
25 lks. dist., mkd. T22S R3W S9 BT.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S	R3W
S9	S10
S16	S15
1963	

Deposit the original stone alongside the iron post.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, fir, cedar and mahogany.

Undergrowth, oak brush, chokecherry, sagebrush and manzanita.

From the cor. of secs. 10, 11, 14 and 15.

S. 89°14' W., bet. secs. 10 and 15.

Over broken mountainous land; by triangulation; desc. 850 ft. over SW. slope through medium dense pine, spruce, cedar and mahogany.

- 26.50 Nephi Canyon, drains NW.; asc. 400 ft. over NE. slope.

- 36.76 Point for the ¼ sec. cor. of secs. 10 and 15 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S	R3W
¼	S10
	S15
1963	

From which

A pine, 18 ins. diam., bears N. 15° E., 24
lks. dist., mkd. ¼ S10 BT.

A pine, 24 ins. diam., bears S. 10° W., 29

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

1ks. dist., mkd. $\frac{1}{4}$ S15 BT.

Continue by triangulation; asc. 115 ft. over NE. slope.

40.00 Spur, projects N.; desc. 430 ft. over broken NW. slope.

46.20 Spur, projects NW.

56.00 Ravine, drains N. 20° W.; asc. 450 ft. over NE. slope.

69.50 Spur, projects N.; end triangulation; desc. 160 ft. over NW. slope.

73.52 The cor. of secs. 9, 10, 15 and 16.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, cedar and mahogany.

Undergrowth, sagebrush, chokecherry, oak brush and manzanita.

N. 0°26' E., bet. secs. 9 and 10.

Over mountainous land; by triangulation; desc. 640 ft. over NW. slope through medium dense pine, spruce, cedar and mahogany.

22.00 Ravine, drains NE.; desc. 240 ft. over N. slope.

28.00 Chokecherry Creek, with stream of water, 6 lks. wide, 5 ins. deep, course W.; asc. 400 ft. over SW. slope.

40.70 Point for the $\frac{1}{4}$ sec. cor. of secs. 9 and 10 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S R3W

$\frac{1}{4}$

S9|S10

1963

From which

A mahogany, 8 ins. diam., bears N. 30° E., 5 lks. dist., mkd. $\frac{1}{4}$ S10 BT.

There were no other suitable bearing trees available.

Asc. 50 ft. over SW. slope.

42.00 Spur, projects SW.; thence by triangulation; desc. 100 ft. over NW. slope.

52.00 Cedar Springs Canyon, drains SW.; asc. 440 ft. over SE. slope.

81.40 End of triangulation.

The cor. of secs. 3, 4, 9 and 10, monumented with a sandstone, 18x10x6 ins., firmly set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T22S	R3W
S4	S3
S9	S10
1963	

From which

A cedar, 8 ins. diam., bears N. $42^{\circ}10'$ E., 29 lks. dist., mkd. T22S R3W S3 BT.

A cedar, 16 ins. diam., bears S. 52° W., 21 lks. dist., mkd. T22S R3W S9 BT.

There were no other suitable bearing trees available.

Land, mountainous.

Soil, rocky and gravelly.

Timber, pine, spruce, cedar, fir and mahogany.

Undergrowth, dense oak brush, sagebrush, chokecherry, and manzanita.

From the cor. of secs. 2, 3, 10 and 11.

N. $89^{\circ}36'$ W., bet. secs. 3 and 10.

Over mountainous land through scattered pinon and mahogany timber and dense oak brush; asc. 20 ft. over E. slope.

.60 Spur, projects S.; thence by triangulation; desc. 80 ft. over W. slope.

6.70 Draw, drains S.; asc. 210 ft. over E. slope.

13.10 Spur, projects S.; desc. 460 ft. over W. slope.

27.70 Ravine, drains S.; asc. 160 ft. over SE. slope.

36.10 Point for the $\frac{1}{2}$ sec. cor. of secs. 3 and 10 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T22S	R3W
$\frac{1}{2}$	S3
	S10
1963	

There were no suitable bearing trees available.

Continue by triangulation; asc. to top of small spur.

36.50 Small spur, projects S.; desc. 80 ft. over SW. slope.

40.70 Draw, drains S.; asc. 200 ft. over SE. slope.

63.10 Spur, projects S.; desc. 460 ft. over W. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 22 S., R. 3 W.

CHAINS		
64.70	Cedar Springs Canyon; intermittent stream of water, course S.; asc. 120 ft. over E. slope through dense mahogany, oak, chokecherry and scattering aspen.	
72.20	<p>The cor. of secs. 3, 4, 9 and 10.</p> <p>Land, mountainous. Soil, rocky and gravelly. Timber, scattering aspen, mahogany and cedar. Undergrowth, oak brush, chokecherry, manzanita and sagebrush.</p>	
38.60	<p>N. 4°20' W., bet. secs. 3 and 4.</p> <p>Over mountainous land; asc. 400 ft. along E. slope through dense oak brush and mahogany.</p>	
40.84	<p>Small draw, drains SE.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 4 at proportionate dist.; there is no remaining evidence of the original cor.</p>	
	<p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T22S R3W $\frac{1}{4}$ S4 S3 1963</p> <p>From which</p> <p style="padding-left: 40px;">An aspen, 10 ins. diam., bears S. 15° E., 47 lks. dist., mkd. $\frac{1}{4}$ S3 BT.</p> <p style="padding-left: 40px;">An aspen, 8 ins. diam., bears N. 17° W., 58 lks. dist., mkd. $\frac{1}{4}$ S4 BT.</p> <p>Asc. 540 ft. over E. slope, changing to SE. slope, through dense aspen.</p>	
63.20	Spur, projects SE.; desc. 20 ft. along E. slope.	
81.88	<p>The cor. of secs. 3, 4, 33 and 34 on the N. bdy. of the Tp., previously described.</p> <p>Land, mountainous. Soil, rocky and gravelly. Timber, mahogany and aspen. Undergrowth, oak brush, sagebrush and manzanita.</p>	

Township 22 South, Range 3 West

CHAINS

General Description

The land in the E. $\frac{1}{2}$ of T. 22 S., R. 3 W. is entirely mountainous. The drainage is divided by a high ridge that extends from the NE. cor. of the township through the W. boundary of sec. 27. The elevation ranges from about 6800 ft. above sea level in the SE. corner of sec. 36, to about 9500 ft. above sea level in the NW. corner of sec. 2.

The soil is principally rocky and gravelly and covered with a very shallow layer of humid soil. The SE. cor. of sec. 36 is mostly deep canyons with numerous sandstone ledges and little vegetation. Much of the area is covered with a dense growth of fir, pine, spruce, cedar, aspen, pinon, and mahogany timber. Extensive logging operations have taken place in secs. 12, 13 and 24. There is no activity at this time. Much of the area is covered with a dense growth of sagebrush, oak brush, manzanita and chokecherry undergrowth. A graded, dirt road enters the township in the NE. cor. of sec. 1, following very nearly along the top of the high ridge that extends through the township, and leaves the area at about the middle of the W. boundary of sec. 27. There are other unimproved roads providing access to Strawberry and Newt's Canyons and to the N. boundary of the township.

Solitude Guard Station is located in the NW. part of sec. 23. Indian Springs Guard Station is located approximately $\frac{1}{4}$ of a mile N. of the NE. cor. of the township.

Most of the deep canyons draining to the W. have small streams of water and are fed by numerous springs. There are small intermittent seeps along the bottoms of the canyons draining to the E.

FIELD ASSISTANTS

GPO 834685

CERTIFICATE OF SURVEY

I, Glen B. Hatch, HEREBY CERTIFY upon honor that,
in pursuance of special instructions bearing date of the 15 day of May, 1963,

I have dependently resurveyed the East Boundary, the East 3 miles of the South Boundary, the East 3 miles of the North Boundary, and a portion of the Subdivisional Lines of T. 22 S., R. 3 W.

of the Salt Lake Meridian, in the State of Utah, which
are represented in the foregoing field notes as having been executed by me and under my direction;
and that said survey has been made in strict conformity with said special instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in specific manner described in the foregoing field notes.

(Date)

January 14, 1965

(Date)

(Cadastral Surveyor)

Glen B. Hatch

(Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date JAN 27 1965BUREAU OF LAND MANAGEMENT,
Washington, D. C.

The foregoing field notes of the dependent resurvey of the East boundary, the East 3 miles of the South boundary, the East 3 miles of the North boundary, and a portion of the subdivisional lines of T. 22 S., R. 3 W.

executed by Glen B. Hatch, Cadastral Surveyor

having been critically examined and found correct, are hereby approved.

APR 21 1965

(Date)

E. J. Summerton

(Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in
is a true copy of the original field notes.

(Date)

(Chief, Division of Engineering)

Blank

Page

Blank

Page

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

123

FIELD NOTES

OF THE

DEPENDENT RESURVEY

OF

PORTIONS OF THE SUBDIVISIONS

OF

TOWNSHIP 15 SOUTH, RANGE 1½ WEST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

Andrew Nelson

Cadastral Surveyor

Under special instructions dated November 19, 19 62, which provided for the surveys

Included under Group Number 463, approved November 20, 1962,

and assignment instructions dated November 26, 19 62.

Survey commenced November 27, 19 62

Survey completed November 28, 19 62

INDEX DIAGRAM

Township 15 SOUTH, Range 1 $\frac{1}{2}$ WEST,

6	5	4	3	2	1
7	8	9	10	11	12
18	17	16	15	14	13
19	20	21	22	23	24
30	29	28	27	26	25
31	32	33	34	35	36

Dependent Resurvey of T. 15 S., R. 1½ W.

CHAINS

Township 15 South, Range 1½ West, Salt Lake Meridian, Utah: the N. portion of the East boundary was originally surveyed by Charles Mogo, Deputy Surveyor, in 1856, and resurveyed by Stewart & Stewart, Deputy Surveyors, in 1898; the West boundary was originally surveyed by Ferinend Dickard, in 1871, and resurveyed by Stewart & Stewart, in 1898; the South boundary (Third Standard Parallel South), the North boundary, portion of the East boundary, and the subdivisions were surveyed by Stewart & Stewart, in 1898.

Request for this survey was made by the District Manager, Bureau of Land Management, Fillmore, Utah, for the reestablishment of the corner of sections 23, 24, 25 and 26, Township 15 South, Range 1½ West. The following field notes are those of a dependent resurvey of a portion of the subdivisional lines adjacent to and necessary for the reestablishment of the above corner.

The survey was made with a Gurley transit No. 600539, equipped with full vertical circle and improved Smith-type telescopic solar attachment, and conforms to the standard instrumental specifications of the Bureau of Land Management. The instrument was in good adjustment during the survey. The directions were determined by the solar-type method.

The measurements were made with a narrow steel tape, 8 chains in length, graduated every link for the first 100 links and the remainder at intervals of 10 links. The tape was tested by comparison with a standard steel tape 1 chain long and found correct. The measurements were made on the slope and the vertical angle of each interval was ascertained by two clinometers in good adjustment. Horizontal equivalents only appear in the field note record.

The geographic position for the ¼ corner between secs. 24 and 25 is in latitude 39°29' N., and longitude 111°59' W., as determined by scaling from U.S.G.S. Scipio North Quadrangle sheet. The magnetic declination was not determined.

Dependent Resurvey of Subdivisions, T. 15 S., R. 1½ W.

Reestablishment of Surveys Executed by
Stewart & Stewart, Deputy Surveyors, in 1898

Beginning at the original ¼ sec. cor. of secs. 25 and 26, which is marked by a sandstone, 16x12x4 ins., loosely set, plainly marked ¼ on W. face, and witnessed by a mound of stone, 3x2 ft. W. of cor.

At cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground to rock, and supported in a large mound of stone to top, with brass cap mkd.

¼
T15S | R1½W
S26 | S25
1962

Corner is located on a steep, rocky SW. slope, about 1 ch. N. and 20 ft. above bottom of draw, draining NW.

Dependent Resurvey of T. 15 S., R. 1½ W.

CHAINS

Note: From this cor. the cor. of secs. 25, 26, 35 and 36, bears S. 0°40' E., 39.97 chs. dist. and is marked by a sandstone, 8x8x12 ins., showing, firmly set, properly marked, and witnessed by stumps of original bearing trees; cor. is set in an E-W wire fence.

Thence

N. 0°38' W., on N. half-mile bet. secs. 25 and 26.

Over broken land, through short undergrowth and few widely scattered cedars; asc. 80 ft. over steep, rocky SW. slope.

- 5.80 Top of ascent on W. slope of rocky point; descend NW. slope, 250 ft. to sec. cor.
- 22.20 Wire fence bears nearly E-W; base of steep descent, continue over low rolling N. slope, through sagebrush.
- 32.80 Irrigation ditch, 5 lks. wide, drains W. from NE.
- 33.40 Wire fence at S. edge of cultivated land, bears NE. and SW.
- 40.07 Point for the cor. of secs. 23, 24, 25 and 26, at proportionate dist.; there is no remaining evidence of the original corner. Cor. point falls in field and is liable to be disturbed; therefore, I bury a limestone, 13x11x9 ins., marked with 2 grooves on S., 1 groove on E. and X on top, over broken glass, 14 ins. below surface, and establish a witness cor. to same, N. 0°22' E., 0.72 chs. dist. from true cor. point.

At witness cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T15S R1½W

S23 | S24

S26 | S25

W C

1962

raise a mound of stone, around cor.

The witness cor. is set in an irregular wire fence at N. side of field, bears westerly and about N. 80° E.

Land, rolling and broken on S. part; nearly level, improved land on N. end.

Soil, rocky and sandy clay.

Undergrowth, sagebrush.

From true reestablished cor.

N. 89°42' E., bet. secs. 24 and 25.

Over nearly level field.

- 9.40 Wire fence at E. edge of field, bears NE. and SW.
- 9.70 Irrigation ditch, drains SW.; enter broken land, through short undergrowth and scattered cedar and pinon; ascend steep W. slope.
- 20.70 Top of rocky spur, 315 ft. above sec. cor., projects N.; descend broken, rocky NE. and N. slopes, 225 ft.

Dependent Resurvey of Subdivisions, T. 15 S., R. 1½ W.

CHAINS

39.33 The original ¼ sec. cor. of secs. 24 and 25, which is marked by a limestone, 24x14x4 ins., firmly set in ground, plainly marked ¼ on N. face, and witnessed by a scattered mound of stone, N. of cor.

At cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, original cor. buried on W. side of post; brass cap mkd.

T15S R1½W

¼ $\frac{S24}{S25}$

1962

rebuild and enlarge the mound of stone, N. of cor.

Corner is located on rocky N. slope.

Land, nearly level, improved land on W. end; remainder steep and broken.

Soil, clay loam and rocky.

Timber, scattered scrub cedar and pinon on slopes.

From the true reestablished cor. of secs. 23, 24, 25 and 26.

N. 89°37' W., bet. secs. 23 and 26.

Over nearly level valley land, across fields.

10.80 R-o-W fence parallel to railroad.

13.60 Union Pacific Railroad, bears N. 56°48' E. and S. 56° 48' W.

16.00 Power line, parallel to R.R.

16.40 R-o-W fence, bears with railroad.

21.50 Chicken Creek, 10 lks. wide, in wash 15 ft. deep, drains SW.

23.30 Oiled road, bears SW. and NE.

24.00 Fence, bears with road; continue across fields.

26.50 NE. cor. of house, bears S. of line about 25 lks. dist.

27.00 Leave farm land, bears about N-S; begin ascent of 175 ft. over rolling E. slope.

39.00 Top of ridge, bears N. and S.; gentle descent to

39.33 The original ¼ sec. cor. of secs. 23 and 26, which is marked by a limestone, 17x13x7 ins., firmly set in the ground, plainly marked ¼ on N. face, and witnessed by a small mound of stone, N. of cor.

At cor. point.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, original cor. buried alongside of post; brass cap mkd.

Dependent Resurvey of Subdivisions, T. 15 S., R. 1½ W.

CHADDS

T15S R1½W

½ S23
S26

1962

raise a large mound of stone, N. of cor.

Corner is located on gentle W. slope.

Land, nearly level valley on E. portion and low hills on W. part.

Soil, clay loam and rocky.

Timber, none.

Undergrowth, sagebrush.

From the true reestablished cor. of secs. 23, 24, 25 and 26.

N. 0°22' E., bet. secs. 23 and 24.

Over nearly level land, across field.

0.72 The witness sec. cor. in fence line at N. edge of field, hereinbefore described.

2.50 Chicken Creek, drains W.

7.20 R-o-W fence, parallel to railroad.

9.04 Union Pacific Railroad, bears N. 56°48' E. and S. 56°48' W.

10.80 R-o-W fence, parallel to railroad.

11.40 Oiled road, bears with railroad.

12.00 Wire fence, bears with road; enter field.

29.00 Irrigation ditch, 5 lks. wide, drains W.; leave field; gradually ascend rolling S. slope, 75 ft.

38.00 Top of low rise, 85 ft. above sec. cor., bears E. and W.; gently descend N. slope, 15 ft.

40.07 The original ½ sec. cor. of secs. 23 and 24, which is marked by a limestone, 18x16x6 ins., firmly set in the ground, marked ½ on W. face; no accessories.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with original cor. buried alongside of post; brass cap mkd.

½
T15S R1½ W
R23 R24
1962

raise a mound of stone, around cor.

Corner is located on a gentle NW. slope, in wire fence bearing E. and W.

Land, nearly level valley and rolling.

Soil, clay loam and gravelly.

Timber, none.

Undergrowth, sagebrush.

Township 15 South, Range 1½ West

CHAINS

General Description

The land embraced within this limited resurvey area is rolling to broken hills bordering a small valley along Chicken Creek, flowing westerly through secs. 23, 24 and 26. The Union Pacific Railroad, and oiled road, between Nephi and Lynndyl, extends across these sections. Mills, a small settlement is located about 1½ miles from the reestablished section corner.

	CHAINS		
--	--------	--	--

[illegible]

CERTIFICATE OF SURVEY

I, Andrew Nelson, Cadastral Surveyor, HEREBY CERTIFY upon honor that,
 in pursuance of special instructions bearing date of the 19th day of November, 1962,
 I have dependently resurveyed portion of the subdivisions of Township 15
 South, Range 1½ West

of the Salt Lake Meridian, in the State of Utah, which
 are represented in the foregoing field notes as having been executed by me and under my direction;
 and that said survey has been made in strict conformity with said special instructions, the Manual
 of Instructions for the Survey of the Public Lands of the United States, and in specific manner
 described in the foregoing field notes.

February 3, 1965
 (Date)

Andrew Nelson
 (Cadastral Surveyor)

 (Date)

 (Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date MAR 5 1965

BUREAU OF LAND MANAGEMENT,
 Washington, D. C.

The foregoing field notes of the dependent resurvey of portion of the subdivisions
 of Township 15 South, Range 1½ West

executed by Andrew Nelson, Cadastral Surveyor,
 having been critically examined and found correct, are hereby approved.

MAY 5 1965
 (Date)

Ed. L. Lanning
 (Chief, Division of Engineering) NES

CERTIFICATE OF TRANSCRIPT

~~I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in~~
~~, is a true copy of the original field notes.~~

~~_____
 (Date)~~

~~_____
 (Chief, Division of Engineering)~~

Blank

Page

Blank Page

ORIGINAL
UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

135

FIELD NOTES

OF THE
DEPENDENT RESURVEY

OF

A PORTION OF THE SOUTH BOUNDARY,

A PORTION OF THE WEST BOUNDARY

AND

A PORTION OF THE SUBDIVISIONAL LINES

OF

TOWNSHIP 21 SOUTH, RANGE 7 EAST

Of the SALT LAKE Meridian,

in the State of UTAH

EXECUTED BY

GLEN B. HATCH, CADASTRAL SURVEYOR

Under special instructions dated June 29, 19 62, which provided for the surveys
and supplemental special instructions dated February 15, 1963,
included under Group Number 458, approved June 29, 1962,

and assignment instructions dated June 29, 19 62.

Survey commenced September 13, 19 62

Survey completed April 23, 19 63

1965 JUL 19 AM 10 00 .9

RECEIVED
STATE & LAND OFFICE
SALT LAKE CITY, UTAH

INDEX DIAGRAM

Township 21 SOUTH, Range 7 EAST,

6 42	43 5 41	31 4 30	21 8 20	14 2 13	11 1 10
9 7 40	40 8 39	29 9 28	9 10 19	13 11 13	12
8 18 38	38 17 37	27 16 26	18 15 17	12 14	13
7 19 35	36 20 34	25 21 24	16 22	23	24
6 30 33	33 29 32	23 28 22	16 27	26	25
5 31 4	31 32 3	22 33 2	15 34	35	36

Township 21 South, Range 7 East

CHAINS

The north boundary (Fourth Standard Parallel South) was surveyed by A. D. Ferron in 1873, retraced in 1921 by Howard W. Miller and dependently resurveyed by Allen L. Tuft concurrently with this survey. The west boundary, the west 3 miles of the south boundary, the north $1\frac{1}{2}$ miles of the east boundary and sections 1 to 11 inclusive, 15 to 21 inclusive, and 28 to 33 inclusive, were surveyed by A. D. Ferron in 1873. The north $1\frac{1}{2}$ miles of the east boundary and the line between secs. 11 and 12 were dependently resurveyed by Howard W. Miller and Andrew Nelson in 1910, who also retraced between sections 1 and 12, 11 and 14, 14 and 15, 15 and 22, 21 and 22, 27 and 28, 33 and 34, the west 3 miles of the south boundary, and surveyed the east 3 miles of the south boundary, the south $4\frac{1}{2}$ miles of the east boundary and sections 12, 13, 14, 22, 23, 24, 25, 26, 27, 34, 35 and 36. In 1919, Howard W. Miller dependently resurveyed the north 2 miles of the west boundary. The following field notes are those of the dependent resurvey of a portion of the west boundary, a portion of the south boundary and a portion of the subdivisional lines of Township 21 South, Range 7 East.

Before restoring the corners, the lines of the original survey were retraced, and a diligent search made for any evidence of the original corners, bearing trees or other calls of the original field note record. The rules of proportionate measurement were applied after exhausting every reasonable possibility of finding any evidence of the lost corners.

The survey was executed with a W. & L. E. Gurley Solar Transit No. 570621 constructed in accordance with the standard instrumental specifications of the Bureau of Land Management. The instrument was in good condition prior to the beginning of the survey and was maintained in proper adjustment throughout the progress of this survey.

Corners on east-west lines were set on the true latitudinal curve; lines connecting previously established corners were run by random and true method, but for simplification of the record the random lines are omitted from the field notes.

Measurements herein contained were made with a narrow steel tape, 8 chains in length, graduated every link for the first 100 links and thereafter at intervals of 10 links. The tape was tested by comparison with a one chain standard steel tape and found to be correct. Measurements were made on the slope with the vertical angle of each interval ascertained by a clinometer in good adjustment; horizontal equivalents alone are entered in the field notes. All lines of this survey were run by direct method where the lines were accessible; lines inaccessible were run by traverse or triangulation methods. Distances to topography on lines run by traverse or triangulation are approximately as scaled from U.S.G.S. topographic sheets. The details of such traverses or triangulations have been thoroughly checked and verified, and in order to simplify the record the diagrams and reductions are omitted from these field notes.

The direction of the lines of this survey were determined by reference to true meridians established on line by altitude observations on the sun. The lines were carried forward by sustained angulation being supplemented by other numerous altitude observations on the sun taken throughout the progress of the survey.

Township 21 South, Range 7 East

CHAINS

The geographic position for the southeast corner of sec. 33 is at latitude $38^{\circ}56'26''$ N. and longitude $111^{\circ}07'45''$ W. as adjusted from traverses to U.S.G.S. triangulation station "Ferron," at latitude $39^{\circ}01'00.343''$ N. and longitude $110^{\circ}59'26.179''$ W., located S. $3^{\circ}20'44''$ W., 79.13 chs. dist. from the south $\frac{1}{4}$ sec. cor. of sec. 35, T. 20 S., R. 8 E.

The magnetic declination was read at a number of stations throughout the township and the average of these readings was found to be $17^{\circ}30'$ East.

Dependent Resurvey of a Portion of the S. Bdy. of T. 21 S., R. 7 E.

Reestablishment of the Survey executed by A. D. Ferron in 1873 and the Retracement of Howard W. Miller and Andrew Nelson in 1910, with establishment of north $\frac{1}{4}$ sec. cors. pertaining to T. 22 S., R. 7 E.

Beginning at the cor. of secs. 33 and 34, on the south bdy. of the Tp., monumented with a 3 in. iron post, set, mkd. and witnessed as described in the field notes of the 1910 Retracement.

From this cor., the closing cor. of secs. 3 and 4, T. 22 S., R. 7 E., bears E. 1.94 chs. dist., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the field notes of the 1910 survey of T. 22 S., R. 7 E.

S. $89^{\circ}27'$ W., along the S. boundary of sec. 33.

Over rolling land through dense pinon and juniper timber.

Desc. 80 ft. over NW. slope.

16.20 Bottom of small draw, 30 ft. deep, drains N.

28.30 Leave timber, bears NW. and S.; thence over nearly level land through medium greasewood and shadscale.

32.18 Cor. of wire fence, with fence bearing NE. and S. $89^{\circ}27'$ W.; thence along fence line.

38.09 Point for the N. $\frac{1}{4}$ sec. cor. of sec. 4, T. 22 S., R. 7 E. at midpoint bet. the closing cor. of secs. 3 and 4, and the closing cor. of secs. 4 and 5.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

$\frac{1}{4}$ S4
T22S R7E
1962

Cor. is set in E., W. fence line.

41.02 Point for the S. $\frac{1}{4}$ sec. cor. of sec. 33 at proportionate dist. Latitudinal control by fence line. There is no remaining evidence of the original cor.

Dependent Resurvey of a Portion of the South
Boundary of Township 21 South, Range 7 East

CHAINS	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.
	<p style="text-align: center;">T21S R7E $\frac{1}{4}$ S33 1962</p>
	Cor. is set in E., W. fence line.
	S. 89°11' W., beginning new measurement, and along fence line.
8.00	Leave greasewood, bears irregularly N. and S.
10.30	Cor. of fence, with fence bearing N.; continue along fence line.
37.10	The closing cor. of secs. 4 and 5, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the field notes of the 1910 retracement of the south boundary of T. 21 S., R. 7 E.
40.99	The cor. of secs. 32 and 33, monumented with a 3 in. iron post, set, mkd. and witnessed as described in the field notes of the 1910 retracement of the south boundary of T. 21 S., R. 7 E.
	Land, rolling, east portion; nearly level, west portion. Soil, sandy clay, with exposed sandstone, east portion. Timber, dense pinon and juniper, east portion. Undergrowth, greasewood and shadscale, west portion.
	S. 89°09' W., along fence line on the S. bdy. of sec. 32.
	Over nearly level desert land.
36.07	Point for the N. $\frac{1}{4}$ sec. cor. of sec. 5, T. 22 S., R. 7 E., at midpoint bet. the closing cor. of secs. 4 and 5, and the closing cor. of secs. 5 and 6.
	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.
	<p style="text-align: center;">$\frac{1}{4}$ S5 T22S R7E 1962</p>
	No accessories available.
	Cor. set at cor. of east, west, and south fences.
40.81	The $\frac{1}{4}$ sec. cor. of secs. 5 and 32, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the field notes of the 1910 retracement of the south bdy. of T. 21 S., R. 7 E. This cor. now functions as the S. $\frac{1}{4}$ sec. cor. of sec. 32, T. 21 S., R. 7 E., only I remark to read
	<p style="text-align: center;">$\frac{1}{4}$ S32 1962 1910</p>
	Cor. set on cor. of fence from east and north.

Dependent Resurvey of a Portion of the
South Boundary of Township 21 South, Range 7 E.

CHAINS	
	S. 89°18' W., beginning new measurement.
11.85	Irrigation ditch, 20 lks. wide, 3 ft. deep, drains NE.
25.10	Irrigation ditch, 10 lks. wide, 1 ft. deep, drains SE.; enter cultivated land.
34.48	Wire fence, bears N. and S.; leave cultivated land.
35.00	Gravel road, bears NW. and S.
35.22	The closing cor. of secs. 5 and 6, T. 22 S., R. 7 E., monumented with a 2 in. iron post, badly rusted and marred by road equipment. I replace with an iron post, 2½ ins. diam., 30 ins. long, set 24 ins. in the ground and in a collar of stone, with brass cap mkd.
	<div style="text-align: center;"> T21S R7E <u>S32</u> S6 S5 C C T22S 1962 </div>
35.30	Power line, bears S. and N. about 2.00 chs., thence NW.
40.77	The cor. of secs. 31 and 32, monumented with a 3 in. iron post, set, mkd. and witnessed as described in the field notes of the 1910 retracement of the S. bdy. of T. 21 S., R. 7 E.
	Land, nearly level desert. Soil, loamy clay. No timber. Undergrowth, shadscale and greasewood.
	S. 89°21' W., along the S. bdy. of sec. 31.
	Over nearly level desert land through rabbit brush and shadscale.
11.65	Irrigation ditch, 10 lks. wide, 2 ft. deep, drains SE.
34.46	Point for the N. ¼ sec. cor. of sec. 6, T. 22 S., R. 7 E., at proportionate dist. between the closing cor. of secs. 5 and 6 and the Tp. cor. of Tps. 21 and 22 S., Rs. 6 and 7 E.
	Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	<div style="text-align: center;"> <u>¼ S6</u> T22S R7E 1962 </div>
38.15	Road, unimproved, bears NW. and SE.
40.35	The ¼ sec. cor. of secs. 6 and 31, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the field notes of the 1910 retracement of the S. bdy. of T. 21 S., R. 7 E. This cor. now functions as the S. ¼ sec. cor. of sec. 31, T. 21 S., R. 7 E., only, and was remarked

Dependent Resurvey of a Portion of the South
Boundary of Township 21 South, Range 7 East

CHAINS

 $\frac{1}{2}$ S31

1962

1910

S. 89°24' W., beginning new measurement.

- 11.85 Road, unimproved, bears SE. and curves NE.
- 13.40 Irrigation ditch, 10 lks. wide, 3 ft. deep, drains S.
- 13.80 Road, unimproved, bears S. and NE.
- 34.80 Irrigation ditch, 20 lks. wide, 3 ft. deep, drains SE.
- 40.47 The cor. of Tps. 21 and 22 S., Rs. 6 and 7 E., monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record. This cor. is situated on fence line bearing N. 0°07' W. and S. 0°07' E.

Land, nearly level desert.

Soil, loamy clay.

No timber.

Undergrowth, rabbit brush and shadscale.

Dependent Resurvey of a Portion of the West Bdy. of T.21S.
R. 7 E.

Reestablishment of the Survey Executed by A. D. Ferron, in 1873.

From the cor. of Tps. 21 and 22 S., Rs. 6 and 7 E., hereinbefore described.

N. 0°07' W., bet. secs. 31 and 36, along fence line.

Over gently rolling desert land.

Asc. 45 ft. over gentle SW. slope.

- 15.60 Top of ascent, slopes W.; desc. gentle NW. slope.
- 22.50 Wash, 30 lks. wide, 3 ft. deep, drains irregularly S.; asc. gentle S. slope.
- 23.30 Power line, bears NE. and SW.
- 32.30 Wash, 10 lks. wide, 3 ft. deep, drains E. 1.00 ch. to junction with wash from N., thence irregularly S.
- 37.70 Wash, 15 lks. wide, 3 ft. deep, drains irregularly S.
- 40.70 Same wash, drains irregularly S.
- 40.73 Point for the $\frac{1}{2}$ sec. cor. of secs. 31 and 36, at proportionate dist. falls in wash. There is no remaining evidence of the original cor.
- 40.83 Point selected for the witness $\frac{1}{2}$ sec. cor. of secs. 31 and 36.

Dependent Resurvey of a Portion of the ~~West~~
Boundary of Township 21 South, Range 7 East

CHAINS	
	<p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone, with brass cap mkd.</p> <p style="text-align: center;">T21S R6E R7E ½ S36 S31 W C 1962</p> <p>Continue along fence line over gentle S. slope; asc. 50 ft.</p> <p>44.15 Same wash, drains irregularly S. from NW.</p> <p>64.80 Top of ascent, bears irregularly E. and W.; desc. 45 ft. over gentle NE. slope.</p> <p>81.46 Point for the cor. of secs. 25, 30, 31 and 36 at junction of property line fences from the N., S., and E., and is accepted as the best evidence of the position of the original cor.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone, with brass cap mkd.</p> <p style="text-align: center;">T21S R6E R7E S25 S30 S36 S31 1962</p> <p>Land, gentle rolling desert. Soil, sandy clay. No timber. Undergrowth, shadscale.</p>
	<p>N. 0°07' W., bet. secs. 25 and 30.</p> <p>Over nearly level land through rabbit brush and shadscale, along fence line.</p> <p>3.12 Telephone line, bears N. 80° E. and S. 80° W.</p> <p>9.16 Fence parallels highway.</p> <p>10.33 Center line of State Highway No. 10, bears N. 85°15' E. and S. 85°15' W.</p> <p>18.50 Wash, 10 lks. wide, 2 ft. deep, drains W.</p> <p>31.40 Fence, bears NE. and SW.</p> <p>35.30 Irrigation canal, 20 lks. wide, 4 ft. deep, flows SE., enter clay hills. Asc. 70 ft. over S. slope.</p> <p>37.30 Low ridge, bears E. and W.; desc. 35 ft. over N. slope.</p> <p>38.80 Draw, drains E.; asc. 40 ft. over S. slope.</p> <p>40.06 Point for the ¼ sec. cor. of secs. 25 and 30 at proportionate dist.; there is no remaining evidence of the original cor.</p>

Dependent Resurvey of a Portion of the West
Boundary of Township 21 South, Range 7 East

CHAINS	
	<p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone, to top, with brass cap mkd.</p> <p style="text-align: center;">T21S R6E R7E S25 S30 1962</p> <p>Asc. 50 ft. over S. slope.</p>
43.50	Ridge, bears E. and W.; desc. 30 ft. over NE. slope.
47.10	Telephone line, bears NE. and SW.
48.50	Draw, drains E.; asc. 35 ft. over S. slope.
51.00	Spur, projects E.; desc. 40 ft. over N. slope.
55.10	Draw, drains E.; asc. 50 ft. over S. slope.
59.10	Spur, projects E.; desc. 55 ft. over N. slope.
63.00	Base of spur, bears E. and W.; thence over nearly level land.
71.90	Wash, 15 lks. wide, 3 ft. deep, drains E.
80.12	<p>The cor. of secs. 19, 24, 25 and 30, monumented with a limestone 4x8x12 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T21S R6E R7E S24 S19 S25 S30 1962</p> <p>Bury original stone cor. alongside iron post, and deposit glass around post, 6 ins. below ground.</p> <p>Land, nearly level desert, N and S. portion; low clay hills, center portion. Soil, sandy clay. No timber. Undergrowth, shadscale and rabbit brush.</p>
	<p>N. 0°19' E., bet. secs. 19 and 24.</p> <p>Over nearly level desert land.</p>
11.50	Wash, 20 lks. wide, 10 ft. deep, drains SE.
14.00	Wash, 15 lks. wide, 8 ft. deep, drains SE.
20.50	Base of slope, bears NW. and SE.; asc. 75 ft. over SW. slope.
30.80	Spur, projects SE.; desc. 50 ft. over NE. slope.
38.50	Wash, drains SE.; asc. 15 ft. over SE. slope of low knoll.

Dependent Resurvey of a Portion of the West
Boundary of Township 21 South, Range 7 East

CHAINS

40.00 Top of ascent; desc. 15 ft. over NE. slope.
40.71 Point for the $\frac{1}{2}$ sec. cor. of secs. 19 and 24 at proportionate dist. There is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T21S
R6E R7E

$\frac{1}{2}$
S24|S19
1962

Desc. 15 ft. over NE. slope.

41.20 Base of knoll, thence over nearly level land.

51.80 Wash, 15 lks. wide, 3 ft. deep, drains SE.

81.42 Point for the cor. of secs. 13, 18, 19 and 24 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S
R6E R7E

S13|S18
S24|S19
1962

Land, rolling, south portion; nearly level, north portion.
Soil, clay.
No timber.
Undergrowth, shadscale.

N. $0^{\circ}19'$ E., bet. secs. 13 and 18.

Over nearly level desert land.

2.10 Wash, 10 lks. wide, 2 ft. deep, drains NE.

31.50 Wash, 10 lks. wide, 2 ft. deep, drains SE.

40.71 Point for the $\frac{1}{2}$ sec. cor. of secs. 13 and 18 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T21S
R6E R7E

$\frac{1}{2}$
S13|S18
1962

48.10 Wash, 50 lks. wide, 10 ft. deep, drains SE.; enter rolling land; asc. 10 ft. over SW. slope.

Dependent Resurvey of a Portion of the West
Boundary of Township 21 South, Range 7 East

CHAINS

- 54.10 Spur, projects SE., thence over series of small spurs about 20 ft. high, projecting E.
- 69.50 Spur, projects E.; desc. 15 ft. over NE. slope.
- 78.50 Wash, 20 lks. wide, 2 ft. deep, drains SE.; asc. 15 ft. over SE. slope.
- 81.42 The cor. of secs. 7, 12, 13 and 18, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the field notes of the 1919 resurvey of a portion of the east boundary of T. 21 S., R. 6 E.
- Land, gently rolling desert.
Soil, rocky clay.
No timber.
Undergrowth, shadscale.
- Reestablishment of the Resurvey Executed by Howard W. Miller, in 1919
-
- N. 0°20' E., bet. secs. 7 and 12.
- Over broken, mountainous land.
- Asc. abruptly about 400 ft. over broken ledges on S. slope by triangulation.
- 4.50 Spur, projects SE.; desc. about 400 ft. over precipitous NE. slope. End one triangulation, beginning of another.
- 24.00 Approximate dist. to base of descent, bears NW. and SE.; thence over nearly level land.
- 36.85 End triangulation.
- 40.755 The $\frac{1}{4}$ sec. cor. of secs. 7 and 12, monumented with a 1 in. iron post, badly deteriorated and broken, mkd. as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T21S
R6E R7E
 $\frac{1}{4}$
S12 | S7
1962
- Thence by triangulation; asc. about 350 ft. over broken S. slope.
- 50.40 End triangulation; spur, projects E.; thence by triangulation; desc. about 300 ft. over steep, broken N. slope.
- 65.00 Approximate dist. to draw, drains irregularly E.; asc. about 280 ft. over S. slope.
- 81.51 The cor. of secs. 1, 6, 7 and 12, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the West
Boundary of Township 21 South, Range 7 East

CHAINS

Land, mountainous, broken.
Soil, rocky clay, exposed sandstone.
No timber.
Undergrowth, shadscale.

Dependent Resurvey of a Portion of the Subdivision of
Township 21 South, Range 7 East

Reestablishment of the Survey Executed by A. D.
Ferron in 1873, and the Retracement of Howard W.
Miller and Andrew Nelson in 1910.

From the cor. of secs. 1 and 12, on the east boundary of
the Tp., monumented with a 3 in. iron post, set, mkd.
and witnessed as described in the official record.

S. 88°14' W., bet. secs. 1 and 12.

Over rolling land.

Asc. 80 ft. over NE. slope.

26.30 Spur, projects E.; thence along spur.

40.85 Point for the $\frac{1}{2}$ sec. cor. of secs. 1 and 12 at propor-
tionate dist.; there is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 12 ins.
in the ground, to bedrock, and in a mound of stone, 3
ft. base to top, with brass cap mkd.

T21S R7E

$\frac{1}{2}$ $\frac{S1}{S12}$
1962

Continue along spur.

55.20 Desc. 45 ft. over W. slope.

73.10 Wash, 10 lks. wide, 2 ft. deep, drains SW.

81.70 The cor. of secs. 1, 2, 11 and 12, monumented with a
sandstone, 9x12x15 ins., firmly set and plainly mkd.
as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins.
in the ground, and in a collar of stone to top, with
brass cap mkd.

T21S R7E

$\frac{S2}{S11} | \frac{S1}{S12}$
1962

Land, rolling desert.
Soil, clay.
No timber.
Undergrowth, shadscale.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	Reestablishment of the Survey Executed by A. D. Ferron, in 1873.
	<p>N. 0°23' E., bet. secs. 1 and 2.</p> <p>Over nearly level desert land.</p> <p>3.30 Fence, bears N. 89°45' W. and S. 89°20' E.</p> <p>3.40 Road, unimproved, parallels fence.</p> <p>5.40 Wash, 10 lks. wide, 3 ft. deep, drains NE.</p> <p>21.70 Wash, 50 lks. wide, 2 ft. deep, drains NE.</p> <p>29.70 Wash, 40 lks. wide, 4 ft. deep, drains irregularly E.</p> <p>33.40 Wash, 15 lks. wide, 2 ft. deep, drains E.</p> <p>35.90 Wash, 10 lks. wide, 2 ft. deep, drains E.</p> <p>40.59 Point for the $\frac{1}{2}$ sec. cor. of secs. 1 and 2 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E $\frac{1}{2}$ S2 S1 1962</p> <p>No accessories available.</p> <p>42.40 Wash, 10 lks. wide, 2 ft. deep, drains SE.</p> <p>46.80 Wash, 10 lks. wide, 1 ft. deep, drains SE.</p> <p>52.20 Wash, 5 lks. wide, 2 ft. deep, drains SE.</p> <p>65.90 Road, unimproved, bears NE. and SW.</p> <p>66.50 Low ridge, bears E. and W.; desc. 10 ft. over N. slope.</p> <p>71.20 Small draw, drains NW.; asc. 20 ft. over SW. slope.</p> <p>72.00 Spur, projects NW.; desc. 30 ft. over NE. slope.</p> <p>74.50 Small draw, drains NW.; asc. 30 ft. over SW. slope.</p> <p>75.80 Small spur, projects NW.; desc. 30 ft. over NE. slope.</p> <p>77.00 Small draw, drains NW.; asc. 20 ft. over SW. slope.</p> <p>78.20 Small spur, projects NW.; desc. 20 ft. over NE. slope.</p> <p>81.67 The true point for cor. of secs. 1, 2, 35 and 36, on the N. bdy. of the Top., from which its witness cor. bears N. 88°52' E., 50 lks. dist., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the dependent resurvey of the Fourth Standard Parallel South (south bdy. of T. 20 S., R. 7 E.).</p> <p>Land, nearly level to gently rolling. Soil, clay</p>

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

No timber.
Undergrowth, shadscale.

Reestablishment of the Survey Executed
by A. D. Ferron, in 1873, and Retrace-
ment Executed by Howard W. Miller and
Andrew Nelson, in 1910.

From the cor. of secs. 14, 15, 22 and 23, monumented with
a 2 in. iron post, set, mkd. and witnessed as described
in the official record.

N. 1°02' E., bet. secs. 14 and 15.

Over nearly level desert land.

1.65 Road, unimproved, bears irregularly N. and S.

8.30 Same road, bears irregularly N. and S.

39.85 Wash, drains NE.

41.32 Point for the $\frac{1}{2}$ sec. cor. of secs. 14 and 15 at propor-
tionate dist.; there is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{2}$
S15 | S14
1962

Bury a cedar post, 4 ins. diam., 2 ft. in the ground
alongside iron post.

45.85 Wash, 70 lks. wide, 12 ft. deep, drains NE.

57.15 Wash, 50 lks. wide, 15 ft. deep, drains irregularly E.

79.15 Wash, 10 lks. wide, 3 ft. deep, drains about 3.00 chs.
E.; thence N.

82.64 The cor. of secs. 10, 11, 14 and 15, monumented with a
sandstone, 5x11x15 ins., firmly set, mkd. and witnessed
as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins.
in the ground, and in a mound of stone, 3 ft. base to
top, with brass cap mkd.

T21S R7E

S10 | S11
S15 | S14
1962

Bury original stone cor. alongside iron post.

Land, nearly level desert.

Soil, clay.

No timber.

Undergrowth, shadscale and scattered greasewood.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	<p>From the cor. of secs. 11, 12, 13 and 14, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record.</p>
	<p>West, bet. secs. 11 and 14.</p>
	<p>Over nearly level desert land through scattered greasewood and shadscale.</p>
40.59	<p>The $\frac{1}{2}$ sec. cor. of secs. 11 and 14, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record.</p>
	<p>S. 89°31' W., beginning new measurement.</p>
9.40	<p>Wash, 70 lks. wide, 12 ft. deep, drains SE.</p>
35.50	<p>Wash, 10 lks. wide, 5 ft. deep, drains N.</p>
40.31	<p>The cor. of secs. 10, 11, 14 and 15.</p>
	<p>Land, nearly level desert.</p>
	<p>Soil, clay.</p>
	<p>No timber.</p>
	<p>Undergrowth, scattered greasewood and shadscale, east portion; shadscale, west portion.</p>
	<p>Reestablishment of Survey Executed by A.D.Ferron, in 1873.</p>
	<p>N. 1°24' W., bet. secs. 10 and 11.</p>
	<p>Over nearly level desert land.</p>
8.85	<p>Wash, 60 lks. wide, 10 ft. deep, drains irregularly E.</p>
41.48	<p>Point for the $\frac{1}{2}$ sec. cor. of secs. 10 and 11 at proportionate dist.; there is no remaining evidence of the original cor.</p>
	<p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p>
	<p>T21S R7E $\frac{1}{2}$ S10 S11 1962</p>
	<p>No accessories available.</p>
45.95	<p>Wash, 100 lks. wide, 8 ft. deep, drains NE.</p>
54.65	<p>Wash, 150 lks. wide, 10 ft. deep, drains NE.</p>
59.45	<p>Wash, 50 lks. wide, 10 ft. deep, drains E.</p>
63.45	<p>Wash, 300 lks. wide, 15 ft. deep, drains irregularly E.</p>
82.96	<p>The cor. of secs. 2, 3, 10 and 11, monumented with a limestone, 5x10x16 ins., firmly set, mkd. and witnessed as described in the official record.</p>
	<p>At the cor. point</p>
	<p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p>
	<p>T21S R7E S3 S2 S10 S11 1962</p>
	<p>Bury original stone cor. alongside iron post.</p>
	<p>Land, nearly level desert.</p>
	<p>Soil, clay.</p>
	<p>No timber.</p>
	<p>Undergrowth, shadscale.</p>
	<p>From the cor. of secs. 1, 2, 11 and 12.</p>
	<p>N. 88°53' W., bet. secs. 2 and 11.</p>

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
	Over nearly level desert land.
41.73	The $\frac{1}{4}$ sec. cor. of secs. 2 and 11, monumented with a sand-stone, 5x6x10 ins., firmly set, mkd. and witnessed as described in the official record. At the cor. point Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T21S R7E $\frac{1}{4}$ $\frac{S2}{S11}$ 1962
	S. $88^{\circ}11'$ W., beginning new measurement.
23.10	Low clay ridge, bears NW. and E.
27.40	Wash, 20 lks. wide, 3 ft. deep, drains SE.
41.28	The cor. of secs. 2, 3, 10 and 11. Land, nearly level desert. Soil, clay No timber Undergrowth, shadscale.
	N. $1^{\circ}56'$ E., bet. secs. 2 and 3. Over nearly level desert land.
4.17	Fence, bears N. $89^{\circ}45'$ W., and S. $89^{\circ}45'$ E.
24.60	Wash, 300 lks. wide, 15 ft. deep, drains NE.
31.30	Wash, 150 lks. wide, 10 ft. deep, drains E.
35.80	Wash, 200 lks. wide, 12 ft. deep, drains E.
40.21	Point for the $\frac{1}{4}$ sec. cor. of secs. 2 and 3 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T21S R7E $\frac{1}{4}$ S3 S2 1962 No accessories available.
59.60	Wash, 10 lks. wide, 3 ft. deep, drains E.
65.50	Wash, 20 lks. wide, 4 ft. deep, drains E.
77.80	Road, unimproved, bears irregularly E. and W.
79.80	Wash, 10 lks. wide, 2 ft. deep, drains E.
80.62	The cor. of secs. 2, 3, 34 and 35, on the N. bdy of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the dependent resurvey of the Fourth Standard Parallel South (south bdy. of T. 20 S., R. 7 E.). Land, nearly level desert. Soil, clay.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

No timber.
Undergrowth, shadscale.

Reestablishment of the Survey Executed by A. D. Ferron in 1873 and Retracement Executed by Howard W. Miller and Andrew Nelson in 1910.

From the cor. of secs. 33 and 34 on the S. bdy. of the Tp., hereinbefore described.

N. 0°19' W., bet. secs. 33 and 34.

Over rolling land, through dense pinon and juniper timber.

Desc. 170 ft. over rocky NW. slope.

21.00 Leave dense timber, bears NE. and SW.

25.90 Draw, drains NE.; asc. 50 ft. over SE. slope.

27.80 Spur, projects NE. about 6.00 chs.; desc. 55 ft. over NW. slope.

31.90 Draw, drains NE.; asc. 30 ft. over SE. slope.

33.70 Spur, projects NE. about 5.00 chs.; desc. 15 ft. over NE. slope.

40.29 The $\frac{1}{2}$ sec. cor. of secs. 33 and 34, monumented with a limestone, 6x10x20 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{2}$
S33 | S34
1962

Bury original stone cor. alongside iron post.

N. 1°11' W., beginning new measurement.

Over gently rolling land.

4.50 Fence, bears NE. and SW.

11.30 Fence, bears SW. and NE.

40.40 The cor. of secs. 27, 28, 33 and 34, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record.

Land, rolling, broken south portion; gently rolling north portion.

Soil, rocky sandy clay, south portion; clay, north portion.

Timber, dense pinon and juniper, south portion; none, north portion.

Undergrowth, shadscale and greasewood, north portion.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

N. 0°39' W., bet. secs. 27 and 28.

Over nearly level land.

4.10 Wash, 10 lks. wide, 4 ft. deep, drains E.

11.05 Fence, bears SE. and NW. about 1.50 chs.; thence W.

17.40 Wash, 40 lks. wide, 6 ft. deep, drains SE.

41.31 The $\frac{1}{4}$ sec. cor. of secs. 27 and 28, monumented with a limestone, 10x11x14 ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 20 ins. in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{4}$
S28 | S27
1962

No accessories available.

N. 0°58' W., beginning new measurement.

9.60 Wash, 10 lks. wide, 1 ft. deep, drains SW.

20.50 Fence, bears N. 0°40' W., and SE.

21.20 Fence, bears NW.

32.20 Gravel road, from Moore to Dry Wash, bears NW. and SE.

32.65 Fence, bears NW.

41.03 The cor. of secs. 21, 22, 27 and 28., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record.

Land, nearly level desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

N. 0°40' W., bet. secs. 21 and 22.

Over gently rolling land.

36.30 Wash, 20 lks. wide, 2 ft. deep, drains NE.

40.67 The $\frac{1}{4}$ sec. cor. of secs. 21 and 22, monumented with a sandstone, 6x10x12 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

T21S R7E

 $\frac{1}{2}$

S21|S22

1962

Bury original stone cor. alongside iron post.

Deposit broken glass around iron post, 6 ins. below ground.

N. 0°40' W., beginning new measurement.

- 3.14 Fence, bears N. 3°50' W. and S. 3°50' E.
- 32.90 Wash, 150 lks. wide, 5 ft. deep, drains NE.
- 35.40 Wash, 60 lks. wide, 6 ft. deep, drains NE.
- 38.20 Wash, 200 lks. wide, 5 ft. deep, drains NE.
- 40.39 Point selected for the witness cor. of secs. 15, 16, 21 and 22.
- Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

W C

 $\begin{array}{c} \uparrow \\ \text{S16} | \text{S15} \\ \text{S21} | \text{S22} \end{array}$

1962

- 40.72 Point for the cor. of secs. 15, 16, 21 and 22, at record dist. of the 1910 retracement, falls in wash, 200 lks. wide, 5 ft. deep, draining irregularly E. There is no remaining evidence of the original cor.

Land, nearly level.
Soil, clay.
No timber.
Undergrowth, shadscale.

From the cor. of secs. 14, 15, 22 and 23.

N. 89°58' W., bet. secs. 15 and 22.

Over nearly level land.

- .60 Road, unimproved, bears irregularly N. and S.
- 14.70 Wash, 10 lks. wide, 4 ft. deep, drains NW.
- 40.585 Point for the ¼ sec. cor. of secs. 15 and 22 at record dist. of the 1910 retracement.
- Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

T21S R7E

$$\frac{1}{4} \frac{S15}{S22}$$

1962

- 62.65 Wash, 20 lks. wide, 3 ft. deep, drains N.
74.65 Wash, 60 lks. wide, 5 ft. deep, drains NE.
80.05 Wash, 200 lks. wide, 5 ft. deep, drains NE.
81.17 The true point for cor. of secs. 15, 16, 21 and 22 at record. dist.

Land, nearly level desert.
Soil, clay.
No timber.
Undergrowth, shadscale, scattered greasewood.

Reestablishment of the Survey Executed by A. D. Ferron,
in 1873.

N. 0°03' W., bet. secs. 15 and 16.

Over gently rolling land.

- 34.18 Fence, bears NNE. and SSW.; enter cultivated land.
39.50 Irrigation ditch, 10 lks. wide, 1 ft. deep, drains E.
40.95 Point for the $\frac{1}{4}$ sec. cor. of secs. 15 and 16 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

$$\frac{1}{4} \frac{S16}{S15}$$

1962

No accessories available.

- 55.80 Fence, bears E. and W.; leave cultivated land.
64.70 Road, unimproved, bears irregularly E. and W.
74.40 Wash, 10 lks. wide, 3 ft. deep, drains irregularly E.
81.90 Point for the cor. of secs. 9, 10, 15 and 16 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

$$\frac{S9}{S16} \frac{S10}{S15}$$

1962

No accessories available.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	<p>Land, nearly level desert. Soil, loamy clay. No timber. Undergrowth, shadscale in desert land.</p>
1.50	<p>From the cor. of secs. 10, 11, 14 and 15. S. 89°50' W., bet. secs. 10 and 15. Over nearly level desert land. Center of stock pond, about 2.00 chs. x 3.00 chs.</p>
39.30	<p>Irrigation ditch, 10 lks. wide, 3 ft. deep, drains SE.</p>
41.32	<p>The $\frac{1}{4}$ sec. cor. of secs. 10 and 15, monumented with a limestone, 7x12x18 ins., firmly set, plainly mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E $\frac{1}{4}$ $\frac{S10}{S15}$ 1962</p> <p>Bury original stone cor. alongside iron post.</p> <p>No accessories available.</p>
41.39	<p>S. 89°04' W., beginning new measurement.</p> <p>The cor. of secs. 9, 10, 15 and 16.</p> <p>Land, nearly level desert. Soil, loamy clay. No timber. Undergrowth, shadscale, with widely scattered rabbit brush.</p>
1.55	<p>N. 2°05' W., bet. secs. 9 and 10.</p> <p>Over nearly level desert land.</p> <p>Road, unimproved, bears NE. and SW.</p> <p>Wash, 10 lks. wide, 3 ft. deep, drains NE.</p> <p>Wash, 10 lks. wide, 2 ft. deep, drains E.</p> <p>Wash, 15 lks. wide, 4 ft. deep, drains E.</p> <p>The $\frac{1}{4}$ sec. cor. of secs. 9 and 10, monumented with a limestone, 6x10x12 ins., firmly set, mkd. and witnessed as described in the official record</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p>

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

T21S R7E

 $\frac{1}{2}$
 S9 | S10
 1962

Bury original stone cor. alongside iron post.

No accessories available.

N. 0°08' E., beginning new measurement.

11.60 Wash, 10 lks. wide, 4 ft. deep, drains E.

15.15 Road, unimproved, bears E. and W.

26.75 Fence, bears E. and W.

32.50 Wash, 50 lks. wide, 10 ft. deep, drains SE.

39.05 Wash, 150 lks. wide, 10 ft. deep, drains SE.

40.50 Point for the cor. of secs. 3, 4, 9 and 10 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

 $\frac{1}{2}$
 S4 | S3
 S9 | S10
 1962

No accessories available.

Land, nearly level desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 2, 3, 10 and 11.

S. 88°40' W., bet. secs. 3 and 10.

Over nearly level desert land.

32.70 Fence, bears N. and S.

41.17 The ¼ sec. cor. of secs. 3 and 10, monumented with a limestone, 6x8x10 ins., and an old fence post set alongside. I accept this as a perpetuation of the original cor. point.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T21S R7E

 $\frac{1}{2}$
 S3
 S10
 1962

Bury stone and old fence post alongside iron post.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
	S. 88°12' W., beginning new measurement.
1.30	Wash, 30 lks. wide, 12 ft. deep, drains S. 75° E.
4.70	Wash, 20 lks. wide, 5 ft. deep, drains NE.
19.70	Wash, 50 lks. wide, 5 ft. deep, drains SE.
40.80	The cor. of secs. 3, 4, 9 and 10. Land, nearly level desert. Soil, clay. No timber. Undergrowth, shadscale.
	N. 2°42' E., bet. secs. 3 and 4. Over nearly level desert land.
1.40	Wash, 20 lks. wide, 3 ft. deep, drains SE.
7.70	Road, unimproved, bears E. and W.
32.70	Wash, 50 lks. wide, 6 ft. deep, drains E.
33.30	Wash, 50 lks. wide, 7 ft. deep, drains irregularly E.
37.00	Wash, 20 lks. wide, 4 ft. deep, drains E.
40.54	Point for the $\frac{1}{2}$ sec. cor. of secs. 3 and 4 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T21S R7E $\frac{1}{2}$ S4 S3 1962 Over gently rolling desert land.
43.30	Wash, 300 lks. wide, 15 ft. deep, drains irregularly E.
51.10	Wash, 10 lks. wide, 3 ft. deep, drains irregularly E.
60.10	Road, unimproved, bears NW. and irregularly E.
78.30	Wash, 10 lks. wide, 2 ft. deep, drains irregularly E.
80.00	Power line, bears NE. and SW.; with unimproved road alongside.
81.39	The cor. of secs. 3, 4, 33 and 34, on the N. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the Fourth Standard Parallel South (South bdy. of T. 20' S., R. 7 E.). Land, nearly level South portion; gently rolling North portion. Soil, loamy clay. No timber. Undergrowth, shadscale.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
	<p>From the cor. of secs. 32 and 33, on the S. bdy. of the Tp.</p> <p>N. 0°32' W., bet. secs. 32 and 33.</p> <p>Over nearly level desert land.</p>
3.50	Road, unimproved, bears irregularly E. and W.
6.00	Irrigation ditch, 5 lks. wide, 2 ft. deep, drains NE.
28.50	Wash, 15 lks. wide, 3 ft. deep, drains E.
31.70	Wash, 10 lks. wide, 2 ft. deep, drains irregularly E.
40.83	<p>Point for the $\frac{1}{2}$ sec. cor. of secs. 32 and 33 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E $\frac{1}{2}$ S32 S33 1962</p>
61.80	Fence, bears E. and W.
81.66	<p>Point for the cor. of secs. 28, 29, 32 and 33 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E S29 S28 S32 S33 1962</p> <p>No accessories available.</p> <p>Land, nearly level desert. Soil, loamy clay. No timber. Undergrowth, shadscale.</p>
	<p>From the cor. of secs. 27, 28, 33 and 34.</p> <p>N. 89°59' W., bet. secs. 28 and 33.</p> <p>Over nearly level desert land.</p>
40.45	Wash, 30 lks. wide, 6 ft. deep, drains NE.
40.84	<p>Point for the $\frac{1}{2}$ sec. cor. of secs. 28 and 33 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p>

23

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
	<p style="text-align: center;">T21S R7E $\frac{1}{4}$ $\frac{S28}{S33}$ 1962</p> <p>55.25 Stock pond dam, bears N. about 3.00 chs. and S. about 8.00 chs., thence along N. edge of pond.</p> <p>59.20 NW. edge of pond.</p> <p>69.70 E. edge of small stock pond, about 2.00 chs. long.</p> <p>71.20 W. edge of pond, enter cultivated land.</p> <p>81.68 The cor. of secs. 28, 29, 32 and 33.</p> <p>Land, nearly level desert E. portion; cultivated W. portion. Soil, loamy clay. No timber. Undergrowth, shadscale, sage brush and greasewood E. portion.</p>
	<p>N. 0°53' W., bet. secs. 28 and 29.</p> <p>Over gently rolling desert land.</p> <p>3.80 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains SE.</p> <p>18.15 Fence, bears NW. and SE.</p> <p>40.84 The $\frac{1}{4}$ sec. cor. of secs. 28 and 29, monumented with a sandstone, 5x10x10 ins., firmly set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E $\frac{1}{4}$ $\frac{S29}{S28}$ 1962</p> <p>Bury original stone cor. alongside iron post.</p> <hr/> <p>N. 0°32' W., beginning new measurement.</p> <p>4.20 Road, unimproved, bears E. and W.</p> <p>5.80 Road, unimproved, bears NE. and SW.</p> <p>6.20 Fence, parallels road.</p> <p>20.35 Fence, bears E. and W.</p> <p>30.60 Irrigation ditch, 10 lks. wide, 2 ft. deep, drains E.</p> <p>35.75 Fence, bears E.</p> <p>40.42 Fence, bears E. and W. and power line, bears E. and W.</p> <p>Point selected for the witness cor. of secs. 20, 21, 28 and 29.</p>

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T21S R7E

W C

S20¹/S21

S29/S28

1962

40.92 Point for the cor. of secs. 20, 21, 28 and 29, at intersection of gravel road from E. N. and W. These roads are along the section lines as told to me by interested land owners, and is accepted as the best evidence of the position of the original cor. Bury a stone mkd. X 10 ins. below ground.

Land, nearly level desert S. portion; level farm land N. portion.

Soil, loamy clay.

No timber.

Undergrowth, shadscale S. portion.

From the cor. of secs. 21, 22, 27 and 28.

S. $89^{\circ}51'$ W., bet. secs. 21 and 28.

Over nearly level land.

16.25 Fence, bears SE. and NW. about 0.50 chs.; thence W.

19.30 Gravel road from Dry Wash to Moore, bears SE. and W.; thence along road.

40.83 Point for the $\frac{1}{4}$ sec. cor. of secs. 21 and 28, on center line of gravel road, and at proportionate dist. Gravel road is along sec. line as told to me by interested land owners.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. below surface of road, with brass cap mkd.

T21S R7E

 $\frac{1}{4}$ S21 $\frac{1}{4}$ S28

1962

from which

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24 ins. in the ground, and in a collar of stone to top, for a reference monument, bears N., 17 ft. dist., with brass cap mkd. T21SR7ES21 RM 17' 1962, and an arrow pointing to the true cor.

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24 ins. in the ground and in a collar of stone, for a reference monument, bears S. 17 ft. dist., with brass cap mkd. T21SR7ES28 RM 17' 1962, and an arrow pointing to the true cor.

S. $89^{\circ}28'$ W., beginning new measurement.

40.43 Power line, bears N. and S. 0.50 ch., thence W.

40.83 True point for the cor. of secs. 20, 21, 28 and 29, from which its witness cor. bears S. $0^{\circ}32'$ E., 50 fms. dist.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	<p>Land, nearly level farm land. Soil, loamy clay. No timber. No undergrowth.</p>
	<p>N. 0°42' W., bet. secs. 20 and 21.</p> <p>Over level farm land, along gravel road, with fence line and telephone line paralleling road on W. side and power line paralleling road on E. side.</p>
28.05	Fences, bears E., W., and N.
40.54	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 20 and 21 on the center line of gravel road, and in line with property line fences to the E. and W.; and is accepted as the best evidence of the position of the original cor.</p>
	At the cor. point
	Set an iron post, 6 ins. long, 1 in. diam., 12 ins. below surface of road, with brass cap mkd.
	<p style="text-align: center;">T21S R7E $\frac{1}{4}$ S20 S21 1962</p>
	from which
	<p>An iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., set 24 ins. in the ground, for a reference monument, bears E. 25 ft. dist., with brass cap mkd. T21SR7E S21 RM 25' 1962, with an arrow pointing to the true cor.</p>
	<p>An iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., set 24 ins. in the ground, for a reference monument, bears W. 25 ft. dist., with brass cap mkd. T21SR7E S20 RM 25' 1962, with an arrow pointing to the true cor.</p>
	N. 0°42' W., beginning new measurement.
	Continue along gravel road.
9.60	SW. cor. of house, bears E. about 1.50 chs. dist.
12.05	SW. cor. of house, bears E.; about 1.50 chs. dist.
12.60	SE. cor. of house, bears W.; about 1.70 chs. dist.
19.70	SW. cor. of house, bears E.; about 1.50 chs. dist.
20.40	Fence, bears W.
23.70	Fence, bears E.
28.65	Fence, bears E.
36.45	Fence, bears W.
41.72	<p>Point for the cor. of secs. 16, 17, 20 and 21 on center line of gravel road, and in line with property line fence to E.; and is accepted as the best evidence of the position of the original cor.</p>

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

At the cor. point

Set an iron post, 6 ins. long, 1 in. diam., 12 ins. in
below surface of road, with brass cap mkd.

T21S R7E

S17 | S16

S20 | S21

1962

from which

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24
ins. in the ground, for a reference monument, bears
N. $60^{\circ}15'$ E., 30.8 ft. dist., with brass cap mkd.
T21SR7E S16RM 30.8' 1962, with an arrow pointing
to true cor.

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24
ins. in the ground, for a reference monument, bears
S. 45° E., 38.9 ft. dist., with brass cap mkd.
T21SR7E S21 RM 38.9' 1962, with an arrow pointing
to true cor.

Land, level farm land.

Soil, loamy clay.

Timber, cottonwood trees around houses.

No undergrowth.

From the true point for cor. of secs. 15, 16, 21 and 22.

N. $89^{\circ}27'$ W., bet. secs. 16 and 21.

Over nearly level meadow land and farm land.

- 1.80 Fence, bears W. and S. $3^{\circ}50'$ E., thence along fence line.
- 10.60 Wash, 50 lks. wide, 5 ft. deep, drains SE.
- 19.90 Fence, bears N.; enter meadow land.
- 40.54 Point for the $\frac{1}{4}$ sec. cor. of secs. 16 and 21 at inter-
section of property line fences from N., S. and W.; it
is accepted as the best evidence of the position of the
original cor.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{4}$ S16

S21

1962

No accessories available.

S. $89^{\circ}52'$ W., beginning new measurement.

Along fence line.

- 20.03 Fence, bears N.; leave meadow land.

- 41.05 The cor. of secs. 16, 17, 20 and 21.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
	<p>Land, nearly level meadow and farm land. Soil, loamy clay. No timber. No undergrowth.</p>
	<p>N. 0°38' W., bet. secs. 16 and 17. Over level farm land, along gravel road.</p>
4.60	Fence, bears W.
12.25	Fence, bears W.
16.80	SE. cor. of house, bears W., 1.00 ch. dist.
20.15	Fence, bears E. and W.
39.30	NW. cor. of house, bears E., about 1.00 ch. dist. NE. cor. of basement house, bears W., about 1.50 ch. dist.
40.71	Point for the $\frac{1}{4}$ sec. cor. of secs. 16 and 17, at intersection of gravel road bearing N. and S., and road bearing E. and W.; and is accepted as the best evidence of the position of the original cor. At the cor. point Set an iron post, 6 ins. long, 1 in. diam., 12 ins. below surface of gravel road, with brass cap mkd. <div style="text-align: center;">T21S R7E $\frac{1}{4}$ S17 S16 1962</div> from which An iron post, 30 ins. long, 2½ ins. diam., set 24 ins. in the ground, for a reference monument, bears N. 32°45' E., 41.7 ft. dist., with brass cap mkd. T21SR7E S16 RM 41.7' 1962, with an arrow pointing to true cor. An iron post, 30 ins. long, 2½ ins. diam., set 24 ins. in the ground, for a reference monument, bears S. 37°15' E., 36.9 ft. dist., with brass cap mkd. T21SR7E S16 RM 36.9' 1962, with an arrow pointing to the true cor.
	<p>N. 0°25' W., beginning new measurement.</p>
23.20	Fence, bears S. 0°25' E. and N. 16°35' E. Telephone line, parallels fence.
24.15	Center line of Utah Highway No. 10, bears N. 16°35' E., and S. 16°35' W.
26.10	Power line, parallels highway.
40.30	Point for the cor. of secs. 8, 9, 16 and 17, in line with gravel road to S., and property line fences to E. and W., and is accepted as the best evidence of the position of the original cor.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	<p>At the cor. point</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <div style="text-align: center;"> $\begin{array}{r} T21S\ R7E \\ \hline S8\ S9 \\ S17\ S16 \\ \hline 1962 \end{array}$ </div> <p>Land, level farm land. Soil, loamy clay. No timber. No undergrowth.</p>
<p>11.85</p> <p>35.15</p> <p>41.50</p>	<p>From the cor. of secs. 9, 10, 15 and 16.</p> <p>S. $89^{\circ}59'$ W., bet. secs. 9 and 16.</p> <p>Over nearly level desert land.</p> <p>Road, unimproved, bears NE. and curves SW.</p> <p>Same road, bears NW. and SE.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 9 and 16, at intersection of property line fences from the W. and S.; and is accepted as the best evidence of the position of the original cor.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> $\begin{array}{r} T21S\ R7E \\ \hline \frac{1}{4}\ S9 \\ \hline S16 \\ \hline 1962 \end{array}$ </div> <p>No accessories available.</p> <hr/> <p>S. $89^{\circ}18'$ W., beginning new measurement.</p> <p>Along fence line.</p> <p>Wash, 20 lks. wide, 4 ft. deep, drains S.; enter farm land.</p> <p>Fence, parallels highway; leave farm land.</p> <p>Telephone line, parallels highway.</p> <p>Center line of Utah Highway No. 10, bears N. $16^{\circ}35'$ E. and S. $16^{\circ}35'$ W.</p> <p>Fence, parallels highway.</p> <p>Power line, parallels highway.</p> <p>The cor. of secs. 8, 9, 16 and 17.</p> <p>Land, nearly level desert, E. portion; level farm land, W. portion. Soil, loamy clay.</p>

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	<p>No timber. Undergrowth, shadscale and rabbit brush, East portion.</p>
	<p>N. 0°56' W., bet. secs. 8 and 9.</p> <p>Over gently rolling desert land.</p> <p>Asc. 40 ft. over gentle SE. slope.</p>
11.40	Road, unimproved, bears NW. and SE.
14.60	Road, unimproved, bears E. and W.
21.60	Wash, 40 lks. wide, 6 ft. deep, drains E.
40.15	<p>The $\frac{1}{2}$ sec. cor. of secs. 8 and 9, monumented with a sand- stone, 4x5x10 ins., firmly set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E $\frac{1}{2}$ S8 S9 1962</p> <p>Deposit original stone cor. alongside iron post.</p> <p>Cor. located on fence line, bears E. and W.</p>
	<p style="text-align: center;">_____</p> <p>N. 0°56' W., beginning new measurement.</p> <p>Asc. 70 ft. over SW. slope.</p>
13.60	Wash, 5 lks. wide, 10 ft. deep, drains SW.
24.50	U. S. Geological Survey elevation marker, bears E., 51 lks. dist., monumented with a brass tablet, set in a concrete block 6x8x8 ins. above ground, mkd.
	<p style="text-align: center;">1923 ELEVATION ABOVE SEA LEVEL 6313 FT. 9 W</p>
26.10	Wash, 40 lks. wide, 6 ft. deep, drains SW.; asc. 20 ft. over S. slope of clay knoll.
30.60	Wash, 40 lks. wide, 8 ft. deep, drains SW.; enter clay hills.
34.20	Top of knoll; desc. 50 ft. over NE. slope.
37.80	Draw, drains E.; asc. 80 ft. over steep S. slope.
39.90	Spur, projects E.; desc. 40 ft. over NE. slope.
41.20	The cor. of secs. 4, 5, 8 and 9, monumented with a sand- stone, 4x7x10 ins., firmly set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

 $\frac{S5}{S8} \frac{S4}{S9}$

1962

Bury original stone cor. alongside iron post.

No accessories available.

Land, gently rolling, south portion; mountainous, north portion.

Soil, clay.

No timber.

Undergrowth, shadscale and rabbit brush.

From the cor. of secs. 3, 4, 9 and 10.

S. $89^{\circ}26'$ W., bet. secs. 4 and 9.

Over nearly level desert land.

.65 Wash, 30 lks. wide, 5 ft. deep, drains SE.

14.60 Wash, 15 lks. wide, 3 ft. deep, drains SE.

18.56 Fence, bears N. and S.

36.00 Power line, bears NE. and SW.

41.05 Point for the $\frac{1}{4}$ sec. cor. of secs. 4 and 9 at proportionate dist.; and on property line fence, bearing E. and W. There is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T21S R7E

 $\frac{1}{4} \frac{S4}{S9}$

1962

S. $89^{\circ}50'$ W., beginning new measurement.

2.87 Fence, parallels highway.

3.10 Telephone line, parallels highway.

3.48 Center line of Utah Highway No. 10, bears N. $25^{\circ}00'$ E., and S. $25^{\circ}00'$ W.

4.20 Fence, parallels highway.

20.65 Wash, 40 lks. wide, 7 ft. deep, drains irregularly E.

31.05 Wash, 30 lks. wide, 5 ft. deep, drains NE.

36.80 Base of spur, projects from W.; asc. 90 ft. over NE. slope.

41.05 The cor. of secs. 4, 5, 8 and 9.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
	<p>Land, nearly level desert. Soil, clay. No timber. Undergrowth, shadscale.</p>
	<p>N. 3°43' E., bet. secs. 4 and 5.</p> <p>Desc. 80 ft. over NE. slope.</p>
4.00	Base of descent, bears NW. and SE.; thence over nearly level desert land.
13.70	Wash, 10 lks. wide, 3 ft. deep, drains E.
32.50	Wash, 40 lks. wide, 8 ft. deep, drains NE.
39.96	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 4 and 5 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E $\frac{1}{4}$ S5 S4 1962</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p>
48.50	Wash, 150 lks. wide, 12 ft. deep, drains irregularly E., enter gently rolling land.
51.20	Wash, 20 lks. wide, 10 ft. deep, drains irregularly E.
53.50	Wash, 80 lks. wide, 15 ft. deep, drains SE.
80.37	<p>The cor. of secs. 4, 5, 32 and 33 on the N. bdy. of the Tp., monumented with an iron post, 2$\frac{1}{2}$ ins. diam., set, mkd. and witnessed as described in the 1962 field notes of the Fourth Standard Parallel South (south bdy. of T. 20 S., R. 7 E.).</p> <p>Land, nearly level desert, south portion; gently rolling north portion. Soil, clay. No timber. Undergrowth, shadscale.</p>
	<p>From the cor. of secs. 31 and 32, on the S. bdy. of the Tp.</p> <p>N. 0°28' W., bet. secs. 31 and 32.</p> <p>Over nearly level farm land.</p>
10.85	Gravel road, bears NW. and SE.
13.73	Fence, bears NW. and SE.
13.90	Power line, bears N. and SE.
40.50	Point for the $\frac{1}{4}$ sec. cor. of secs. 31 and 32 at proportionate dist.; there is no remaining evidence of the original cor.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{2}$
S31 | S32
1962

No accessories available.

Cor. situated along power line.

54.00 Irrigation ditch, 5 lks. wide, 1 ft. deep, drains E.

61.10 Fence cor., with fences bearing N., E. and W.

81.00 Point for the cor. of secs. 29, 30, 31 and 32, at intersection of property line fences from the S., N., E. and W.; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

S30 | S29
S31 | S32
1962

No accessories available.

Land, nearly level farm land.

Soil, loamy clay.

No timber.

No undergrowth.

From the cor. of secs. 28, 29, 32 and 33.

S. $87^{\circ}50'$ W., bet. secs. 29 and 32.

Over level farm land.

40.56 Fence, bears N. and S.

Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 29 and 32.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

W S29
← C S32
1962

No accessories available.

40.86 Point for the $\frac{1}{4}$ sec. cor. of secs. 29 and 32, on center line of road, bears N. and S., and in line with property line fence to W. Bury a stone mkd X 6 ins. below ground.

S. $89^{\circ}37'$ W., beginning new measurement.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
.30	Fence, bears N, 57', and W.
40.62	<p>The cor. of secs. 29, 30, 31 and 32.</p> <p>Land, level farm land.</p> <p>Soil, loamy clay.</p> <p>No timber.</p> <p>No undergrowth.</p>
	<p>S. 89°40' W., bet. secs. 30 and 31.</p> <p>Over level farm land, along fence line.</p>
20.18	Fence, bears S.
40.13	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 30 and 31 at proportionate dist., and on property line fence, bears S. 89°38' W. and N. 89°40' E.</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T21S R7E $\frac{1}{4}$ $\frac{S30}{S31}$ 1962</p> <p>No accessories available.</p>
	<p>S. 89°38' W., beginning new measurement.</p> <p>Continue along fence line.</p>
1.15	Wash, 30 lks. wide, 5 ft. deep, drains SE.
10.35	Road, unimproved, bears NW. and SE.
16.90	Irrigation ditch, drains SW.; asc. 30 ft. over SE. slope of small knoll.
20.50	Top of ascent, slopes S.; desc. 50 ft. over SW. slope.
40.13	<p>The cor. of secs. 25, 30, 31 and 36, on the W. bdy. of the Tp., hereinbefore described.</p> <p>Land, nearly level farm land.</p> <p>Soil, loamy clay.</p> <p>No timber.</p> <p>No undergrowth.</p>
	<p>From the cor. of secs. 29, 30, 31 and 32.</p> <p>N. 0°47' W., bet. secs. 29 and 30.</p> <p>Over level farm land, along fence line.</p>
40.32	Center line of Utah Highway No. 10, bears N. 61° E. and S. 61° W.
40.59	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 29 and 30, on center line of old fence to the S., and in line with property line fence to the E.; and is accepted as the best evidence of the position of the original cor.</p> <p>At the cor. point</p>

Dependent Resurvey of a Portion of the Sub-
division of T. 21 S., R. 7 E.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T21S R7E

$\frac{1}{2}$
S30 | S29
1962

N. $0^{\circ}36'$ E., beginning new measurement.

Over rolling desert land.

Asc. 75 ft. over SW. slope.

- 225 Fence, bears N. 61° E. and S. 61° W.
- 3.88 Power line, bears NE. and SW.
- 30.65 Road, unimproved, bears NW. and SE.
- 33.45 Irrigation canal, 20 lks. wide, 2 ft. deep, drains SE.
- 36.20 Spur, projects SE.; desc. 30 ft. over NE. slope.
- 41.65 Point for the cor. of secs. 19, 20, 29 and 30, at proportionate dist. From this point, the original cor. was found N. 45° W., 2.33 chs. dist., which is a sandstone, $2 \times 10 \times 14$ ins., plainly mkd., and lying loose upon a pile of trash on old cabin site. According to statements of interested land owners, this is not the original position of the cor. and is not accepted as such.

At proportionate dist.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T21S R7E

S19 | S20
S30 | S29
1962

Bury original stone cor. alongside iron post.

Land, level farm land, south portion; rolling desert, north portion.

Soil, clay.

No timber.

Undergrowth, shadscale, north portion.

From the true point for cor. of secs. 20, 21, 28 and 29.

S. $89^{\circ}11'$ W., bet. secs. 20 and 29.

Along gravel road, over level farm land.

20.40 Fence, bears N.

39.97 Fence, bears N. and S.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

40.48

Point for the $\frac{1}{4}$ sec. cor. of secs. 20 and 29 at intersection of gravel road to E. and Utah Highway No. 10, and is accepted as the best evidence of the position of the original cor.; highway under construction and cor. point not monumented.

S. 89°06' W., beginning new measurement.

0.42

Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 20 and 29.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T21S R7E
 $\frac{1}{4}$ S20 W
 $\frac{1}{4}$ S29 C
 1962

Cor. situated on power line, bears N. and E.

0.54

U. S. C. & G. S. Bench Mark, bears S., 17 lks. dist., monumented with a brass tablet, set in cement block, 6x8x8 in. above ground, with brass cap mkd.

U40

1934

4.92

Fence, bears N. and S.

40.08

The cor. of secs. 19, 20, 29 and 30.

Land, level farm land.

Soil, loamy clay.

Timber, cottonwood trees along the W. portion.

No undergrowth.

S. 88°03' W., bet. secs. 19 and 30.

Over rolling desert land.

Asc. 30 ft. over NE. slope.

7.47

Telephone line, bears NW. and SE.

8.25

Spur, projects SE.; desc. 30 ft. over SW. slope.

12.05

Irrigation ditch, 5 lks. wide, 2 ft. deep, drains SE.

14.15

Road, unimproved, bears NW. and SE.

14.85

Fence, bears NW. and SE.; enter farm land.

24.00

Fence, bears N. and S.; leave farm land, enter gently rolling desert.

29.15

Irrigation canal, 20 lks. wide, 3 ft. deep, flows NE.

39.76

The $\frac{1}{4}$ sec. cor. of secs. 19 and 30, monumented with a limestone, 5x8x11 ins., loosely set, dimly mkd., as described in the official record.

At the cor. point

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{4}$ $\frac{S19}{S30}$

1962

Bury original stone cor. alongside iron post.

No accessories available.

S. $88^{\circ}15'$ W., beginning new measurement.

19.40 Telephone line, bears NE. and SW.

34.50 Wash, 30 lks. wide, 10 ft. deep, drains SE.

40.51 The cor. of secs. 19, 24, 25 and 30 on the W. bdy. of Tp., hereinbefore described.

Land, rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale, rabbit brush, willows along canal.

From the cor. of secs. 19, 20, 29 and 30.

N. $0^{\circ}47'$ W., bet. secs. 19 and 20.

Over gently rolling desert land.

0.30 Road, unimproved, bears irregularly E. and W.

3.40 Fence, bears NW. and SE.

5.15 Fence, bears E. and ^W.

12.00 Fence, bears E. and W.

14.90 Wash, 30 lks. wide, 5 ft. deep, drains E.

19.00 Wash, 20 lks. wide, 2 ft. deep, drains SW.

19.30 Fence, bears irregularly W. and SE.

23.80 Irrigation ditch, drains E.

25.40 Irrigation canal, 20 lks. wide, 4 ft. deep, flows E.

41.65 Point for the $\frac{1}{4}$ sec. cor. of secs. 19 and 20, on property line fence, bearing E. and W.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{4}$ $\frac{S19}{S20}$

1962

No accessories available.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

N. 0°47' W., beginning new measurement.

40.16

Point for the cor. of secs. 17, 18, 19 and 20, at intersection of property line fences from N., E., and W., and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T21S R7E
S18 S17
S19 S20
1962

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 16, 17, 20 and 21.

S. 88°11' W., bet. secs. 17 and 20.

Over level farm land.

0.42

Fence, bears N. and S.; enter farm land.

19.95

Fence, parallels highway.

20.70

Center line of Utah Highway No. 10, bears N. 15°00' E. and S. 15°00' W.

21.33

Fence, parallels highway.

21.35

Power line, parallels highway.

40.46

Point for the ¼ sec. cor. of secs. 17 and 20, at intersection of property line fences from the N. and W.; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E
¼ S17
S20
1962

No accessories available.

S. 89°24' W., beginning new measurement.

Along fence line, leave farm land.

33.35

Irrigation canal, 15 lks. wide, 5 ft. deep, drains N.

40.18

The cor. of secs. 17, 18, 19 and 20.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

Land, level farm land, east portion; level desert, west portion.
Soil, loamy clay.
No timber.
Undergrowth, shadscale and rabbit brush, west portion.

S. 89°34' W., bet. secs. 18 and 19.

Over nearly level desert land, along fence line.

10.40 Telephone line, bears NE. and SW.

16.80 Wash, 30 lks. wide, 6 ft. deep, drains SE.

23.10 Wash, 20 lks. wide, 6 ft. deep, drains SE.

24.80 Wash, 20 lks. wide, 6 ft. deep, drains SE.

25.90 Wash, 10 lks. wide, 3 ft. deep, drains SE.

40.28 Point for the $\frac{1}{4}$ sec. cor. of secs. 18 and 19 at intersection of fence to E. and fence to N.; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T21S R7E

$\frac{1}{4}$ $\frac{S18}{S19}$
1962

No accessories available.

S. 86°09' W., beginning new measurement.

8.20 Wash, 10 lks. wide, 3 ft. deep, drains SE.

20.00 Enter low rolling hills.

38.54 The cor. of secs. 13, 18, 19 and 24 on the W. bdy. of the Tp., hereinbefore described.

Land, nearly level desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 17, 18, 19 and 20.

N. 0°06' E., bet. secs. 17 and 18.

Over nearly level desert land, along fence line.

17.50 Cement lined canal, 10 lks. wide, 3 ft. deep, drains NW.

19.55 Fence, bears E.

24.00 Telephone line, bears NE. and SW.

25.35 Fence, bears NE. and SW.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS		
27.00	Same canal, drains NE.	
27.40	Road, unimproved, bears NE. and SW.	
40.48	Point for the $\frac{1}{2}$ sec. cor. of secs. 17 and 18 at proportionate dist.; there is no remaining evidence of the original cor.	
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.	
	<p style="text-align: center;">T21S R7E $\frac{1}{2}$ S18 S17 1962</p>	
63.50	Wash, 10 lks. wide, 3 ft. deep, drains SE.	
77.00	Wash, 10 lks. wide, 6 ft. deep, drains SE.	
78.80	Wash, 20 lks. wide, 10 ft. deep, drains SE.	
80.96	Point for the cor. of secs. 7, 8, 17 and 18 at proportionate dist.; there is no remaining evidence of the original cor.	
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.	
	<p style="text-align: center;">T21S R7E S7 S8 S18 S17 1962</p>	
	Land, nearly level desert. Soil, clay. No timber. Undergrowth, shadscale.	
	From the cor. of secs. 8, 9, 16 and 17.	
	S. $89^{\circ}10'$ W., bet. secs. 8 and 17.	
	Over level farm land, along fence line.	
40.64	Point for the $\frac{1}{2}$ sec. cor. of secs. 8 and 17 at intersection of property line fences, from the E., S., and N.; and is accepted as the best evidence of the position of the original cor.	
	At the cor. point	
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.	
	<p style="text-align: center;">T21S R7E S8 $\frac{1}{2}$ S17 1962</p>	
	No accessories available.	
	S. $88^{\circ}11'$ W., beginning new measurement.	

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

	Leave farm land, enter gently rolling desert.
1.25	Cement-lined canal, drains NE.
4.05	Road, unimproved, bears N. and S.
10.40	Telephone line, bears NE. and SW.
33.25	Wash, 10 lks. wide, 2 ft. deep, drains SE.
34.35	Wash, 20 lks. wide, 4 ft. deep, drains SE.
39.18	The cor. of secs. 7, 8, 17 and 18. Land, level farm land, east portion; gently rolling desert, west portion. Soil, loamy clay. No timber. Undergrowth, shadscale west portion.
	S. 88°10' W., bet. secs. 7 and 18. Over gently rolling desert land.
1.65	Wash, 30 lks. wide, 10 ft. deep, drains SE.
5.10	Wash, 10 lks. wide, 6 ft. deep, drains SE.
30.00	Wash, 30 lks. wide, 5 ft. deep, drains SE.
39.12	Point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 18 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T21S R7E $\frac{1}{4}$ $\frac{S7}{S18}$ 1962
40.90	Wash, 40 lks. wide, 5 ft. deep, drains SE.
60.40	Wash, drains SE.; asc. about 300 ft. over broken, ledgy NE. slope of spur.
60.70	Fence, bears NW. and SE.
68.40	Point of ledgy spur, top of ledge, 50 ft. high, bears NW.; desc. abruptly 250 ft. over ledgy, precipitous SW. slope.
78.39	The cor. of secs. 7, 12, 13 and 18, on the W. bdy. of the Tp., hereinbefore described. Land, gently rolling desert, east portion; broken, mountainous, west portion. Soil, clay, with exposed sandstone, west portion. No timber. Undergrowth, shadscale.
	From the cor. of secs. 7, 8, 17 and 18. N. 0°17' E., bet. secs. 7 and 8.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	
	Over mountainous land.
5.50	Wash, 10 lks. wide, 2 ft. deep, drains SE.
22.50	Enter clay hills; asc. 150 ft. over SW. slope.
27.90	Fence, bears NE. and SW.
34.40	Spur, projects W.; desc. 60 ft. over N. slope.
36.00	Draw, drains NW.; asc. 20 ft. over SW. slope.
36.80	Top of ascent, slopes NW.; desc. 50 ft. over N. slope.
40.48	Point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 8 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T21S R7E $\frac{1}{4}$ S7 S8 1962 Desc. 50 ft. over N. slope.
44.50	Draw, drains E.; asc. 55 ft. over S. slope.
53.90	Small draw, drains SE.; asc. 320 ft. over steep, precipitous SW. slope.
62.25	Point of ledge, 30 ft. high, on ridge, bears E. and W.; desc. 340 ft. over steep N. slope.
80.96	Point for the cor. of secs. 5, 6, 7 and 8 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd. T21S R7E S6 S5 S7 S8 1962 Land, mountainous, broken. Soil, clay, exposed sandstone. No timber. Undergrowth, shadscale.
	From the cor. of secs. 4, 5, 8 and 9. S. $88^{\circ}20'$ W., bet. secs. 5 and 8. Over mountainous land. Asc. 70 ft. over NE. slope.
5.10	Top of ascent on N. side of clay knoll; desc. 120 ft. over NW. slope.
10.20	Telephone line, bears NE. and SW.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

- 15.80 Draw, drains N.; asc. 60 ft. over series of small spurs, projects S.
- 29.90 Top of ascent, S. side of clay knoll; desc. 50 ft. over SW. slope.
- 39.07 Point for the $\frac{1}{2}$ sec. cor. of secs. 5 and 8 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T21S R7E
 $\frac{1}{2}$ $\frac{S5}{S8}$
1962
- Desc. 25 ft. over W. slope.
- 50.35 Wash, 20 lks. wide, 4 ft. deep, drains N.; asc. 30 ft. over rolling NE. slope.
- 57.35 Wash, 30 lks. wide, 5 ft. deep, drains irregularly NE.
- 63.05 Spur, projects NE.; desc. 25 ft. over NW. slope.
- 69.15 Wash, drains N.; asc. 40 ft. over NE. slope.
- 75.80 Spur, projects N., 4.00 chs. to end; desc. 50 ft. over W. slope.
- 77.90 Wash, 20 lks. wide, 5 ft. deep, drains N.; asc. 10 ft. along N. slope.
- 78.14 The cor. of secs. 5, 6, 7 and 8.
- Land, mountainous.
Soil, clay.
No timber.
Undergrowth, shadscale.
- S. $88^{\circ}30'$ W., bet. secs. 6 and 7.
- Over mountainous land.
- Desc. 30 ft. over NW. slope.
- 3.40 Small draw, drains NE. about 10.00 chs., thence E.; asc. 120 ft. over SE. slope.
- 13.90 Spur, projects NE.; desc. 65 ft. over NW. slope.
- 21.50 Draw, drains NE.; asc. 140 ft. over broken SE. slope.
- 38.30 Spur, projects SE.; desc. 30 ft. over SW. slope.
- 38.90 Draw, drains SE.; asc. 40 ft. over NE. slope.
- 39.02 Point for the $\frac{1}{2}$ sec. cor. of secs. 6 and 7 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

43

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS	<p>T21S R7E</p> <p>$\frac{1}{4}$ $\frac{S6}{S7}$</p> <p>1962</p>
39.60	Spur, projects SE.; desc. abruptly 50 ft. over ledgy SW. slope.
40.90	Draw, drains S.; asc. abruptly 230 ft. over broken, precipitous E. slope.
46.30	Top of ascent; mesa, bears S. and NE., enter scattered pinon and juniper timber; desc. 20 ft. over NW. slope.
60.60	Draw, drains N.; asc. 30 ft. over NE. slope.
74.20	West edge of mesa, bears NW. and SE.; desc. 100 ft. over SW. slope, leave timber.
78.47	<p>The cor. of secs. 1, 6, 7 and 12 on the W. bdy. of the Tp., hereinbefore described.</p> <p>Land, mountainous. Soil, rocky clay. Timber, scattered pinon and juniper, west portion; none, east portion. Undergrowth, shadscale.</p>
	From the cor. of secs. 5, 6, 7 and 8.
	N. 1°51' E., bet. secs. 5 and 6.
	Over mountainous land.
	Desc. 30 ft. over N. slope.
2.35	Wash, 50 lks. wide, 10 ft. deep, drains irregularly E.
4.60	Wash, 100 lks. wide, 15 ft. deep, drains irregularly E.; asc. 140 ft. over steep SE. slope.
19.60	Top of ascent, bears W. and NE.; enter pinon and juniper timber; desc. 80 ft. over NW. slope.
40.50	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 5 and 6 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 12 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.</p>
	<p>T21S R7E</p> <p>$\frac{1}{4}$ $\frac{S6}{S5}$</p> <p>1962</p>
	Desc. 105 ft. over NW. slope.
60.50	Wash, 80 lks. wide, 8 ft. deep, in draw, drains SE.; asc. 100 ft. over steep SW. slope.
63.10	S. edge of mesa, bears irregularly E. and W.; asc. 40 ft. over gentle SW. slope.
77.25	Small wash, drains SE.

Dependent Resurvey of a Portion of the Sub-
division of Township 21 South, Range 7 East

CHAINS

81.12 The cor. of secs. 5, 6, 31 and 32 on the N. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the Fourth Standard Parallel South (south bdy. of T. 20 S., R. 7 E.).

Land, mountainous.

Soil, rocky clay.

Timber, scattered pinon and juniper.

Undergrowth, shadscale and rabbit brush.

General Description

The portion of Township 21 South, Range 7 East, covered in these field notes is nearly level desert land, with farm land in secs. 8; 9 and 16 to 33 inclusive. Secs. 5, 6, 7 and 8 are mountainous land with scattered juniper and pinon timber. No timber in remainder resurveyed. Shadscale, rabbit brush and greasewood undergrowth in desert area. There were no springs or water holes noted in the township.

Utah Highway No. 10 enters the township on the west bdy. of sec. 30 and bears NE. through the township, leaving on the N. bdy. of sec. 4. There are numerous unimproved roads throughout the township.

The town of Moore is located in sections 20 and 21.

The elevation is about 6,000 ft. above sea level. The drainage is generally east.

FIELD ASSISTANTS

GPO 834685

CERTIFICATE OF SURVEY

I, **Glen B. Hatch**, HEREBY CERTIFY upon honor that,
 in pursuance of special instructions bearing date of the 29th day of **June**, 1962,
 and supplemental special instructions dated February 15, 1963,
 I have dependently resurveyed a portion of the south boundary, a portion of
 the west boundary, and a portion of the subdivisional lines of Township 21
 South, Range 7 East,


of the **Salt Lake** Meridian, in the State of **Utah**, which
 are represented in the foregoing field notes as having been executed by me and under my direction;
 and that said survey has been made in strict conformity with said special instructions, the Manual
 of Instructions for the Survey of the Public Lands of the United States, and in specific manner
 described in the foregoing field notes.

(Date)

November 30, 1963

(Date)

(Cadastral Surveyor)

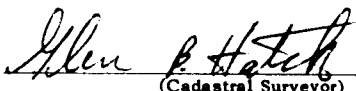

(Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date **DEC 9 1964**
 BUREAU OF LAND MANAGEMENT,
 Washington, D. C.


The foregoing field notes of the dependently resurveyed portions of the south boundary
 the west boundary and of the subdivisional lines of Township 21 South, Range
 7 East,

executed by **Glen B. Hatch, Cadastral Surveyor,**

having been critically examined and found correct, are hereby approved.

JUN 21 1965

(Date)

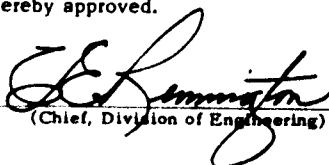

(Chief, Division of Engineering)

~~CERTIFICATE OF TRANSCRIPT~~

I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in
 , is a true copy of the original field notes.

(Date)

(Chief, Division of Engineering)

Blank

Page

Blank

Page

ORIGINAL

Form 4-679
(January 1963)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

185

FIELD NOTES

OF THE

DEPENDENT RESURVEY

OF THE

SOUTH BOUNDARY (FOURTH STANDARD PARALLEL SOUTH),

THE EAST BOUNDARY

THE NORTH BOUNDARY

AND

A PORTION OF THE SUBDIVISIONAL LINES

OF

TOWNSHIP 20 SOUTH, RANGE 7 EAST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

GLEN B. HATCH

CADASTRAL SURVEYOR

ALLEN L. TUFT

CADASTRAL SURVEYOR

Under special instructions dated JUNE 29, 19 62, which provided for the surveys
included under Group Number 458, approved JUNE 29, 1962,
and assignment instructions dated JUNE 29, 19 62.

Survey commenced JULY 26, 19 62

Survey completed SEPTEMBER 10, 19 62

DEPT. OF THE INTERIOR
BUREAU OF LAND MGMT

1965 JUL 19 AM 10 00 J

RECEIVED
STATE & LAND OFFICE
SALT LAKE CITY, UTAH

INDEX DIAGRAM

Township		20 South		Range		7 EAST		
21	20	19	17	16	15			
6	5	47 4	38 3	2	29 1	11		
		46			27			
7	53 8	45 9	10	11	12	13		
	52							
18	17	44 16	15	14	13	11		
	51				27			
19	20	42 21	22	33 23	25 24	10		
	51	42	37	32	25			
20	50 29	40 28	36 27	31 26	24 25	9		
49	49	40	35	31	23			
21	48 28	39 28	34 24	30 25	22 26	8		
7	6	5	4	3	2			

Lines surveyed by Glen B. Hatch _____

Lines surveyed by Allen L. Tuft _____

Dependent Resurvey of the South Bdy. (Fourth Standard Parallel South) T.20S., R7E.

CHAINS

The S. Bdy., (Fourth Standard Parallel South), the E. Bdy., the E. 4 miles of the N. Bdy., the S. 1 mile of the W. Bdy. and all the subdivision, except sec. 6 and portions of secs. 5, 7, 18, 19 and 30 were surveyed by A. D. Ferron in 1873.

The E. Bdy. was resurveyed by A. D. Ferron in 1882.

The W. 2 miles of the N. Bdy. was surveyed by C. Jarvis in 1909.

The W. Bdy. of sec. 7, and the remaining portion of sec. 7, was surveyed by A. D. Ferron in 1909.

The N. Bdy. of sec. 4 was resurveyed by J. Dougall in 1911.

The W. Bdys. of sec. 7 and 31 was resurveyed and the remaining portions of secs. 5, 18, 19, 30 and sec. 6 was surveyed by H. W. Miller and W. H. Good in 1921.

The following field notes are those of the dependent resurvey of the S. Bdy. (Fourth Standard Parallel South), the E. Bdy., the N. Bdy. and a portion of the subdivision of Township 20 South, Range 7 East.

Before restoring the cors., the lines of the original survey were retraced and a diligent search made for any evidence of the original cor. or other calls of the original field note record.

The rules of proportionate measurement were applied after exhausting every reasonable possibility of finding direct evidence of the lost corner.

The survey was executed with a W. & L. E. Gurley Solar Transit No. 570621 constructed in accordance with the standard instrumental specifications of the Bureau of Land Management. The instrument was in good condition prior to the beginning of the survey and was maintained in proper adjustment throughout the progress of this survey.

Corners on east-west lines were set on the true latitudinal curve. Lines connecting previously established corners were run by random and true method, but for simplification of the record the random lines are omitted from the field notes.

Measurements herein contained were made with a narrow steel tape, 8 chains in length, graduated every link for the first 100 links and thereafter at intervals of 10 links. The tape was tested by comparison with a one chain standard steel tape and found to be correct. Measurements were made on the slope with the vertical angle of each interval ascertained by a clinometer in good adjustment; horizontal equivalents alone are entered in the field notes. All lines of this survey were run by direct method where the lines were accessible; lines inaccessible were run by traverse or triangulation methods. Distances to topography on lines run by traverse or triangulation are approximately as scaled from U. S. G. S. topographic sheets. The details of such traverses or triangulations have been thoroughly checked and verified, and in order to simplify the record the diagrams and reductions are omitted from these field notes.

The direction of the lines of this survey were determined by reference to true meridians established on line by altitude observations on the sun. The lines were carried forward by sustained angulation being supplemented by other numerous altitude observations on the sun taken throughout the progress of the survey.

Dependent Resurvey of the South Bdy. (Fourth Standard Parallel South) T. 20 S.

CHAINS

The geographic position for the southeast corner of the township is at latitude $39^{\circ}01'46''$ N. and longitude $111^{\circ}04'25''$ W. as adjusted from traverses to U. S. G. S. triangulation station. "Ferron", at Lat. $39^{\circ}01'00.343''$ N. and Long. $110^{\circ}59'26.179''$ W., located S. $3^{\circ}20'44''$ W., 79.13 chs. dist. from the south $\frac{1}{4}$ sec. cor. of sec. 35, T. 20 S., R. 8 E. The magnetic declination was read at a number of stations throughout the township and the average of these readings was found to be $17^{\circ}30'$ East.

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South), Township 20 South, Range 7 East.

Reestablishment of the Survey Executed by A. D. Ferron in 1873 and the Retracement of Howard W. Miller in 1921.

Beginning at the cor. of Townships 20 and 21 South, Ranges 7 and 8 East, monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record.

S. $88^{\circ}52'$ W., bet. secs. 1 and 36.

Over nearly level desert land.

18.50 Road, unimproved, bears north and south.

23.60 Wash, 50 lks. wide, 20 ft. deep, drains north.

37.00 Wash, 50 lks. wide, 20 ft. deep, drains north.

40.45 Point for the standard $\frac{1}{4}$ sec. cor. of sec. 1 and 36 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

SC

T20S R7E

$\frac{1}{4}$ S36

S1

T21S

1962

deposit glass around iron post, 4 ins. below ground.

41.75 Wash, 40 lks. wide, 5 ft. deep, drains north.

56.10 Wash, 30 lks. wide, 15 ft. deep, drains north.

80.40 Point selected for the witness standard cor. of secs. 1, 2, 35 and 36.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

SC

T20S R7E

S35 | S36

S2 | S1

WC

T21S

1962

Resurvey of the South Boundary (Fourth Standard Parallel South), T.20 S., R.7 E.

CHAINS

deposit glass around iron post, 6 ins. below ground and raise a mound of stone, 2 ft. base, 1½ ft. high, north of cor.

80.90 True point for the standard cor. of secs. 1, 2, 35 and 36 at proportionate dist., falls in wash, 30 lks. wide, 4 ft. deep, drains NW. and is deemed unsafe; there is no remaining evidence of the original cor. for monumentation.

Land, nearly level desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

S.88°52'W., bet. secs. 2 and 35.

Over nearly level desert land.

40.05 Wash, 80 lks. wide, 25 ft. deep, drains north.

40.45 Point for the standard ¼ sec. cor. of secs. 2 and 35 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

SC

T20S R7E

1/4 S35

S2

T21S

1962

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 2 ft. base, 1½ ft. high, north of cor.

Asc. 80 ft. over east slope of clay knoll.

49.60 Top of knoll, desc. 35 ft. over west slope.

54.10 Wash, 50 lks. wide, 35 ft. deep, drains north.

60.45 Wash, 50 lks. wide, 30 ft. deep, drains NE., asc. 80 ft. over NE. slope.

80.90 Point for the standard cor. of secs. 2,3,34 and 35 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

SC

T20S R7E

S34 | S35

S3 #2

T21S

1962

Dependent Resurvey of the South Boundary (Fourth Standard Parallel South), T.20 S

CHAINS

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 2 ft. base, $1\frac{1}{2}$ ft. high, north of cor.

Land, nearly level desert.

Soil, sandy clay.

No timber.

Undergrowth, shadscale.

S.88°52'W., bet. secs. 3 and 34.

Over nearly level desert land.

13.50 Road, unimproved, bears N.70°W. and S.70°E.

20.90 Wash, 20 lks. wide, 10 ft. deep, drains S.80°E.

40.45 Point for the standard $\frac{1}{4}$ sec. cor. of secs. 3 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

SC

T20S R7E

$\frac{1}{4}$ S34

S3

T21S

1962

deposit glass around iron post, 4 ins. below ground.

43.11 Fence, bears north and south.

55.70 Wash, 40 lks. wide, 10 ft. deep, drains irregularly east.

80.34 Power line, bears north and south.

80.90 Point for the standard cor. of secs., 3, 4, 33 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

SC

T20S R7E

S33 | S34

S4 | S3

T21S

1962

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 3 ft. base, 2 ft. high, north of cor.

Land, nearly level desert.

Soil, sandy clay.

No timber.

Undergrowth, shadscale.

Resurvey of the South Boundary (Fourth Standard Parallel So.), T.20 S., R. 7 E.

CHAINS

S. 88°52' W., bet. secs. 4 and 33.

Over gently rolling desert land.

1.62 Telephone line, bears north and south.

2.17 Center line of State Highway No. 10, bears about N. 18° 30' E. and S. 18°30' W.; asc. 25 ft. over east slope.

3.00 Point of small clay spur, slopes south, thence asc. 50 ft. along rolling south slope.

40.45 Point for the standard $\frac{1}{4}$ sec. cor of secs. 4 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

SC
T20S R7E

$\frac{1}{4}$ S33

S4
T21S
1962

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 2 ft. base, 1½ ft. high, north of cor.

Asc. 110 ft. over SE. slope.

57.20 Top of ascent, slopes south, desc. 110 ft. over rocky SW. slope.

80.90 Point for the standard cor. of secs. 4, 5, 32 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

SC
T20S R7E

S32 | S33

S5 | S4
T21S
1962

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 3 ft. base, 2 ft. high, north of cor.

Land, gently rolling east portion; mountainous west portion.

Soil, clay east portion; rocky, sandy clay west portion. Timber, none.

Undergrowth, shadscale and scattered sagebrush.

Dependent Resurvey of the So. Boundary (Fourth Standard Parallel South), T. 20 S.

CHAINS

S. 88°52' W., bet. secs. 5 and 32.

Over rolling desert land.

Desc. 15 ft. over gentle SW. slope.

2.14 Fence, bears north and south 0.55 chs., thence west.

21.40 Wash, 20 lks. wide, 8 ft. deep, drains SE., asc. 40 ft. over NE. slope.

22.82 Telephone line, bears north and south.

33.50 Small clay spur, slopes SE., desc. 10 ft. over SW. slope.

38.60 Wash, 20 lks. wide, 8 ft. deep, drains SE., asc. 5 ft. over NE. slope.

40.45 Point for the standard $\frac{1}{4}$ sec. cor. of secs. 5 and 32 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, with brass cap mkd.

SC
T20S R7E

$\frac{1}{4}$ S32

S5
T21S
1962

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 5 ft. base, $1\frac{1}{2}$ ft. high, north of cor.

From this cor., a fence bearing east and west, bears south, 0.38 chs. dist.

41.50 Wash, 20 lks. wide, 10 ft. deep, drains SE., asc. 165 ft. over NE. slope. Enter scattered timber.

59.70 Spur, slopes SE.; desc. 50 ft. over SW. slope.

67.35 Bottom of canyon, drains SE.; asc. 100 ft. over NE. slope.

78.70 Ridge, bears NW. and SE., thence across top of ridge. Fence bears north, and south 0.72 chs.; thence east.

80.90 Point for the standard cor. of secs. 5, 6, 31 and 32 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

SC
T20S R7E

S31 | S32

S6 | S5
T21S
1962

from which

Next Resurvey of the So. Boundary (Fourth Standard Parallel South), T. 20 S., R. 7 E.

CHAINS

A juniper, 4 ins. diam., bears S.64°45'E., 55 lks. dist., mkd. S 5 BT.

A pinon pine, 10 ins. diam., bears S.60°W., 16 lks. dist., mkd. T21S R7E S6 BT.

A pinon pine, 4 ins. diam., bears N.89°W., 27 lks. dist., mkd. S31 BT.

Land, rolling desert east portion; mountainous west portion.

Soil, rocky, sandy clay.

Timber, scattered to medium pinion and juniper, west portion.

Undergrowth, shadscale and sagebrush east portion.

S.88°52'W., bet. secs. 6 and 31.

Over mountainous land through medium dense timber.

Asc. 20 ft. over gentle SE. slope.

10.70 Desc. 95 ft. over steep SW. slope.

15.45 Bottom of canyon, drains SE.; asc. 50 ft. over NE. slope.

20.85 Spur, slopes SE. from west; asc. 70 ft. along spur.

40.45 True point for the standard $\frac{1}{4}$ sec. cor. of secs. 6 and 31 at proportionate dist. falls in wash, drains north, and is not monumented.

Asc. 15 ft. over east slope.

40.64 Point selected for the witness standard $\frac{1}{4}$ sec. cor. of secs. 6 and 31.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

SC
T20S R7E

$\frac{1}{4}$ S31 W
C

S6
T21S
1962

From which

A pinon pine, 7 ins. diam., bears N.27°15'W., 78 lks. dist., mkd. ~~4-87~~.

Asc. 120 ft. over NE. slope.

66.15 Ridge, bears irregularly east and west, desc. 60 ft. over SW. slope.

76.00 Bottom of canyon, drains SE., asc. 120 ft. over NE. slope.

80.90 The standard cor. of Tps. 20 and 21 S., Rs. 6 and 7 E., monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record of the 1921 survey.

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South) T. 20

CHAINS

Land, mountainous.
Soil, rocky clay.
Timber, medium growth of juniper and pinion.
Undergrowth, shadscale and sagebrush.

Dependent Resurvey of the East Boundary of Township
20 South, Range 7 East

Reestablishment of the Survey Executed by A. D. Ferron
in 1882.

From the cor. of Tps. 20 and 21 S., RS. 7 and 8 E.,
hereinbefore described.

N.0°27'W., bet. secs. 31 and 36.

Over gently rolling desert land.

Desc. 10 ft. over gentle N. slope.

11.45 Wash, 10 lks. wide, 2 ft. deep, drains N. 75° E., asc.
10 ft. over SE. slope.

21.00 Road, unimproved, bears N. 80° E. and S. 80° W., desc.
35 ft. over gentle north slope.

40.67 Point for the $\frac{1}{4}$ sec. cor. of secs. 31 and 36 at propor-
tionate dist.; there is no remaining evidence of the
original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in
the ground, and in a collar of stone to top, with brass
cap mkd.

T20S
R7E R8E
 $\frac{1}{4}$
S36|S31
1962

deposit glass around iron post, 4 ins. below ground.

Desc. 35 ft. over gentle north slope.

51.60 Wash, 20 lks. wide, 4 ft. deep, drains N.20°E.

53.30 Wash, 20 lks. wide, 15 ft. deep, drains east.

54.35 Wash, 20 lks. wide, 4 ft. deep, drains east.

56.10 Wash, 10 lks. wide, 4 ft. deep, drains east.

81.34 The cor. of secs. 25, 30, 31 and 36, monumented with a
sandstone, 7x9x11 ins., set, mkd. and witnessed as des-
cribed in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, and in a mound of stone, 3 ft. base to top,
with brass cap mkd.

T20S
R7E R8E

S25|S30
S36|S31
1962

East Boundary of the East Boundary of Township 20 South, Range 7 East

CHAINS

bury original stone cor. alongside iron post, and deposit glass around iron post, 4 ins. below ground.

Land, gently rolling desert.

Soil, clay,

No timber.

Undergrowth, shadscale.

N.0°30'W., bet. secs. 25 and 30.

Over gently rolling desert land.

Desc. 10 ft. over gentle NW. slope

3.90 Wash, drains NE.; asc. 20 ft. over SE. slope.

14.50 Road, unimproved, bears N.30°E. and S.50°W.

17.30 Low clay spur, slopes NE.; desc. 50 ft. over north slope.

27.25 Road, unimproved, bears N.40°W. and S.40°E.

37.40 Wash, 5 lks. wide, 2 ft. deep, drains west; asc. 10 ft. over south slope.

37.80 Low clay spur, slopes west; desc. 30 ft. over north slope

40.44 Point for the $\frac{1}{4}$ sec. cor. of secs. 25 and 30 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S
R7E R8E
 $\frac{1}{4}$
S25 | S30

1962

deposit glass around iron post, 4 ins. below ground.

41.35 Wash, 5 lks. wide, 1 ft. deep, drains west, desc. 40 ft. along gently rolling west slope.

49.20 Wash, 6 lks. wide, 2 ft. deep, drains west.

57.70 Wash, 10 lks. wide, 3 ft. deep, drains west.

72.10 Road, unimproved, bears N.85°W. and S.85°E.

77.75 Wash, 10 lks. wide, 2 ft. deep, drains west.

80.88 Point for the cor. of secs. 19, 24, 25 and 30, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S
R7E R8E
S24 | S19
S25 | S30
1962

Dependent Resurvey of the East Boundary of Township 20 South, Range 7

CHAINS

deposit glass around iron post, 4 ins. below ground.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

N.0°30'W., bet. secs. 19 and 24.

Over nearly level desert land.

- 6.50 Wash, 5 lks. wide, 2 ft. deep, drains west.
- 11.40 Wash, 5 lks. wide, 2 ft. deep, drains west.
- 13.10 Road, unimproved, bears S.40°E., from S.60°W.
- 16.55 Wash, 5 lks. wide, 2 ft. deep, drains west.
- 19.25 Wash, 5 lks. wide, 2 ft. deep, drains west.
- 23.75 Wash, 5 lks. wide, 2 ft. deep, drains N.80°W.
- 27.65 Wash, 5 lks. wide, 2 ft. deep, drains west.
- 40.44 Point for the $\frac{1}{4}$ sec. cor. of secs. 19 and 24, at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T20S
R7E R8E
 $\frac{1}{4}$
S24|S19
1962
- deposit glass, around iron post, 4 ins. below ground.
- 55.50 Road, unimproved, bears N.80°E. and S.60°W.
- 61.55 Irrigation canal, 6 lks. wide, 2 ft. deep, flows N.50°E.
- 66.50 Gravel road, bears east and west, thence along east side of gravel road, bears north.
- 72.45 Road, unimproved, bears N.30°E. and S.10°W.
- 73.55 Irrigation ditch, 5 lks. wide, 2 ft. deep, flows east.
- 73.85 Road, unimproved, bears N.80°W. and S. 60°E.
- 74.75 Fence, bears north and SE.
- 78.68 Point selected for the witness cor. of secs. 13, 18, 19 and 24.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of the East Boundary of Township 20 S., R. 7 E.

CHAINS

T20S
R7E R8E
W C
S13↑S18
S24|S19
1962

79.45 Ferron Creek, with stream of water, 15 lks. wide, 1 ft. deep, flows irregularly E.

80.88 True point for the cor. of secs. 13, 18, 19 and 24, at proportionate dist. falls in creek bed and is not monumented.

Land, nearly level desert.
Soil, clay.
No timber.
Undergrowth, shadscale.

N. 0°30' W., bet. secs. 13 and 18.

Over level farm land and along gravel road.

1.50 Leave creek bed.

14.40 Cattle guard, falls 20 lks. E. of 1 inch iron post, with brass cap mkd.

4C310
E FERRON GUARD

SE SE S13
T20S R7E
1953

39.00 House, bears W., about 2.00 chs. dist.

40.20 House, bears E., about 2.50 chs. dist.

40.44 Point for the $\frac{1}{2}$ sec. cor. of secs. 13 and 18 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. below surface of gravel road, with brass cap mkd.

T20S
R7E R8E
 $\frac{1}{2}$
S13|S18
1962

from which

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24 ins. in the ground, for a reference monument, bears N.60°45'W., 38 ft. dist., with brass cap mkd. T20S R7E S13 RM 38' 1962, and an arrow pointing to the true corner.

Dependent Resurvey of the East Boundary of T. 20 S., R. 7 E.

CHAINS

deposit glass around iron post, 4 ins. below ground.

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24 ins. in the ground, for a reference monument, bears N. $45^{\circ}45'$ E., 25.7 ft. dist., with brass cap mkd. T20S R8E S18 RM 25.7' 1962, and an arrow pointing to the true corner.

deposit glass around iron post, 4 ins. below ground.

45.70 Corral and water tank, bears E., about 2.00 chs. dist.

46.95 Gravel road, curves NW.; asc. 50 ft. over south slope of knoll.

50.50 Top of ascent; desc. 30 ft. over gentle N. slope.

59.95 Gravel road, bears N. from SW., thence along road.

61.90 Oiled road, thence along road.

80.88 The cor. of secs. 7, 12, 13 and 18, at intersection of oiled road from S., and oiled road from E. and W.; according to local residents, this is the true cor. point, and is accepted as such.

At the cor. point

Drive a nail flush with oiled road.

from which

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 20 ins. in the ground, for a reference point, bears S. $45^{\circ}57'$ E., 44.5 ft. dist., with brass cap mkd. T20S R8E S18 RM 44.5 ' 1962, and an arrow pointing to the true cor.

deposit glass around iron post, 4 ins. below ground.

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 20 ins. in the ground for a reference monument, bears S. $48^{\circ}25'$ W., 48.2 ft. dist., with brass cap mkd. T20S R7E S13 RM 48.2' 1962, and an arrow pointing to the true cor.

deposit glass around iron post, 4 ins. below ground.

Land, level farm land.

Soil, loamy clay.

No timber.

Dependent Resurvey of the East Boundary of T. 20 S., R. 7 E.

CHAINS

N.0°41'W., bet. secs. 7 and 12.

Over level farm land and along gravel road, from Molen to Clawson.

10.70 House, bears east, about 2.00 chs. dist.

14.85 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains east.

32.00 Leave gravel road, curves NW. to NE.; asc. 25 ft. over south slope of knoll.

40.42 Point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 12 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S
R7E R8E
 $\frac{1}{4}$
S12 S7

1962

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, west of cor.

Cor. is located in small swell along east side of road.

40.45 Wash, 3 lks. wide, 1 ft. deep, drains S.50°W., asc. 60 ft. over south slope.

43.80 Top of ascent, bears NW. and SE., desc. 20 ft. over gently rolling NE. slope.

49.25 Gravel road, bears north from SW.

52.40 Leave road, turns N.55°W.

52.55 Fence, bears N.55°W. and S.55°E.

54.65 Road, unimproved, bears N.60°W. and S.60°E.

54.80 Irrigation ditch, 3 lks. wide, 2 ft. deep, drains S.60°E.

66.55 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains S.80°E.

66.90 Fence, bears N.80°W. and S.80°E.

67.95 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains irregularly south.

69.60 Fence, bears N.85°E. and S.85°W.

72.30 Small draw, drains SE.; asc. 20 ft. over SW slope.

75.30 Small spur, slopes SE.; desc. 15 ft. over NE. slope.

78.40 Small draw, drains SE.; asc. 15 ft. over SW. slope.

80.84 The cor. of secs. 1, 6, 7 and 12, monumented with a sand stone, 4x12x17 ins., set, mkd. and witnessed as described in the official record.

Dependent Resurvey of the East Boundary of T. 20 S., R. 7 E.

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S
R7E R8E

S1 | S6

S12 | S7
1962

bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, west of cor.

Land, level farm land south portion; gently rolling desert north portion,

Soil, loamy clay.

No timber.

Undergrowth, shadscale in desert portion.

N.0°30'W., bet. secs. 1 and 6.

Over rolling desert land.

Desc. 10 ft. over NE. slope.

8.10 Wash, in small draw, drains N.80°E., asc. 130 ft. over south slope.

27.90 Road, unimproved, bears east and west.

30.90 Top of small knoll, desc. 15 ft. over NW. slope.

33.90 Wash, in small draw, drains SW.; asc. 15 ft. over SE. slope.

38.00 Spur, slopes NE.; desc. 5 ft. over NW. slope.

40.13 Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 6 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S
R7E R8E

$\frac{1}{4}$
S1 | S6

1962

Desc. 165 ft. over north slope.

63.65 Wash, 20 lks. wide; 6 ft. deep, drains irregularly north.

66.00 Same wash, drains irregularly north.

67.20 Same wash, drains east.

70.00 Small spur, slopes NE.; desc. 10 ft. over NW. slope.

74.85 Wash, 30 lks. wide, 8 ft. deep, drains NE.; asc. 15 ft. over SE. slope.

Dependent Resurvey of the East Boundary of T. 20 S., R. 7 E.

CHAINS

- 76.30 Small spur, slopes NE., desc. 15 ft. over NW. slope.
- 77.65 Wash, 40 lks. wide, 10 ft. deep, drains east; asc. 20 ft. over south slope.
- 80.26 The cor. of Tps. 19 and 20 S., RS. 7 and 8 E., monumented with a limestone, 6x10x14 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S
R7E R8E

S36 | S31

S1 | S6

T20S
1962

bury original stone cor. alongside iron post.

Land, rolling desert.
Soil, clay.
No timber.
Undergrowth, shadscale.

Dependent Resurvey of the North Boundary of Township 20 South, Range 7 East

Reestablishment of the Survey Executed by A. D. Ferron in 1873.

S.89°26'W., bet. secs. 1 and 36.

Over rolling desert land.

Desc. 15 ft. over SW. slope.

- 1.58 Power line, bears north and south.
- 3.80 Wash, 30 lks. wide, 10 ft. deep, drains SE.; asc. 55 ft. over NE. slope.
- 14.90 Spur, slopes NE.; desc. 15 ft. over NW. slope.
- 17.10 Wash, 15 lks. wide, 3 ft. deep, drains north; asc. 50 ft. along rolling north slope.
- 17.90 Wash, 80 lks. wide, 20 ft. deep, drains north.
- 21.80 Wash, 10 lks. wide, 4 ft. deep, drains north.
- 35.60 Wash, 4 lks. wide, 1 ft. deep, drains north.
- 36.65 Top of ascent, slopes north; desc. 10 ft. over NW. slope.
- 40.57 The ¼ sec. cor. of secs. 1 and 36, monumented with a limestone, 4x4x8 ins., set, mkd. and witnessed as described in the official record.

Dependent Resurvey of the North Boundary of Township 20 S., R. 7

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R7E

S36

S1

T20S

1962

bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, north of cor.

N.89°47'W., beginning new measurement.

- 0.75 Wash, 5 lks. wide, 2 ft. deep, drains NE.; asc. 150 ft. over SE. slope.
- 20.85 Ridge, bears north and south; desc. 75 ft. over NW. slope.
- 33.50 Draw, drains NE.; asc. 45 ft. over SE. slope.
- 40.40 Point for the cor. of secs. 1, 2, 35 and 36, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R7E

S35 | S36

S2 | S1

T20S

1962

cor. is located on point of spur, slopes NE.

Land, rolling desert.

Soil, clay.

Undergrowth, shadscale.

No timber.

N.89°47'W., bet. secs. 2 and 35.

Over rolling desert land.

Desc. 85 ft. over west slope.

- 11.00 Enter wash, 20 lks. wide, 5 ft. deep, drains irregularly west; desc. 25 ft. over gentle west slope.
- 16.80 Leave wash, drains SW.
- 27.00 Enter sagebrush, bears irregularly north and south.
- 32.30 Road, unimproved, bears N.15°W. and S.40°E.
- 32.61 Fence, bears N.15°W. and S.40°E.

Dependent Resurvey of the North Boundary of Township 20 S., R. 7 E.

CHAINS

33.55 Irrigation ditch, 10 lks. wide, 2 ft. deep, drains south.

34.75 Pole corral.

37.10 North cor. of log shed.

39.50 Irrigation ditch, 3 lks. wide, 1 ft. deep, drains south.

40.40 Point for the $\frac{1}{4}$ sec. cor. of secs. 2 and 35, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R7E

 $\frac{1}{4}$ S35

S2

T20S

1962

raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, north of cor.

43.48 Fence, bears north and south.

55.10 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains S.60°E.

61.67 Fence, bears north and south.

77.17 Road, unimproved, bears NW. and SE.

78.30 Irrigation canal, 30 lks. wide, 6 ft. deep, with stream of water, 3 lks. wide, 1 ft. deep, flows S.70°E.

80.80 Point for the cor. of secs. 2,3,34 and 35, at measurement in latitude, and local control longitudinally mkd. by an old property fence, bearing N. and S; this fence is accepted as marking the N. and S. sec. line. There is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a mound of stone, 3 ft. base, to top, with brass cap mkd.

T19S R7E

S34 | S35

S3 | S2

T20S

1962

deposit glass around iron post, 4 ins. below ground.

Land, gently rolling desert east portion; nearly level west portion.

Soil, sandy blue clay.

No timber.

Undergrowth, shadscale and sagebrush.

N. 89°47' W., bet. secs. 3 and 34.

Dependent Resurvey of the North Boundary of Township 20 S., R. 7

CHAINS

- Over nearly level desert land.
- Asc. 25 ft. over east slope of small knoll.
- 3.90 Top of knoll; desc. 25 ft. over west slope.
- 7.00 Base of knoll, thence over nearly level desert land.
- 14.65 Wash, 20 lks. wide, 6 ft. deep, drains S .80°E.
- 16.75 Wash, 80 lks. wide, 20 ft. deep, drains irregularly east.
- 22.80 Wash, 80 lks. wide, 25 ft. deep, drains irregularly east.
- 25.40 Enter farm land.
- 27.87 Power line, bears north and south.
- 30.95 Irrigation ditch, 5 lks. wide, 1 ft. deep, drains NE.
- 31.10 Fence, bears N.40°E. and S.40°W.
- 32.87 Center line of State Highway No. 10, bears N.40°E. and S.40°W.
- 34.57 Fence, bears N.40°E. and S.40°W.
- 37.05 Irrigation ditch, 20 lks. wide, 5 ft. deep, drains south.
- 40.45 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 34, at proportionate measurement in latitude, and local control longitudinally, mkd. by an old property fence bearing, N. and S; this fence is accepted as marking the N. and S. center line of secs. 3 and 34.
- Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 22 ins. in the ground, with brass cap mkd.
- T19S R7E
- $\frac{1}{4}$ S34
- S3
- T20S
1962
- deposit glass around iron post, 4 ins. below ground.
- 60.75 Fence, bears north and south.
- 61.15 Irrigation ditch, 8 lks. wide, 2 ft. deep, drains NE.
- 61.85 Irrigation, canal, 30 lks. wide, 4 ft. deep, flows N.30°E.
- 65.45 Fence, bears N.60°W. and S.40°E.
- 65.95 Road, unimproved, bears N.60°W. and S.40°E.
- 73.05 Telephone line, bears N.60°W. and S.40°E.
- 81.80 The cor. of secs. 3, 4, 33 and 34, monumented with a sandstone, 8x10x12 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point

Dependent Resurvey of the North Boundary of Township 20 S., R. 7 E.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R7E

S33 | S34

S4 | S3

T20S

1962

bury original stone cor. alongside iron post.

Land, nearly level farm land.

Soil, loamy clay.

Timber, none.

Reestablishment of the Resurvey Executed by J. Dougall in 1911

N. $89^{\circ}49'$ W., bet. secs. 4 and 33.

Over nearly level desert land.

40.075

Point for the S. $\frac{1}{4}$ sec. cor. of sec. 33, T. 19 S., R. 7 E., at mid point bet. the cor. of secs. 3, 4, 33 and 34, and the closing cor. of secs. 32 and 33.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone, with brass cap mkd.

T19S R20E

$\frac{1}{4}$ S33

T20S

1962

40.98

Point for the N. $\frac{1}{4}$ sec. cor. of sec. 4, at mid point bet. the cors. of 3, 4, 33 and 34 and cor. of 4 and 5; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R7E

$\frac{1}{4}$ S4

T20S

1962

raise a mound of stone, 3 ft. base, 2 ft. high, north of cor.

Asc. 150 ft. over east slope of spur.

62.00

Top of ledge, 50 ft. high, on spur, slopes south, about 4.00 chs. to end, desc. 65 ft. over SW. slope; enter scattered timber.

78.10

Wash, drains south; asc. 20 ft. over SE. slope.

80.15

The closing cor. of secs. 32 and 33, T. 19 S., R. 7 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1911 survey.

81.96

The cor. of secs. 4 and 5, T. 20 S., R. 7 E., monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record.

Land, nearly level desert east portion; mountainous west portion.

Soil, clay east portion; rocky, gravelly clay west portion.

Timber, scattered pinon and juniper, west portion; none east portion.

Undergrowth, shadscale.

Dependent Resurvey of the North Boundary, Township 20 S., R. 7 E.

CHAINS	Reestablishment of the Survey Executed by C. Jarvis in 1909 with establishment of S. $\frac{1}{4}$ sec. cors. for secs. 31 and 32, T. 19 S., R. 7 E.
	<p>N. 89°57' W., along the north boundary of sec. 5.</p> <p>Over mountainous land, through medium pinon and juniper timber.</p> <p>Asc. 70 ft. over NE. slope.</p>
7.20	East edge of bench, bears north and south; asc. 20 ft. over gentle east slope.
17.40	Top of ascent, bears north and south; desc. 30 ft. over gentle west slope.
38.13	<p>Point for the south $\frac{1}{4}$ sec. cor. of sec. 32, T. 19 S., R. 7 E., at mid point bet. the closing cor. of secs. 32 and 33 and the closing cor. of secs. 31 and 32.</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T19S R7E <u>$\frac{1}{4}$ S32</u> 1962</p> <p>Desc. 30 ft. over west slope.</p>
39.00	Draw, drains south; asc. 25 ft. over east slope.
40.01	<p>The $\frac{1}{4}$ sec. cor. of secs. 5 and 32, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record. This cor. will now function as the north $\frac{1}{4}$ sec. cor. of sec. 5, T. 20 S., R. 7 E., only, I remark</p> <p style="text-align: center;"><u>$\frac{1}{4}$ S5</u> 62 1910</p> <p>from which</p> <p>The original bearing tree, a cedar, 12 ins. diam., bears S. 19° E., 15 lks. dist., mkd. $\frac{1}{4}$ S 5 B T.</p> <p>I destroy the marks on the original bearing tree pertaining to sec. 32.</p>
	<p>West, beginning new measurement.</p> <p>Asc. 10 ft. over gentle east slope.</p>
3.00	Top of ascent, thence over nearly level bench land.
11.90	Wash, 30 lks. wide, 10 ft. deep, drains irregularly south.
38.06	The closing cor. of secs. 31 and 32, T. 19 S., R. 7 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record.

Dependent Resurvey, of the North Boundary of Township 20 S., R. 7 E.

CHAINS

39.91 The cor. of secs. 5 and 6, T. 20 S., R. 7 E., monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record.

Land, mountainous

Soil, rocky clay.

Timber, medium juniper and pinion.

Undergrowth, shadscale and scattered sagebrush.

N.89°58'W., along the north boundary of sec. 6.

Over gently rolling bench land.

Asc. 110 ft. over SE. slope.

4.50 Wash, 30 lks. wide, 6 ft. deep, drains S.30°E.

22.30 Clay ridge, bears north and south; desc. 10 ft. over gentle west slope.

35.90 Top of shale ledge, desc. abruptly 30 ft. over west slope.

36.00 Draw, drains irregularly south; asc. 20 ft. over abrupt NE. slope.

38.09 Point for the south $\frac{1}{4}$ sec. cor. of sec. 31 T. 19 S., R. 7 E., at proportionate dist. bet. the closing cor. of secs. 31 and 32, and the cor. of Tps. 19 and 20 S., Rs. 6 and 7 E.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone, $4\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R7E

$\frac{1}{4}$ S31

1962

Asc. 10 ft. over NE. slope.

39.97 The $\frac{1}{4}$ sec. cor. of secs. 6 and 31, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record. This cor. will now function as the north $\frac{1}{4}$ sec. cor. of sec. 6, T. 20 S., R. 7 E. only, and was remarked.

$\frac{1}{4}$ S 6

62

1910

from which

The original bearing tree, a cedar, 10 ins. diam., bears S.46°E., 3 lks. dist., mkd. $\frac{1}{4}$ S 6 BT.

I destroy all marks on the original bearing tree pertaining to sec. 31.

N.89°53'W., beginning new measurement.

Over rolling bench land, through medium timber.

Dependent Resurvey of the North Boundary of Township 20 South, R. 7 E.

CHAINS

- Asc. 40 ft. over rolling south slope.
- 14.30 Spur, slopes south; desc. 50 ft. over west slope.
- 16.30 Draw, drains south; asc. 20 ft. over SE. slope.
- 19.20 Spur, slopes south; desc. 35 ft. over west slope.
- 30.35 Draw, drains irregularly south; asc. 20 ft. over east slope.
- 34.00 Spur, slopes south, desc. 35 ft. over west slope.
- 38.60 Draw, drains SE.; asc. 20 ft. over NE. slope.
- 39.80 The cor. of Tps., 19 and 20 S., RS. 6 and 7 E., monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record.

Land, mountainous.
Soil, rocky clay.
Timber, medium dense pinion and juniper.
Undergrowth, shadscale.

Dependent Resurvey of a Portion of the Subdivision of
T. 20 S., R. 7 E.

Reestablishment of the Survey Executed by A. D. Ferron
in 1873.

From the true point for the standard cor. of secs. 1, 2,
35 and 36, on the south boundary of the Tp., hereinbe-
fore described.

N.0°36'W., bet. secs. 35 and 36.

Over rolling desert land.

- 8.80 Wash, 15 lks. wide, 5 ft. deep, drains east.
- 38.20 Wash, 10 lks. wide, 3 ft. deep, drains east.
- 40.78 Point for the $\frac{1}{4}$ sec. cor. of secs. 35 and 36, at pro-
portionate dist.; there is no remaining evidence of the
original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4}$

S35 S36

1962.

deposit glass around iron post, 4 ins. below ground, and
raise a mound of stone, 3 ft. base, 2 ft. high, west of
cor.

- 64.40 Wash, 10 lks. wide, 4 ft. deep, drains east.
- 73.55 Wash, 10 lks. wide, 5 ft. deep, drains east.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

78.15 Wash, 5 lks. wide, 6 ft. deep, drains east.

81.56 Point for the cor. of secs. 25, 26, 35 and 36, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{S26}{S35} | \frac{S25}{S36}$

1962

deposit glass around iron post, 3 ins. below ground.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 25, 30, 31 and 36, on the east boundary of the Tp., hereinbefore described.

S.89°00'W., bet secs. 25 and 36.

Over rolling desert land.

Asc. 15 ft. over gentle east slope.

25.20 Top of ascent, bears north and south; desc. 45 ft. over west slope.

31.20 Wash, 30 lks. wide, 6 ft. deep, drains NW.; asc. 35 ft. over NE. slope.

38.80 Spur, slopes north; desc. 30 ft. over west slope.

40.55 Point for the $\frac{1}{4}$ sec. cor. of secs. 25 and 36, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4} \frac{S25}{S36}$

S36
1962

deposit glass around iron post, 3 ins. below ground.

42.30 Draw, drains north; asc. 45 ft. over east slope.

51.60 Spur, slopes NW.; desc. 45 ft. over NW. slope.

59.60 Draw, drains NW.; asc. 15 ft. over NE. slope.

62.00 Spur, slopes NW.; desc. 30 ft. over west slope.

72.85 Wash, 60 lks. wide, 10 ft. deep, drains north; asc. 15 ft. over east slope.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

74.80	Small spur, slopes north; desc. 10 ft. over west slope.
76.85	Wash, 40 lks. wide, 8 ft. deep, drains north; asc. 20 ft. over NE. slope.
81.10	The cor. of secs. 25, 26, 35 and 36. Land, rolling desert. Soil, blue clay. No timber. Undergrowth, shadscale.
	N. 0°56'W., bet. secs. 25 and 26. Over rolling desert land. Desc. 15 ft. over NE slope.
0.60	Wash, 10 lks. wide, 3 ft. deep, drains east; asc. 15 ft. over SE. slope.
3.60	Spur, slopes NE.; desc. 25 ft. over NW. slope.
4.50	Wash, drains NE.; asc. 20 ft. over SE. slope.
11.00	Spur, slopes NE.; desc. 15 ft. over NW. slope.
13.70	Wash, 5 lks. wide, 2 ft. deep, drains NE.; asc. 15 ft. over SE. slope.
16.20	Smallspur, slopes NE.; desc. 10 ft. over NW. slope.
17.40	Wash, drains NE.; asc. 35 ft. over SE. slope.
20.15	Spur, slopes east; desc. 40 ft. over north slope.
32.90	Wash, 10 lks. wide, 3 ft. deep, drains east; asc. 25 ft. over SE. slope.
36.80	Spur, slopes NE.; desc. 15 ft. over north slope.
40.78	Point for the $\frac{1}{2}$ sec. cor. of secs. 25 and 36, at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T20S R7E $\frac{1}{2}$ S26 S25 1962 Thence over gently rolling land.
57.20	Wash, 20 lks. wide, 3 ft. deep, drains N.60°W.
70.99	Fence, bears north and S.76°W., thence along fence line.
81.56	Point for the cor. of secs. 23, 24, 25 and 26, at intersection of fences from the north, north and east; and is accepted as the best evidence of the position of the original cor. At the cor. point

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins., diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R7E

$$\frac{S23 | S24}{S26 | S25}$$

1962

deposit glass around iron post, 3 ins. below ground.

Land, rolling desert.

Soil, blue clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 19, 24, 25 and 30, on the east boundary of the Tp., hereinbefore described.

S.89°31'W., bet. secs. 24 and 25.

Over gently rolling desert land.

Desc. 30 ft. over west slope.

6.15 Wash, 5 lks. wide, 2 ft. deep, drains N.70°W., thence over nearly level land.

21.10 Fence, bears north and south.

40.85 Point for the $\frac{1}{4}$ sec. cor. of secs. 24 and 25, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R7E

$$\frac{1}{4} \frac{S24}{S25}$$

1962

56.70 Irrigation ditch, 8 lks. wide, 2 ft. deep, drains N.70°E.

59.20 Same ditch, drains SE.

81.70 The cor. of secs. 23, 24, 25 and 26.

Land, nearly level desert.

Soil, blue clay.

No timber.

Undergrowth, shadscale.

N.0°12'W., bet. secs. 23 and 24.

Over nearly level desert land.

Asc. 30 ft. over gentle south slope.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7

CHAINS	
13.30	Fence, bears east and west, top of ascent, bears east and west; desc. 35 ft. over gentle north slope,
28.30	Irrigation canal, 15 lks. wide, 3 ft. deep, drains S.70°E.
41.91	Point for the $\frac{1}{4}$ sec. cor. of secs. 23 and 24, at intersection of old fences from north and west. A sandstone, 8x12x12 ins. lying upon the ground, no other rocks around, and is accepted as the best evidence of the position of the original cor. At the cor. point. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T20S R7E $\frac{1}{4}$ S23 S24 1962 raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, west of cor. N.1°00'W., beginning new measurement.
11.60	Wash, 100 lks. wide, 10 ft. deep, drains irregularly east.
19.07	Fence, bears east and west; asc. 65 ft. over SE. slope.
21.50	Irrigation ditch, 4 lks. wide, 2 ft. deep, drains S.70°W.
25.00	Top of ascent, slopes east; desc. 55 ft. over NE. slope.
25.90	Irrigation ditch, 10 lks. wide, 2 ft. deep, drains S.60°E.
28.70	Irrigation ditch, 10 lks. wide, 2 ft. deep, drains east, thence over level farm land.
30.90	Road, unimproved, bears S.80°E. and north,
39.19	Cor. fence, bears east and north.
39.29	Point for the cor. of secs. 13, 14, 23 and 24 at cor. of fence bearing W. and S. and in line with the center of a gravel road bearing E. and N. and is accepted as the best evidence of the position of the original cor. At the cor. point Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T20S R7E S14 S13 S23 S24 1962 Cor. is located alongside fence post, at east side of gate. Land, nearly level desert south portion; level farm land north portion.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

Soil, clay.
No timber.
Undergrowth, shadscale south portion.

From the true point for cor. of secs. 13, 18, 19 and 24, on the east boundary of the Tp., from which it's witness cor. bears S.0°30'E., 2.20 chs. dist., hereinbefore described.

S.89°45'W., bet. secs. 13 and 24.

Over nearly level meadow land, along south side of Ferron Creek.

0.35 Gravel, road, bears north and south.

6.50 Ferron Creek, with stream of water, 10 lks. wide, 1 ft. deep, flows irregularly east, from NW.

9.50 Fence, bears N.20°W. and S.30°W.

10.12 Ferron creek, flows irregularly east, from irregularly NW.

16.30 Ditch, drains north, enter medium dense willows and greasewood.

41.02 Point for the $\frac{1}{4}$ sec. cor. of secs. 13 and 24, at intersection of property line fences from south, east and west; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4}$ $\frac{S13}{S24}$

1962

No accessories available.

S.89°40'W., beginning new measurement.

Over level meadow land, along fence line through dense willows.

15.64 Fence, bears S.50°E., leave meadow land and willows, thence along gravel road, bears west and SE.

40.75 The cor. of secs. 13, 14, 23 and 24.

Land, nearly level meadow and farm land.
Soil, clay.
No timber.
Undergrowth, willows, greasewood.

From the cor. of secs. 1, 6, 7 and 12, on the east boundary of the Tp., hereinbefore described.

S. 89°24'W., bet. secs. 1 and 12.

Dependent Resurvey of a Portion of the S subdivision, T. 20 S., R. 7 E.

CHAINS

Over gently rolling desert land.

Desc. 15 ft. over a SW. slope.

2.05 Wash, 10 lks. wide, 2 ft. deep, drains SE.; asc. 40 ft. over gentle NE. slope.

7.70 Irrigation ditch, 20 lks. wide, 2 ft. deep, drains SE.

11.85 Road, unimproved, bears north and south.

16.90 Spur, slopes SE., desc. 90 ft. over SW. slope.

20.84 Fence, bears north and south.

32.12 Fence, bears north and south.

34.50 Wash, drains SE., asc. 10 ft. over NE. slope.

40.11 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 1 and 12.Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

WC

$\frac{1}{4}$	S1
	S12
	1962

raise a mound of stone. 3 ft. base, $1\frac{1}{2}$ ft. high, north of cor.40.76 True point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 12, at proportionate dist. falls in marsh, and is deemed unsafe to perpetuate; there is no remaining evidence of the original cor.

41.65 Center of small pond; asc. 45 ft. over NE. slope.

43.04 Fence, bears N. 20° W. and S. 20° E.

61.18 Fence, bears north and south.

67.60 Spur, slopes SE.; desc. 25 ft. over SW. slope.

75.55 Wash, 15 lks. wide, 3 ft. deep, drains SE.; asc. 10 ft. over NE. slope

81.52 The cor. of secs. 1, 2, 11 and 12, monumented with a limestone $5 \times 8 \times 10$ ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S R7E

S2	S1
S11	S12

1962

bury original stone cor. alongside iron post.

Dependent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7 E.

CHAINS

Land, gently rolling desert.
Soil, gravelly clay.
No timber.
Undergrowth, shadscale.

N. 0° 06' W., bet. secs. 1 and 2.

Over gently rolling desert land.

Desc. 30 ft. over NE. slope.

6.20 Wash, 10 lks, wide, 3 ft. deep, drains SE.; asc. 60 ft. over SW. slope.

11.10 Spur, slopes SE.; desc. 60 ft. over NE. slope.

19.27 Fence, bears N. 80° W. and S. 80° E.

28.06 Small log cabin on line.

28.75 Wash, drains SE., thence along west side of unimproved road, bears north and SE.

40.56 Point for the $\frac{1}{2}$ sec. cor. of secs. 1 and 2, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{2}$
S2|S1
1962

Set a cedar post 6 ft. long, 5 ins. diam., alongside iron post, and raise a mound of stone, 3 ft. base, 1 ft. high around post.

Asc. 200 ft. over SW. slope.

43.45 Leave road, bears NW.

44.67 Fence, bears N. 80° W. and S. 70° E.

45.85 Road, unimproved, bears N. 80° W. and S. 70° E.

47.00 Fence, bears N. 80° W. and S. 80° E.

55.80 Irrigation ditch, 4 lks. wide, 1 ft. deep, drains SE.

57.70 Irrigation ditch, 5 lks, wide, 1 ft. deep, drains S. 70° E.

58.60 Cor. of fences, from north, south, east and west, thence along fence line.

72.30 Ridge, bears east and west; desc. 35 ft. over north slope.

80.82 The cor. of secs. 1, 2, 35 and 36, on the north boundary of the Tp., hereinbefore described.

Land, rolling desert.
Soil, clay.
No timber.
Undergrowth, shadscale.

Dependent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7 E.

CHAINS

From the standard cor. of secs. 2, 3, 34 and 35, on the south boundary of the Tp., hereinbefore described.

N. 0° 46' W., bet. secs. 34 and 35.

Over rolling desert land.

Asc. 5 ft. over SE. slope.

1.20 Small spur, slopes east; desc. 10 ft. over north slope.

9.15 Wash, drains east; asc. 30 ft. over SE. slope.

14.60 Small spur, slopes NE.; desc. 60 ft. over NW. slope.

24.15 Wash, 20 lks. wide, 15 ft. deep, drains NE.; asc. 35 ft. over SE. slope.

29.40 Clay ridge, bears east and west; desc. 20 ft. over NE. slope.

37.30 Wash, drains east; asc. 15 ft. over SE. slope.

41.15 Point for the $\frac{1}{2}$ sec. cor. of secs. 34 and 35, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{2}$

S34 | S35

1962

raise a mound of stone, 3 ft. base, 2 ft. high, west of cor.

Asc. 10 ft. over SW. slope.

42.00 Spur, slopes east; desc. 30 ft. over NE. slope.

52.50 Wash, drains east; asc. 20 ft. over SE. slope.

55.80 Ridge, bears east and west; desc. 95 ft. over NW. slope.

82.30 Point for the cor. of secs. 26, 27, 34 and 35, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

S27 | S26

S34 | S35

1962

deposit charcoal around iron post, 3 ins. below ground.

Land, rolling desert.

Soil, blue clay.

No timber.

Undergrowth, shadscale.

Independent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7 E.

CHAINS

From the cor. of secs. 25, 26, 35 and 36.

S. 89° 24' W., bet. secs. 26 and 35.

Over rolling desert land.

Asc. 45 ft. over SE. slope.

2.60 Spur, slopes NE.; desc. 20 ft. over NW. slope.

3.40 Wash, drains north; asc. 15 ft. over NE. slope.

8.50 Spur, slopes north; desc. 15 ft. over NW. slope.

10.80 Wash, drains north; asc. 25 ft. over NE. slope.

16.20 Spur, slopes north; desc. 20 ft. over NW. slope.

18.20 Wash, drains north; asc. 15 ft. over NE. slope.

31.40 Small clay knoll; desc. 15 ft. over gentle NW. slope.

40.53 Point for the $\frac{1}{4}$ sec. cor. of secs. 26 and 35 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4}$ S26
S35

1962

deposit glass around iron post, 3 ins. below ground.

Desc. 20 ft. along gentle north slope.

81.06 The cor. of secs. 26, 27, 34 and 35.

Land, gentle rolling desert.

Soil, blue clay.

No timber.

Undergrowth, shadscale.

N. 0° 57' W., bet. secs. 26 and 27.

Over nearly level desert land.

18.35 Wash, 10 lks. wide, 6 ft. deep, drains N. 50° E.

36.70 Wash, 5 lks. wide, 2 ft. deep, drains N. 30° E.

41.15 Point for the $\frac{1}{4}$ sec. cor. of sec. 26 and 27, at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4}$
S27 | S26
1962

Dependent Resurvey of a portion of the Subdivision, T. 20 S., R. 7 E.

CHAINS

- raise a mound of stone, 3 ft. base, 2 ft. high, west of cor.
- 49.89 Fence, bears east and west.
- 51.10 Road, unimproved, bears east and west.
- 61.40 Wash, 5 lks, wide, 2 ft. deep, drains east.
- 68.51 Fence, bears N. 30° E. and S. 60° W.
- 78.64 Fence, bears east and west.
- 79.80 Road, unimproved, bears SE., and curves north.
- 82.30 Point for the cor. of secs. 22, 23, 26 and 27, at intersection of property line fences, from east, north and west; and is accepted as the best evidence of the position of the original cor.
- At the cor. point
- Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T20S R7E
- S22|S23
S27|S26
- 1962
- Land, nearly level desert.
Soil, clay.
No timber.
Undergrowth, shadscale.
-
- From the cor. of secs. 23, 24, 25 and 26.
- S.89° 57' W., bet. secs. 23 and 26.
- Over nearly level desert land.
- 38.35 Road, unimproved, bears irregularly S. 70 E. and N. 70 W.
- 40.53 Point for the ¼ sec. cor. of secs. 23 and 26 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T20S R7E
- ¼ S23
S26
- 1962
- deposit glass around iron post, 3 ins. below ground, and raise a mound of stone, 3 ft. base, 2 ft. high, north of cor.
- 64.07 Fence, bears N. 40° E. and S. 40° W.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

81.06 The cor. of secs. 22, 23, 26 and 27.

Land, nearly level desert.
Soil, clay.
No timber.
Undergrowth, shadscale.

N. 1° 04' W., bet. secs. 22 and 23.

Over nearly level farm land, along fence line.

4.90 Irrigation ditch, 10 lks. wide, 3 ft. deep, drains east.

16.04 Fence, bears east and west.

16.45 House, bears west, 2.50 chs. dist.

27.03 Fence, bears east and west, leave north-south fence line.

27.25 Road, unimproved, bears west, from south.

29.30 Wash, 10 lks. wide, 3 ft. deep, drains east; asc. 40 ft. over south slope.

31.54 Fence, bears N. 70° W. and S. 20° E.

36.55 Low clay ridge, bears east and west; desc. 10 ft. over gentle north slope.

40.07 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 22 and 23.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4}$

WC

S22 \uparrow S23

1962

deposit glass around iron post, 3 ins. below ground, and raise a mound of stone, 3 ft. base, 2 ft. high, west of cor.

40.37 True point for the $\frac{1}{4}$ sec. cor. of secs. 22 and 23 at proportionate dist. falls in cultivated land and is not monumented; there is no remaining evidence of the original cor.

47.17 Road, unimproved, bears east and west, leave cultivated land.

47.33 Cor. of fences bearing north, south, east and west, thence along fence line.

49.70 Irrigation ditch, 5 lks. wide, 3 ft. deep, drains east.

54.00 Wash, 15 lks. wide, 10 ft. deep, drains S. 70° E.

70.25 Enter small patch of dense willows.

72.25 Leave willows.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

- 73.32 Fence, bears east and west.
- 73.45 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains east.
- 75.91 Fence, bears east and west.
- 79.57 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains east.
- 80.74 Point for the cor. of secs. 14, 15, 22 and 23, at intersection of north-south, east-west property line fences; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{S15}{S22} | \frac{S14}{S23}$

1962

No accessories available.

Land, nearly level farm land.

Soil, loamy clay.

No timber.

From the standard cor. of secs. 3, 4, 33 and 34, on the south boundary of the Tp., hereinbefore described.

N.0°54'W., bet. secs. 33 and 34.

Over nearly level desert land.

- 4.72 Telephone line, bears N. 40° E. and S. 40° W.
- 6.00 Center line of State Highway No. 10, bears N.18°30' E. and S.18°30' W., approximately.
- 12.35 Wash, 10 lks. wide, 2 ft. deep, drains N. 70° E.
- 24.00 Enter low clay hills.
- 41.47 Point for the $\frac{1}{4}$ sec. cor. of secs. 33 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{S33}{S33} | \frac{S34}{S34}$

1962

deposit glass around iron post, 4 ins. below ground, and raise a mound of stone, 3 ft. base, 2 ft. high, west of cor.

- 43.25 Wash, 30 lks. wide, 30 ft. deep, drains east; asc. 200 ft. over south slope.

Dependent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7 E.

CHAINS

- 55.95 Spur, slopes SE.; desc. 210 ft. over steep NE. slope.
- 63.10 Draw, drains east; asc. 200 ft. over steep south slope.
- 73.25 Spur, slopes east; desc. 370 ft. over steep north slope.
- 81.00 Bottom of steep slope; desc. 30 ft. over a N. slope.
- 82.94 Point for the cor. of secs. 27, 28, 33 and 34, at proportionate dist. in latitude, and at midpoint from the extension of property line fences to the north.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{S28}{S33} | \frac{S27}{S34}$

1962

deposit glass around iron post, 3 ins. below ground, and raise a mound of stone, 3 ft. base, 2 ft. high, west of cor.

Land, nearly level desert south portion; mountainous north portion.

Soil, clay.

No timber.

Undergrowth, sparse shadscale.

From the cor. of secs. 26, 27, 34 and 35.

S. $89^{\circ}22'$ W., bet. secs. 27 and 34.

Over rolling desert land.

Desc. 25 ft. over NW. slope.

- 5.50 Wash, 30 lks. wide, 6 ft. deep, drains north; asc. 50 ft. over east slope.

- 12.00 Spur, slopes north; desc. 50 ft. over west slope.

- 16.30 Wash, drains north; asc. 20 ft. over NE. slope.

- 19.60 Spur, slopes north; desc. 25 ft. over NW. slope.

- 36.00 Wash, 50 lks. wide, 10 ft. deep, drains north; asc. 15 ft. over east slope.

- 40.52 Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{S27}{S34}$

1962

raise a mound of stone, 3 ft. base, 2 ft. high, north of cor.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS	
	Asc. 30 ft. over east slope.
43.47	Fence, bears north and south.
47.70	Spur, slopes north; desc. 40 ft. over NW. slope.
57.46	Telephone line, bears north and south.
63.30	Wash, drains north; asc. 30 ft. over NE. slope.
68.06	Fence, bears N. 20° W. and S. 30° E.
68.80	Center line of State Highway No. 10, on curve bearing northwesterly and southerly; desc. 10 ft. over NW. slope.
78.00	Wash, drains north; asc. 10 ft. along north slope.
81.04	The cor. of secs. 27, 28, 33 and 34. Land, rolling desert. Soil, clay. Undergrowth, shadscale. No timber.
	N. 1°03' W., bet. secs. 27 and 28. Over nearly level farm land. Desc. 70 ft. over gentle north slope.
5.00	Thence along the remains of old State Highway No. 10.
13.40	Irrigation canal, 10 lks. wide, 8 ft. deep, drains east.
14.20	Irrigation ditch, 4 lks. wide, 2 ft. deep, drains east.
16.40	New State Highway No. 10, bears N. 1° W., and curves SE, thence along highway.
30.65	Irrigation ditch, 5 lks. wide, 3 ft. deep, drains east.
41.47	Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 28, on State Highway No. 10, at midpoint between old fences paralleling the Highway, and in line with the extension of a property line fence to the east, and is accepted as the best evidence of the position of the original cor. At the cor. point Drive a nail, 2 ins. long, flush with highway, from which An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24 ins. in the ground, and in a collar of stone to top, for a reference monument, bears S. 45° E., 65 ft. dist., with brass cap mkd. T20S R7E $\frac{1}{4}$ S27 RM 65' 1962, with an arrow pointing to true cor. point. An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 24 ins. in the ground, and in a collar of stone to top, for a reference monument, bears N. 45° W., 65 ft. dist., with brass cap mkd. T20S R7E $\frac{1}{4}$ S28 RM 65' 1962, with an arrow pointing to the true cor. point.

Dependent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7 E.

CHAINS

N. 0°54' W., beginning new measurement.

Continue along highway through nearly level farm land.

40.00

Point for the cor. of secs. 21, 22, 27 and 28, on State Highway No. 10, at midpoint between old fences parallel to the highway, and in line with the extension of a property line fence to the east, and is accepted as the best evidence of the position of the original cor.

At the cor. point

Drive a nail, 2 ins. long, flush with highway,
from which

An iron post, 30 ins. long, 2½ ins. diam., set 22 ins. in the ground, for a reference monument, bears N. 45° E., 62 ft. dist., with brass cap mkd. T20S R7E S22 RM 62' 1962, with an arrow pointing to the true cor. point;

deposit glass around iron post, 3 ins. below ground.

An iron post, 30 ins. long, 2½ ins. diam., set 24 ins. in the ground, and in a collar of stone to top, for a reference monument, bears S. 45° E., 62 ft. dist., with brass cap mkd. T20S R7E S27 RM 62' 1962, with an arrow pointing to the true cor. point,

deposit glass around iron post, 3 ins. below ground.

Land, nearly level farm land.
Soil, clay.
No timber.

From the cor. of secs. 22, 23, 26 and 27.

S. 88°46' W., bet. secs. 22 and 27.

Over nearly level desert land to south, farm land to north, along an old fence line.

17.89

Fence, bears north and south.

26.40

Irrigation ditch, 5 lks. wide, 3 ft. deep, drains N.

38.10

Wash, 100 lks. wide, 15 ft. deep, drains NE. from SW.

40.00

Point selected for the witness ¼ sec. cor. of secs. 22 and 27.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E
¼ ← S22
S27
WC
1962

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7

CHAINS

- 40.55 Point for the $\frac{1}{4}$ sec. cor. of secs. 22 and 27 at proportionate dist. falls in wash, 50 lks. wide, 10 ft. deep, drains NE. from irregularly W., and is not monumented; there is no evidence of the original cor.
- Thence along wash.
- 55.90 Leave wash, drains irregularly E. from SW.; asc. 70 ft. over SE. slope of knoll.
- 56.20 Road, unimproved, bears NE. and SW.
- 62.70 Top of knoll; desc. 60 ft. over SW. slope.
- 81.10 The true cor. point for secs. 21, 22, 27 and 28.
- Land, nearly level desert to south and west; farm land to north and east.
Soil, clay.
No timber.
Undergrowth, shadscale, rabbit brush in desert area.
- The cor. of secs. 3, 4, 9 and 10, monumented with a sandstone, 5x10x12 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T20S R7E

S4	S3
S9	S10

1962
- Bury original stone cor. alongside iron post.
- North, bet. secs. 3 and 4.
- Over gently rolling desert land, along fence line.
- 7.00 Fence, bears E. and W.
- 11.50 Road, unimproved, bears E. and W.
- 20.03 Fence, bears E. and W.
- 33.05 Irrigation canal, 20 lks. wide, 4 ft. deep, flows NE.
- 40.00 New barbwire fence, bears E. and W. End N. and S. fence.
- 40.49 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 4, at proportionate dist. latitudinally, and in line with property line fence from south.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R7E

$\frac{1}{4}$

S4	S3
----	----

1962

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

raise a mound of stone, 3 ft. base, 2 ft. high, west of cor.

N. 1° 08' W., beginning new measurement.

23.75 Road, unimproved, bears east and west.

25.63 Telephone line, bears east and west.

40..90 The cor. of secs. 3, 4, 33 and 34, on the north boundary of the Tp., hereinbefore described.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale, sagebrush and rabbit brush.

From the standard cor. of secs. 4, 5, 32 and 33, on the south boundary of the Tp., hereinbefore described.

N. 0° 15' W., bet. secs. 32 and 33.

Over mountainous land.

Asc. 50 ft. over SW. slope.

3.80 Small spur, slopes SE.; desc. 40 ft. over NE. slope.

7.20 Wash, 20 lks. wide, 6 ft. deep, drains S. 80° E.; asc. 35 ft. over SW. slope.

16.40 Wash, 30 lks. wide, 6 ft. deep, drains S. 10° W.; asc. 290 ft. over SW. slope.

20.37 Fence, bears east and west.

28.70 South rim of small mesa, bears NW. and SE., thence along top.

30.90 North rim of mesa, bears NE. and SW.; desc. 360 ft. over steep, broken NW. slope.

41.47 Point for the $\frac{1}{4}$ sec. cor. of secs. 32 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4}$

S32|S33

1962

No accessories available.

Desc. 240 ft. over steep, NW. slope.

56.70 Base of steep descent, bears west and NE.; desc. 30 ft. over gentle NW. slope.

58.22 Telephone line, bears N. 70° E. and S. 80° W.

67.40 Wash, 30 lks. wide, 5 ft. deep, drains east; asc. 25 ft. over SE. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

- 71.30 Small spur, slopes NE.; desc. 60 ft. over north slope.
- 80.80 Bottom of descent; asc. 10 ft. over SE. slope.
- 82.94 Point for the cor. of secs. 28, 29, 32 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

S29	S28
S32	S33

1962

No accessories available.

Land, mountainous.
Soil, rocky clay.
No timber.
Undergrowth, shadscale.

- 39.94 From the cor. of secs. 27, 28, 33 and 34.
S. $88^{\circ} 52'$ W., bet. secs. 28 and 33.
Over gently rolling desert land.
Desc. 20 ft. over gentle NW. slope.
- Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R7E

S28
S33

1962

raise a mound of stone, 3 ft. base, 2 ft. high, north of cor.

Desc. 10 ft. over NW. slope.

- 52.14 Telephone line, bears N. 50° E. and S. 50° W.
- 54.00 Wash, 25 lks. wide, 2 ft. deep, drains N. 40° W.; asc. 50 ft. over NW. changing to north slope.
- 79.88 The cor. of secs. 28, 29, 32 and 33.

Land, gently rolling desert.
Soil, clay.
No timber.
Undergrowth, shadscale.

N. $2^{\circ} 11'$ W., bet. secs. 28 and 29.

Over rolling desert land.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

Desc. 20 ft. over series of small spurs and washes.

- 0.95 Wash, 10 lks. wide, 5 ft. deep, drains east.
- 8.35 Wash, 20 lks. wide, 5 ft. deep, drains east.
- 15.55 Wash, 20 lks. wide, 4 ft. deep, drains east.
- 23.25 Wash, 30 lks. wide, 8 ft. deep, drains east.
- 23.72 Fence, bears east and west; asc. 35 ft. over south slope.
- 25.30 Low clay ridge, bears east and west; desc. 45 ft. over north slope.
- 33.30 Wash, 20 lks. wide, 5 ft. deep, drains east; asc. 40 ft. over south slope.
- 41.50 Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 29 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T20S R7E
 $\frac{1}{4}$
S29 | S28
1962
- Asc. 65 ft. over south slope.
- 42.05 Ridge, bears east and west; desc. 110 ft. over north slope.
- 45.35 Wash, 10 lks, wide, 4 ft. deep, drains east.
- 50.30 Wash, 10 lks. wide, 5 ft. deep, drains east; asc. 125 ft. over south slope.
- 59.60 Ridge, bears east and west; desc. 160 ft. over north slope.
- 60.76 Fence, bears east and west, enter farm land.
- 68.10 Road, unimproved, bears east and west.
- 68.25 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains east.
- 80.10 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains east.
- 80.50 Road, unimproved, bears east and west, leave farm land.
- 83.00 The cor. of secs. 20, 21, 28 and 29, monumented with a sandstone, 4x7x10 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R7E
S20 | S21
S29 | S28
1962

Dependent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7 T.

CHAINS

bury original stone cor. alongside iron post, and deposit glass around iron post, 3 ins. below ground.

Land, rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the true cor. point of secs. 21, 22, 27 and 28.

S. 89° 50' W., bet. secs. 21 and 28.

Over level farm land.

0.73 Fence, bears north and south.

40.81 Point for the $\frac{1}{4}$ sec. cor. of secs. 21 and 28, falls in cultivated land and is not monumented.

41.00 Telephone line, bears north and south.

44.19 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 21 and 28.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E
 $\frac{1}{4}$ $\frac{S21}{S28}$ \rightarrow W
 C

1962

deposit glass around iron post, 6 ins. below ground.
 Cor. located on north-south fence line.

Leave farm land, enter desert land.

60.35 Irrigation ditch, 5 lks. wide, 2 ft. deep, drains south.

60.70 Irrigation canal, 10 lks. wide, 4 ft. deep, flows south.

61.54 Fence, bears north and south.

81.62 The cor. of secs. 20, 21, 28 and 29.

Land, level farm land east portion; desert west portion.

Soil, clay.

No timber.

Undergrowth, shadscale west portion.

N. 0° 19' W., bet. secs. 20 and 21.

Over level farm land, along east side of gravel road.

20.48 Fence, bears east and west.

40.71 Point for the $\frac{1}{4}$ sec. cor. of secs. 20 and 21, on a north-south property line fence, and at intersection of property line fence to west; and is accepted as the best evidence of the position of the orig. cor.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 6 ins.

Dependent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7 E.

CHAINS

below ground, with brass cap mkd.

T20S R7E

S20|S21

1962

from which

An iron post, 30 ins. long, 2½ ins. diam., set 24 ins. in the ground, for a reference monument, bears N. 0°37' W., 11.2 ft. dist., with brass cap mkd. T20S R7E S20/21 RM 11.2 1962, and an arrow pointing to the true cor.

An iron post, 30 ins. long, 2½ ins. diam., set 24 ins. in the ground, for a reference monument, bears S. 0°19' E., 11.2 ft. dist., with brass cap mkd. T20S R7E S20/21 RM 11.2 1962, and an arrow pointing to the true cor.

N. 0°37' W., beginning new measurement.

Continue over level farm land, along gravel road.

40.93 Point for the cor. of secs. 16, 17, 20 and 21, at the center line intersection of north-south, east-west gravel roads; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 4 ins. below the ground, with brass cap mkd.

T20S R7E

S17|S16

S20|S21

1962

from which

An iron post, 30 ins. long, 2½ ins. diam., set 22 ins. in the ground, for a reference monument, bears N. 48°55' E., 38.1 ft. dist., with brass cap mkd. T20S R7E S16 RM 38.1 1962, and an arrow pointing to the true cor.

deposit glass around iron post, 3 ins. below ground.

Dependent Resurvey of a Portion of the Subdivision, T. 20 S., R. 7

CHAINS

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 22 ins. in the ground, for a reference monument, bears S. $41^{\circ}56'$ E., 49.3 ft. dist., with brass cap mkd. T20S R7E S21 RM 49.3' 1962, and an arrow pointing to the true cor.

deposit glass around iron post, 3 ins. below ground.

Land, level farm land.

Soil, loamy clay.

No timber.

N. $0^{\circ}37'$ W., bet. secs. 16 and 17.

Over level farm land, along gravel road.

26.40 Irrigation canal, 30 lks. wide, 6 ft. deep, flows east.

36.10 Old barn, bears E. 50 lks. dist.

40.22 Point for the $\frac{1}{2}$ sec. cor. of secs. 16 and 17, on center line of north and south gravel road, and in line with center line of gravel road to east; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. below ground, with brass cap mkd.

T20S R7E

$\frac{1}{2}$

S17 | S16

1962

from which

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 22 ins. in the ground, with glass around post, 3 ins. below ground, for a reference monument, bears N. $42^{\circ}20'$ E., 47.2 ft. dist., with brass cap mkd. T20S R7E S16 RM 47.2' 1962, and an arrow pointing to the true cor.

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 22 ins. in the ground, with glass around iron post, 3 ins. below ground, for a reference monument, bears N. $51^{\circ}48'$ W., 54.8 ft. dist., with brass cap mkd. T20S R7E S17 RM 54.8' 1962, and an arrow pointing to the true cor.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS	
	<p>N. 0°37' W., beginning new measurement.</p> <p>Continue along gravel road through farm land.</p> <p>8.05 Irrigation canal, 5 lks. wide, 3 ft. deep, flows east.</p> <p>16.63 House, bears E., 50 lks. dist.</p> <p>24.16 House, bears E., 50 lks. dist.</p> <p>37.00 Road, curves NW., enter cottonwood trees and willows along Ferron Creek.</p> <p>38.00 Irrigation ditch, 20 lks. wide, 1 ft. deep, drains E.</p> <p>39.00 Ferron Creek, 40 lks. wide, 2 ft. deep, flows S. 60° E.</p> <p>40.70 Leave trees and willows, enter road.</p> <p>40.86 Point for the cor. of secs. 8, 9, 16 and 17 at intersection of north-south gravel road and east-west oiled road; and is accepted as the best evidence of the position of the original cor.</p> <p>At the cor. point</p> <p>Drive a nail, 2 ins. long, flush with oiled road.</p> <p>from which</p> <p>An iron post, 30 ins. long, 2½ ins. diam., set 22 ins. in the ground, with glass around post, 3 ins. below ground, for a reference monument, bears N. 43° E., 64.7 ft. dist., with brass cap mkd. T20S R7E S9 RM 64.7' 1962, and an arrow pointing to the true cor.</p> <p>An iron post, 30 ins. long, 2½ ins. diam., set 22 ins. in the ground, with glass around iron post, 3 ins. below ground, for a reference monument, bears N. 25°02' W., 72.3 ft. dist., with brass cap mkd. T20S R7E S8 RM 72.3' 1962, and an arrow pointing to the true cor.</p> <p>Land, level farm land. Soil, loamy clay. Timber, cottonwood trees along Ferron Creek. Undergrowth, willows along Ferron Creek.</p>
	<p>N. 0°33' W., bet. secs. 8 and 9.</p> <p>Over level farm land, along gravel road.</p> <p>3.30 Irrigation canal, 30 lks. wide, 3 ft. deep, flows S.75°E.</p> <p>11.00 Several buildings east and west of line, about 50 lks. dist.</p> <p>24.37 Road to east, continue along road.</p>

Dependent Resurvey of a Portion of the Subdivision of T. 20 S.,

CHAINS

27.20	House, bears W., 50 lks. dist.
28.50	House, bears E., 50 lks. dist.
33.00	Shed, bears E., 50 lks. dist.
40.57	Point for the $\frac{1}{2}$ sec. cor. of secs. 8 and 9, on center line of gravel road, and in line with property line fences to east and west, and is accepted as the best evidence of the position of the original cor.
	At the cor. point
	Drive a nail, 3 ins. long, flush with gravel road.
	from which
	An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 22 ins. in the ground, for a reference monument, bears S. $28^{\circ}49'$ E., 41.2 ft. dist., with brass cap mkd. T20S R7E S9 RM 41.2' 1962, and an arrow pointing to the true cor.
	An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 22 ins. in the ground, for a reference monument, bears S. $82^{\circ}40'$ W., 31.7 ft. dist., with brass cap mkd. T20S R7E S8 RM 31.7' 1962, and an arrow pointing to the true cor.
	N. $0^{\circ}33'$ W., beginning new measurement.
	Continue along gravel road.
18.55	Leave gravel road, bears NW.
19.45	Irrigation ditch, 5 lks. wide, 2 ft. deep, drains S. 40° E.
25.20	Irrigation canal, 20 lks. wide, 10 ft. deep, flows E.
26.00	Road, bears S. 50° E. and north, thence along road.
35.00	Leave road, bears NW.
39.30	Road, unimproved, bears N. 80° E. and S. 80° W.
40.77	The cor. of secs. 4, 5, 8 and 9, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1921 survey.
	Land, nearly level farm land.
	Soil, clay.
	No timber.
	Undergrowth, shadscale, north of canal.
	From the cor. of secs. 3, 4, 9 and 10.
	S. $89^{\circ}34'$ W., bet. secs. 4 and 9.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

Over nearly level farm land.

Asc. 40 ft. over gentle east slope.

12.92 Irrigation canal, 30 lks. wide, 5 ft. deep, flows S.10°E.

14.80 Leave farm land, enter medium sagebrush.

15.74 Fence, bears north and south.

22.65 Road, unimproved, bears north and south.

40.76 Point for the $\frac{1}{4}$ sec. cor. of secs. 4 and 9 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R7E

$\frac{1}{4}$ S4
S9

1962

raise a mound of stone, 3 ft. base, 1 $\frac{1}{2}$ ft. high, north of cor.

41.22 Telephone line, and old fence, bears north and south.

63.70 Wash, 15 lks. wide, 2 ft. deep, drains south.

81.52 The cor. of secs. 4, 5, 8 and 9.

Land, nearly level farm east portion; gently rolling desert west portion.

Soil, clay.

No timber.

Undergrowth, shadscale and sagebrush west portion.

Retracement of a portion of the Survey executed by H.W. Miller and W. H. Good in 1921.

N. 0° 55' W., bet. secs. 4 and 5.

Over rolling desert land.

2.75 Wash, 50 lks. wide, 2 ft. deep, drains S. 40° E.; asc. 70 ft. over rolling SE. slope.

6.65 Road, unimproved, bears irregularly north and south.

16.00 Old broken fence, bears north, thence along fence line.

40.83 The $\frac{1}{4}$ sec. cor. of secs. 4 and 5, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record. Rebuild mound of stone, 3 ft. base around iron post.

N. 0° 55' W., beginning new measurement.

Asc. 100 ft. over SE. slope.

24.30 Spur, slopes east; desc. 35 ft. over north slope.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

- 29.00 Wash, 200 lks. wide, 20 ft. deep, drains east.
- 32.05 Wash, 20 lks. wide, 3 ft. deep, drains east; asc. 10 ft. over SE. slope.
- 34.60 Small spur, slopes east; desc. 40 ft. over NE. slope.
- 41.36 The cor. of sec. 4 and 5, on the north boundary of the Tp., hereinbefore described.
- Land, rolling desert.
Soil, clay.
No timber.
Undergrowth, shadscale.
-
- Reestablishment of the Survey Executed by A. D. Ferron in 1873.
- From the standard cor. of secs. 5, 6, 31 and 32, on the south boundary of the Tp., hereinbefore described.
- N. 0° 25' E., bet. secs. 31 and 32.
- Over mountainous land through dense pinon and juniper timber.
- Asc. 45 ft. over gentle SE. slope of bench land.
- 15.00 Wash, 20 lks. wide, 10 ft. deep, drains SE.
- 33.00 North edge of bench, bears irregularly east and west; desc. 255 ft. over steep, broken north slope.
- 41.73 Point for the $\frac{1}{4}$ sec. cor. of secs. 31 and 32 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.
- T20S R7E
 $\frac{1}{4}$
S31|S32
1962
- Desc. 60 ft. over north slope.
- 45.90 Draw, drains north; desc. 105 ft. along east slope of draw.
- 50.30 Wash, 15 lks. wide, 10 ft. deep, drains N. 70° E., continue descent.
- 57.10 Same wash, drains N. 60° W.
- 59.90 Wash, 25 lks. wide, 15 ft. deep, drains west.
- 75.40 Wash, 25 lks. wide, 5 ft. deep, drains N. 75° E.
- 83.46 The cor. of secs. 29, 30, 31 and 32, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1921 survey.
- Land, mountainous.
Soil, rocky clay.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

Timber, dense pinon and juniper.
Undergrowth, shadscale.

From the cor. of secs. 28, 29, 32 and 33.

S. 89°15' W., bet. secs. 29 and 32.

Over gently rolling desert land, through medium shadscale and sagebrush.

Asc. along a gently rolling north slope.

39.94 Point for the $\frac{1}{4}$ sec. cor. of secs. 29 and 32 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R7E

$\frac{1}{4}$ $\frac{S29}{S32}$
1962

Desc. along gently rolling north slope.

65.25 Wash, 5 lks. wide, 2 ft. deep, drains N. 75° E.; asc. over gentle NE. slope.

79.88 The cor. of secs. 29, 30, 31 and 32.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

Retracement of a portion of Survey executed by H. W. Miller and W. H. Good, in 1921

S. 86°28' W., bet. secs. 30 and 31.

Over mountainous land.

5.00 Wash, drains NE.; asc. 65 ft. over SE. slope.

21.05 Top of low spur, slopes SE.; asc. 290 ft. over broken and ledgy SE. slope. Enter timber.

38.36 True point for the $\frac{1}{4}$ sec. cor. of secs. 30 and 31 falls on ledge where cor. cannot be perpetuated.

S. 86°28' W., beginning new measurement.

4.80 Top of white sandstone ledges, bears NE. and SW.

4.84 The witness $\frac{1}{4}$ sec. cor. of secs. 30 and 31, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record. Rebuild mound of stone around iron post.

Asc. 120 ft. over SE. slope.

13.35 Top of ascent, bears NE. and SW.; desc. 50 ft. over NW. slope.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R.

CHAINS 18.00	Bottom of draw, drains NE.; asc. 100 ft. over SE. slope.
42.99	<p>The cor. of secs. 25, 30, 31 and 36, on the W. bdy. of the Tp., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record.</p> <p>Land, mountainous, broken. Soil, rocky clay, exposed sandstone. Timber, medium pinon and juniper. Undergrowth, shadscale and sagebrush.</p>
	<p>From the cor. of secs. 29, 30, 31 and 32.</p> <p>N. 3°13' W., bet. secs. 29 and 30.</p> <p>Over rolling desert land.</p>
	Asc. 50 ft. along east slope, over series of small washes draining E.
28.22	Fence, bears E. and W.; desc. 10 ft. over NE. slope.
37.70	Wash, 100 lks. wide, 1 ft. deep, drains E.; asc. 30 ft. over S. slope.
41.10	Small spur, slopes E.; desc. 35 ft. over N. slope.
42.19	<p>The $\frac{1}{2}$ sec. cor. of secs. 29 and 30, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record. Rebuild stone mound around iron post.</p> <hr/>
	N. 3°18' W., beginning new measurement.
	Desc. 50 ft. over N. slope, enter scattered juniper timber.
4.30	Wash, 50 lks. wide, 5 ft. deep, drains E.; asc. 70 ft. over S. slope.
8.35	Spur, slopes E.; desc. 75 ft. over NE. slope.
14.65	Wash, 50 lks. wide, 6 ft. deep, drains irregularly E.; desc. 30 ft. over NE. slope.
19.30	Wash, 20 lks. wide, 5 ft. deep, drains E.; desc. 90 ft. over NE. slope. Leave timber.
41.06	<p>The cor. of secs. 19, 20, 29 and 30, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record.</p> <p>Land, rolling desert. Soil, rocky clay. Timber, scattered juniper, north portion. Undergrowth, shadscale.</p>
	<p>Reestablishment of the Survey executed by A. D. Ferron, in 1873.</p> <hr/>
	From the cor. of secs. 20, 21, 28 and 29.

Independent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

S. 89° 35' W., bet. secs. 20 and 29.

Over gently rolling desert land.

Asc. 60 ft. over rolling NE. slope.

1.15 Road, unimproved, bears N. 30° W., and S. 15° E.

1.90 Irrigation ditch, 10 lks. wide, 3 ft. deep, drains S. 20° E.

21.50 Fence, bears S. 20° E. and N. 40° E., curving north.

29.70 Wash, 10 lks. wide, 5 ft. deep, drains N. 15° W.

37.20 Wash, 15 lks. wide, 5 ft. deep, drains irregularly north.

40.82 The $\frac{1}{4}$ sec. cor. of secs. 20 and 29, monumented with a sandstone, 4x8x12 ins., set. mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R7E

$\frac{1}{4}$ S20

S29

1962

bury original stone cor. alongside iron post.

S. 89° 28' W., beginning new measurement.

Asc. 25 ft. over gently rolling NE. slope.

9.00 Enter scattered timber, bears north and south.

15.45 Wash, 30 lks. wide, 15 ft. deep, drains irregularly north.

25.95 Wash, 40 lks. wide, 10 ft. deep, drains north.

40.60 The cor. of secs. 19, 20, 29 and 30.

Land, gently rolling desert.

Soil, clay.

Timber, scattered pinon and juniper west portion

Undergrowth, shadscale.

From the cor. of secs. 16, 17, 20 and 21.

S. 89° 13' W., bet. secs. 17 and 20.

Over level farm land, along gravel road.

40.12 Point for the $\frac{1}{4}$ sec. cor. of secs. 17 and 20 at center of roadway and in line with property line fence to south; and is accepted as the best evidence of the position of the original cor.

At the cor. point,

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 26 ins. in

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R.

CHAINS

the ground, with brass cap mkd.

T20S R7E

 $\frac{1}{4}$ S17

S20

1962

deposit glass around iron post, 3 ins. below ground.

S. 89° 39' W., beginning new measurement.

Continue over level farm land along gravel road.

10.50 End of road.

10.80 Irrigation canal, 30 lks. wide, 4 ft. deep, flows south, enter desert land.

18.49 Fence, bears north, south and west, thence along fence line.

37.80 Wash, 20 lks. wide, 8 ft. deep, drains N. 80° E.

40.14 The cor. of secs. 17, 18, 19 and 20, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1921 survey.

Land, level farm on 50.00 chs., desert on 30.00 chs.
Soil, clay.

No timber.

Undergrowth, shadscale in desert portion.

From the true cor. point of secs. 8, 9, 16 and 17.

S. 89° 46' W., bet. secs. 8 and 17.

Over level farm land, along gravel road.

1.05 Ferron Creek, 30 lks. wide, 2 ft. deep, flows SE.

2.35 Intersection with north and south road.

17.00 House, bears south, 50 lks. dist.

21.50 Irrigation canal, 20 lks. wide, 10 ft. deep, flows south.

38.60 House, bears south, 50 lks. dist.

41.10 Point for the $\frac{1}{4}$ sec. cor. of secs. 8 and 17, in center line of gravel road, and in line with property line fences to north and south; and is accepted as the best evidence of the position of the original cor.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 3 ins. below ground, with brass cap mkd.

T20S R7E

 $\frac{1}{4}$ S8

S17

1962

from which

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R. 7 E.

CHAINS

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 22 ins. in the ground, with glass deposited around iron post, 3 ins. below ground, for a reference monument, bears N. $3^{\circ}17'$ E., 35 ft. dist., with brass cap mkd. T20S R7E S8 RM 35' 1962, and an arrow pointing to the true cor.

An iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., set 22 ins. in the ground, with glass deposited around iron post, 3 ins. below ground, for a reference monument, bears S. $7^{\circ}11'$ W., 29.7 ft. dist., with brass cap mkd. T20S R7E S17 RM 29.7' 1962, and an arrow pointing to the true cor.

S. $89^{\circ}46'$ W., beginning new measurement.

Continue over level farm land, along gravel road.

- 12.40 Road, bears N.
- 12.90 Irrigation ditch, 20 lks. wide, 2 ft. deep, drains N.
- 13.28 Fence, bears N. and S., leave farm land.
- 15.15 Irrigation canal, 20 lks. wide, 3 ft. deep, flows SW.; asc. 160 ft. over E. slope.
- 36.15 Spur, slopes north; desc. 60 ft. over SW. slope.
- 41.10 The cor. of secs. 7, 8, 17 and 18, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1921 survey.

Land, level farm land, east portion; rolling desert, west portion.
Soil, clay.
No timber.
Undergrowth, shadscale, west portion.

N. $0^{\circ}01'$ W., bet. secs. 7 and 8.

Over gently rolling land.

Asc. 55 ft. over SW. slope.

- 2.25 Spur, slopes E.; desc. 95 ft. over N. slope.
- 18.55 Irrigation canal, 30 lks. wide, 3 ft. deep, flows E.; desc. 60 ft. over gentle N. slope.
- 21.81 Telephone line, bears N. 70° W. and S. 70° E.
- 22.84 Fence, bears N. 70° W. and S. 70° E.
- 23.75 Road, graded gravel, bears N. 70° W. and S. 70° E.
- 31.65 Fence, bears east, west and north, thence along fence line.

Dependent Resurvey of a Portion of the Subdivision of T. 20 S., R.

CHAINS	
32.30	Ferron Creek, 80 lks. wide, $1\frac{1}{2}$ ft. deep, flows irregularly E.
39.45	Fence, bears E. and W.
40.54	Point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 8, at cor. of property line fences bearing north, south and east, and is accepted as the best evidence of the position of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T20S R7E $\frac{1}{4}$ S7 S8 1962 deposit glass around iron post, 3 ins. below ground. N. $0^{\circ}01'$ W., beginning new measurement. <hr/> Over level farm land.
19.65	Fence, bears E. and W., end of N. and S. fence.
19.90	Road, unimproved, bears E. and W.
20.10	Irrigation ditch, drains E.
28.50	Irrigation canal, 15 lks. wide, 10 ft. deep, flows E.
28.70	Irrigation ditch, drains E., leave farm land; asc. 95 ft. over S. slope.
32.20	Ridge, bears E. and W.; desc. 95 ft. over N. slope.
39.79	The cor. of secs. 5, 6, 7 and 8, monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1921 survey. Land, rolling desert, south portion; level farm land, north portion. Soil, clay. No timber Undergrowth, shadscale south portion.

General Description

The central portion of Township 20 South, Range 7 East is level farm land, the west tier of secs. is mountainous land, with scattered pinon and juniper timber. The remainder of the township is rolling desert land, covered with shadscale undergrowth. The town of Ferron is located in secs. 9, 10, 15 and 16. The area is drained in an easterly direction by numerous washes draining into Ferron Creek that flows in an easterly direction through secs. 7, 8, 9, 16, 15, 14 and 13. State Highway No. 10 enters the township in sec. 33, and bears northerly through sec. 33 and along the sec. line bet. secs. 27 and 28, 21 and 22, 15 and 16, 9 and 10, thence bears northeast through sec. 3. There are numerous unimproved roads throughout the township. No springs or other sources of water, other than Ferron Creek, were noted in the township.

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FIELD ASSISTANTS

[illegible]

CERTIFICATE OF SURVEY

X We, Glen B. Hatch and Allen L. Tuft, HEREBY CERTIFY upon honor that,

in pursuance of special instructions bearing date of the **29** day of **June**, 19**62**,
We

have dependently resurveyed the South boundary (Fourth Standard Parallel South), the East boundary, the North boundary and a portion of the subdivisional lines of Township 20 South, Range 7 East

of the **Salt Lake** Meridian, in the State of **Utah**, which
us our
are represented in the foregoing field notes as having been executed by ~~xxxx~~ and under ~~xxx~~ direction;
and that said survey has been made in strict conformity with said special instructions, the Manual
of Instructions for the Survey of the Public Lands of the United States, and in specific manner
described in the foregoing field notes.

Salt Lake City, Utah
(Date)

December 11, 1962
(Date)

Allen L. Tuft
(Cadastral Surveyor) **Allen L. Tuft**

Glen B. Hatch
(Cadastral Surveyor) **Glen B. Hatch**

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date DEC 9 1964

BUREAU OF LAND MANAGEMENT,
Washington, D. C.

The foregoing field notes of the dependent resurvey of the South boundary (Fourth Standard Parallel South), the East boundary, the North boundary, and a portion of the subdivisional lines of Township 20 South, Range 7 East

executed by **Allen L. Tuft, Glen B. Hatch, Cadastral Surveyors**

having been critically examined and found correct, are hereby approved.

JUN 21 1965

(Date)

EE Livingston
(Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

~~I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in
is a true copy of the original field notes.~~

(Date)

(Chief, Division of Engineering)

Blank

Page

Blank

Page

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

245

FIELD NOTES

OF THE

DEPENDENT RESURVEY

OF

THE SOUTH BOUNDARY (FOURTH STANDARD PARALLEL SOUTH),

THE EAST BOUNDARY

THE NORTH BOUNDARY

AND

THE SUBDIVISIONAL LINES

OF

TOWNSHIP 20 SOUTH, RANGE 8 EAST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

GLEN B. HATCH, Cadastral Surveyor

Under special instructions dated June 29, 19 62, which provided for the surveys

included under Group Number 458, approved June 29, 1962,

and assignment instructions dated June 29, 19 62.

Survey commenced August 22, 19 62

Survey completed October 12, 19 62

DEPT. OF THE INTERIOR
BUR OF LAND MGMT

1965 JUL 19 AM 10 00

RECEIVED
STATE & LAND OFFICE
SALT LAKE CITY, UTAH

INDEX DIAGRAM

Township 20 SOUTH, Range 8 EAST,

23	22	21	20	19	17	
6	82 8	69 4	59 8	47 2	35 1	16
81	81	68	58	46	34	
7	80 8	67 9	56 10	45 11	33 12	15
79	78	66	55	44	32	
18	77 17	65 16	54 15	43 14	31 13	13
76	75	64	53	42	30	
19	74 20	63 21	52 22	41 23	28 24	12
74	73	62	51	40	28	
30	72 29	61 28	50 27	39 26	26 25	11
71	71	61	49	38	25	
31	70 32	59 33	48 34	36 35	24 36	9
8	7	6	5	4	2	

Dependent Resurvey of the South Boundary (Fourth Standard Parallel South), of Township 20 South, Range 8 East

CHAINS

In 1873, A. D. Ferron surveyed the west 1 mile of the south boundary (Fourth Standard Parallel South), the west boundary (Second Guide Meridian East), the west $3\frac{1}{2}$ miles of the north boundary and the west portion of the subdivision. In 1882, A. D. Ferron, surveyed the east 5 miles of the south boundary (Fourth Standard Parallel South), the east boundary, the east $2\frac{1}{2}$ miles of the north boundary and the east portion of the subdivision, and resurveyed the west 1 mile of the south boundary, the west boundary (Second Guide Meridian East), the west $3\frac{1}{2}$ miles of the north boundary and the subdivisional lines between the 1873 and 1882 surveys.

The west 1 mile of the south boundary was resurveyed by Andrew Nelson and Howard W. Miller in 1910, who also retraced the east 5 miles of the south boundary that same year.

The east boundary was resurveyed in 1918 by Howard W. Miller and Walter Byergo.

The west boundary (Second Guide Meridian East) was resurveyed by Allen L. Tuft, in 1962, concurrently with this survey.

The following field notes are those of the dependent resurvey of the south boundary (Fourth Standard Parallel South), the east boundary, the north boundary and the subdivisional lines of Township 20 South, Range 8 East.

Before restoring the corners, the lines of the original survey were retraced and a diligent search made for any evidence of the lost corner or other calls of the original field note record.

The rules of proportionate measurement were applied to ascertain the position of the lost corner after exhausting every reasonable possibility of finding direct evidence of the lost corner.

The survey was executed with a W. & L.E. Gurley Solar Transit No. 570621 constructed in accordance with the standard instrumental specifications of the Bureau of Land Management. The instrument was in good condition prior to the beginning of the survey and was maintained in proper adjustment throughout the progress of this survey.

Corners on east-west lines were set on the true latitudinal curve. Lines connecting previously established corners were run by random and true method, but for simplification of the record the random lines are omitted from the field notes.

Measurements herein contained were made with a narrow steel tape, 8 chains in length, graduated every link for the first 100 links and thereafter at intervals of 10 links. The tape was tested by comparison with a one chain standard steel tape and found to be correct. Measurements were made on the slope with the vertical angle of each interval ascertained by a clinometer in good adjustment horizontal equivalents alone are entered in the field notes. All lines of this survey were run by direct method where the lines were accessible; lines inaccessible were run by traverse or triangulation methods. Distances to topography on lines run by traverse or triangulation are approximately as scaled from U.S.G.S. topographic sheets. The details of such traverses or triangulations have been thoroughly checked and verified, and in order to simplify the record, the diagrams and reductions are omitted from these field notes.

Dependent Resurvey of the South Boundary (Fourth Standard Parallel South), of Township 20 South, Range 8 East

CHAINS

The direction of the lines of this survey were determined by reference to true meridians established on line by altitude observations on the sun. The lines were carried forward by sustained angulation being supplemented by other numerous altitude observations on the sun taken throughout the progress of the survey.

The geographic position for the southeast corner of the township is at latitude $39^{\circ}01'51.8''$ N. and longitude $110^{\circ}57'49.2''$ W. as adjusted from traverses to U.S.G.S. triangulation station "Ferron," at latitude $39^{\circ}01'00.343''$ N. and longitude $110^{\circ}59'26.179''$ W., located S. $3^{\circ}20'44''$ W., 79.13 chs. dist. from the south $\frac{1}{4}$ sec. cor. of sec. 35, T. 20 S., R. 8 E.

The magnetic declination was read at a number of stations throughout the township and the average of these readings was found to be 17° East.

Dependent Resurvey of the South Boundary (Fourth Standard Parallel South), Township 20 South, Range 8 East

Reestablishment of the Survey Executed by A. D. Ferron, in 1882, and the Retracement of Andrew Nelson and Howard W. Miller, in 1910, with the establishment of north $\frac{1}{4}$ sec. corners of sections 1 to 6 inclusive, Township 21 South, Range 8 East.

Beginning at the cor. of Tp. 20 S., Rs. 8 and 9 E., monumented with a sandstone, $6 \times 10 \times 40$ ins., firmly set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 5 ins. in the ground to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

SC
T20S
R8E R9E
S36 | S31
S6
T21S R9E
1962

Bury original stone cor. alongside iron post.

S. $89^{\circ}57'$ W., along the south boundary of sec. 36.

Over rolling desert land.

- 0.10 Wash, 15 lks. wide, 1 ft. deep, drains NW.; asc. 15 ft. over NE. slope.
- 2.70 Top of ascent, slopes NW.; desc. 10 ft. over gentle NW. slope.
- 5.52 The closing cor. of Tp. 21 S., Rs. 8 and 9 E., monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 survey of T. 21 S., R. 8 E.
- Desc. 70 ft. over NW. slope.

Dependent Resurvey of the South Boundary (Fourth Standard
Parallel South) of Township 20 South, Range 8 East

CHAINS

- 17.10 Wash, 30 lks. wide, 1 ft. deep, drains irregularly N.;
asc. 100 ft. over steep east slope.
- 21.10 Top of red spur, slopes S.; desc. 115 ft. over steep W.
slope.
- 24.20 Wash, drains N.; asc. 85 ft. over E. slope.
- 29.10 Spur, slopes S.; desc. 50 ft. over SW. slope.
- 40.02 The standard $\frac{1}{4}$ sec. cor. of sec. 36, monumented with a
sandstone, 6x10x40 ins., set, mkd. and witnessed as de-
scribed in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 5 ins. in
the ground, to bedrock, and in a mound of stone, 6 ft.
base to top, with brass cap mkd.

SC
T20S R8E
 $\frac{1}{4}$ S36
1962

bury original stone cor., in mound of stone, alongside
iron post.

N. $89^{\circ}46'$ W., beginning new measurement.

Desc. 15 ft. over W. slope.

- 4.30 Wash, 30 lks. wide, 3 ft. deep, drains N.; asc. 15 ft.
over E. slope.
- 5.56 Point for the N. $\frac{1}{4}$ sec. cor. of sec. 1, T. 21 S., R. 8 E.
at midpoint between closing corners.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, and in a collar of stone to top, with
brass cap mkd.

$\frac{1}{4}$ S1
T21S R8E
1962

Asc. 15 ft. over E. slope.

- 7.20 Small spur, slopes N.; desc. 20 ft. over W. slope.
- 7.65 Wash, 40 lks. wide, 8 ft. deep, drains irregularly N.
from SW.; asc. 30 ft. over gentle SE. slope.
- 13.60 Spur, slopes NE.; desc. 50 ft. over gently rolling NW.
slope.
- 37.65 Small spur, slopes N.; desc. 5 ft. over W. slope.
- 40.32 The standard cor. of secs. 35 and 36, monumented with a
3 in. iron post, set, mkd. and witnessed as described in
the official record of the 1910 retracement.

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South), Township 20 South, Range 8 East

CHAINS	<p>Land, rolling desert mountains. Soil, sandy, rocky. No timber. Undergrowth, shadscale.</p>
	<p>N. 89°55' W., along the S. bdy. of sec. 35. Over mountainous land. Desc. 20 ft. over W. slope.</p>
3.20	<p>Wash, 50 lks. wide, 2 ft. deep, drains N. 15° E.; asc. 5 ft. over E. slope.</p>
5.30	<p>The closing cor. of secs. 1 and 2, T. 21 S., R. 8 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 survey. Asc. abruptly 20 ft. over sandstone ledge.</p>
5.45	<p>Top of ledge, bears N. and S.; desc. 20 ft. over gentle W. slope.</p>
14.35	<p>Wash, drains N. asc. 30 ft. over E. slope.</p>
21.55	<p>Small spur, slopes S.; desc. 20 ft. along S. slope.</p>
23.30	<p>Small wash, drains S.; asc. 140 ft. over rocky, steep SE. slope.</p>
32.35	<p>Wash, 5 lks. wide, 1 ft. deep, drains SE. continue ascent.</p>
40.33	<p>The standard $\frac{1}{4}$ sec. cor. of sec. 35, monumented with a sandstone, 5x12x24 ins., set, mkd. and witnessed as described in the official record. At the cor. point Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.</p>
	<p style="text-align: center;">SC T20S R8E <u>$\frac{1}{4}$ S35</u> 1962</p> <p>bury original stone cor. alongside iron post. From this cor., U.S.C. & G.S. triangulation station "Feron," bears S. 3°20'44" W., 79.13 chs. dist.</p>
	<p>N. 89°58' W., beginning new measurement. Asc. 130 ft. over steep, rocky SE. slope.</p>
4.95	<p>Point for the N. $\frac{1}{4}$ sec. cor. of sec. 2, T. 21 S., R. 8 E. at midpoint between closing corners. Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 6 ins. in the ground, to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p>

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South), Township 20 South, Range 8 East

CHAINS		
	<p style="text-align: center;"> $\frac{1}{2}$ S2 T21S R8E 1962 </p> <p>Asc. abruptly 15 ft. over sandstone ledge.</p> <p>5.45 Top of ledge, spur, slopes NE.; thence by triangulation; desc. about 100 ft. over broken NW. slope.</p> <p>18.25 Draw, drains N.; asc. about 50 ft. over NE. slope.</p> <p>24.25 Spur, slopes N. desc. about 40 ft. over W. slope.</p> <p>29.25 Draw, drains N.; asc. about 75 ft. over E. slope.</p> <p>32.45 Ridge, bears N. and S.; end triangulation; desc. 90 ft. over W. slope.</p> <p>40.24 The standard cor. of secs. 34 and 35, monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 retracement.</p> <p>Land, mountainous, broken. Soil, rocky sand east portion; rocky clay west portion No timber. Undergrowth, shadscale.</p>	
	<p>N. 89°52' W., along the south bdy. of sec. 34.</p> <p>Over mountainous land.</p> <p>Desc. 20 ft. over W. slope.</p> <p>1.90 Base of descent, bears S. and NE.; thence over level land; enter dense greasewood.</p> <p>4.69 The closing cor. of secs. 2 and 3, T. 21 S., R. 8 E., monumented with a 2 in. iron post, loosely set, mkd. and witnessed as described in the official record of the 1910 survey.</p> <p>Rebuild a mound of stone, 3 ft. base, 2 ft. high, around iron post.</p> <p>14.80 Wash, 50 lks. wide, 10 ft. deep, drains irregularly NE.; asc. 90 ft. over rocky E. slope; leave greasewood.</p> <p>19.35 Ridge, bears N. and S.; desc. 85 ft. over SW. slope.</p> <p>31.15 Wash, 50 lks. wide, 5 ft. deep, drains S. 20° E.; asc. 40 ft. over NE. slope.</p> <p>38.95 Spur, slopes N.; desc. 10 ft. over W. slope.</p> <p>40.54 The standard $\frac{1}{2}$ sec. cor. of sec. 34, monumented with a sandstone, 5x12x17 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 6 ins. in the ground, to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.</p>	

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South), Township 20 South, Range 8 East

CHAINS	<div data-bbox="596 165 711 276"> SC T20S R8E <u>½ S34</u> 1962 </div> <div data-bbox="292 298 918 342">bury original stone cor. alongside iron post.</div> <div data-bbox="292 409 849 453">S. 89°54' W., beginning new measurement.</div> <div data-bbox="195 464 1079 530">4.18 Point for the N. ½ sec. cor. of sec. 3, T. 21 S., R. 8 E. at midpoint between closing corners.</div> <div data-bbox="292 541 1044 608">Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</div> <div data-bbox="562 652 683 752"> <u>½ S3</u> T21S R8E 1962 </div> <div data-bbox="287 763 637 807">No accessories available.</div> <div data-bbox="189 818 1067 884">5.75 Wash, 40 lks. wide, 6 ft. deep, drains NE.; asc. 120 ft. over steep E. slope.</div> <div data-bbox="177 895 929 940">10.45 Spur, slopes S.; desc. 120 ft. over SW. slope.</div> <div data-bbox="177 951 1056 1017">16.65 Wash, 30 lks. wide, 4 ft. deep, drains SE.; asc. 85 ft. over NE. slope.</div> <div data-bbox="177 1028 912 1072">24.30 Spur, slopes S.; desc. 45 ft. over NW. slope.</div> <div data-bbox="177 1083 1038 1150">33.25 Wash, 40 lks. wide, 8 ft. deep, drains S.; asc. 30 ft. over SE. slope.</div> <div data-bbox="177 1161 1038 1205">37.95 Top of ascent, slopes NW.; desc. 5 ft. over NW. slope.</div> <div data-bbox="177 1216 1067 1327">40.18 The standard cor. of secs. 33 and 34, monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 retracement.</div> <div data-bbox="281 1338 815 1470"> Land, mountainous. Soil, rocky, sandy clay. No timber. Undergrowth, shadscale and greasewood. </div> <div data-bbox="281 1537 878 1581">N. 88°55' W., along the S. bdy. of sec. 33.</div> <div data-bbox="281 1592 728 1636">Over gently rolling desert land.</div> <div data-bbox="281 1647 671 1692">Desc. 15 ft. over NW. slope.</div> <div data-bbox="177 1703 1061 1824">4.03 The closing cor. of secs. 3 and 4, T. 21 S., R. 8 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 survey.</div> <div data-bbox="275 1835 792 1891">Thence over nearly level desert land.</div> <div data-bbox="177 1891 906 1946">9.50 Road, unimproved, bears irregularly N. and S.</div> <div data-bbox="166 1946 849 2001">30.20 Wash, 10 lks. wide, 2 ft. deep, drains S.</div> <div data-bbox="166 2001 1033 2112">40.71 The standard ½ sec. cor. of sec. 33, monumented with a sandstone, 4x6x12 ins., set, mkd. and witnessed as described in the official record.</div>
--------	--

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South), Township 20 South, Range 8 East

CHAINS	
	<p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">SC T20S R8E <u>½ S33</u> 1962</p> <p>bury original stone cor. alongside iron post, and deposit glass around iron post, 3 ins. below ground.</p> <p style="text-align: center;">_____</p> <p>S. 89°16' W., beginning new measurement.</p> <p>Continue over nearly level land.</p>
3.36	<p>Point for the N. ¼ sec. cor. of sec. 4, T. 21 S., R. 8 E., at midpoint between closing corners.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;"><u>¼ S4</u> T21S R8E 1962</p> <p>No accessories available.</p>
40.30	<p>The standard cor. of secs. 32 and 33, monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 retracement.</p> <p>Land, nearly level desert. Soil, sandy clay. No timber. Undergrowth, shadscale.</p>
	<p>S. 88°01' W., along the S. bdy. of sec. 32.</p> <p>Over nearly level desert land, through medium greasewood.</p>
2.89	Fence, bears N., and S. about 1.50 chs., thence W.
3.10	The closing cor. of secs. 4 and 5, T. 21 S., R. 8 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 survey.
14.93	Fence, bears N. 85° W. and S. 85° E.
16.50	Wash, 35 lks. wide, 7 ft. deep, drains S. 70° E.
27.83	Fence, bears N. and S.
30.90	Leave level land, bears N. and S.; asc. 90 ft. over E. slope.
37.40	Spur, slopes S.; desc. 10 ft. over W. slope.
40.38	The standard ¼ sec. cor. of sec. 32, monumented with a sandstone, 5x14x20 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South), Township 20 South, Range 8 East

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

SC
T20S R8E
 $\frac{1}{4}$ S32
1962

bury original stone cor. alongside iron post.

S. $87^{\circ}50'$ W., beginning new measurement.

Asc. 15 ft. over SE. slope.

2.70 Point for the N. $\frac{1}{4}$ sec. cor. of sec. 5, T. 21 S., R. 8 E. at midpoint between closing corners.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

$\frac{1}{4}$ S5
T21S R8E
1962

Asc. 40 ft. over SE. slope.

9.40 Base of ledge, bears NE. and SW.; asc. abruptly 50 ft. over shale and sandstone ledge.

9.95 Top of ledge; asc. 30 ft. over SE. slope.

15.65 Base of sandstone ledge, bears NE. and SW.; asc. abruptly 15 ft. over ledge.

15.70 Top of ledge, mesa, bears NE. and SW.; desc. 60 ft. over gentle NW. slope, enter scattered juniper timber.

40.46 The standard cor. of secs. 31 and 32, monumented with a 3 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 retracement.

Land, nearly level desert, east portion; mountainous, west portion.

Soil, rocky sandy clay, exposed sandstone, west portion. Timber, scattered juniper, west portion; no timber, east portion.

Undergrowth, shadscale and greasewood.

Reestablishment of the Resurvey Executed by Andrew Nelson and Howard W. Miller in 1910.

S. $85^{\circ}51'$ W., along the south boundary of sec. 31.

Over gently rolling desert land, through scattered juniper timber.

Desc. 5 ft. over NW. slope.

2.22 The closing cor. of secs. 5 and 6, T. 21 S., R. 8 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1910 survey.

Dependent Resurvey of the South Boundary, (Fourth Standard Parallel South), Township 20 South, Range 8 East

CHAINS	
	Desc. 50 ft. over gently rolling NW. slope.
13.10	Leave timber, bears NE. and SW.
39.92	The standard $\frac{1}{4}$ sec. cor. of sec. 31, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of 1910 resurvey.
42.34	Point for the N. $\frac{1}{4}$ sec. cor. of sec. 6, T. 21 S., R. 8 E., at proportionate dist. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. <div style="text-align: center;">$\frac{1}{4}$ S6 T21S R8E 1962</div> No accessories available. Thence along gentle north slope.
61.45	Wash, 15 lks. wide, 6 ft. deep, drains irregularly N.; asc. 40 ft. over gentle NE. slope.
79.84	The standard cor. of Tps. 20 and 21 S., Rs. 7 and 8 E., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the S. bdy. of T. 20 S., R. 7 E. Land, gently rolling desert. Soil, clay. Timber, scattered juniper E. portion; no timber west portion. Undergrowth, shadscale.
Dependent Resurvey of the East Boundary of Township 20 South, Range 8 East	
Reestablishment of the Survey Executed by A. D. Ferron in 1882 and the Resurvey Executed by Howard W. Miller and Walter Byergo in 1918.	
From the standard cor. of Tp. 20 S., Rs. 8 and 9 E., hereinbefore described. N. $0^{\circ}03'$ E., along the east boundary of sec. 36. Over gently rolling desert land.	
14.05	Wash, 30 lks. wide, 2 ft. deep, drains N. 60° W.
19.90	Wash, 10 lks. wide, 2 ft. deep, drains NW.
21.35	Wash, 20 lks. wide, 6 ft. deep, drains irregularly N.
21.90	Same wash, drains N.
25.00	Leave wash, drains NE.
34.00	Road, improved dirt, bears irregularly E. and W.

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS

39.88

The west $\frac{1}{4}$ sec. cor. of sec. 31, T. 20 S., R. 9 E., monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

From this cor., a 1 in. iron post, 10 ins. above ground, bears east, 0.02 chs. dist., with brass cap mkd.

420G

SID AND CHARLIE
EROSION CONTROL
SW SW SEC. 31
T20S R9E
1958

40.40

Point for the E. $\frac{1}{4}$ sec. cor. of sec. 36, at record dist. of the 1918 survey from the W. $\frac{1}{4}$ sec. cor. of sec. 31, T. 20 S., R. 9 E. The original stone cor., a sandstone, 6x8x12 ins., was lying loose upon the ground.

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S
R8E R9E
 $\frac{1}{4}$
S36
1962

bury original stone cor. alongside iron post.

N. 0°02' E., beginning new measurement.

Asc. 75 ft. over SE. slope.

15.20

Spur, slopes E.; desc. 55 ft. over N. slope.

21.40

Wash, 10 lks. wide, 1 ft. deep, drains E.; asc. 35 ft. over SE. slope.

28.50

Spur, slopes E.; desc. 20 ft. over N. slope.

31.05

Wash, 10 lks. wide, 1 ft. deep, drains E.; asc. 25 ft. over S. slope.

36.50

Spur, slopes E.; desc. 5 ft. over gentle N. slope.

38.75

Wash, 10 lks. wide, 1 ft. deep, drains E.; asc. 10 ft. over S. slope.

39.25

Road, unimproved, bears irregularly E. and W.

39.37

The closing cor. of secs. 30 and 31, T. 20 S., R. 9 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

Desc. 10 ft. over N. slope.

39.85

Wash, 10 lks. wide, 1 ft. deep, drains SE.; asc. 5 ft. over SE. slope.

40.27

The cor. of secs. 25 and 36, monumented with a sandstone, 3x8x15 ins., set, mkd. and witnessed as described in the official record of the 1882 survey.

At the cor. point

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S
R8E R9E

S25
— S36 — S30
1962

bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, sandy clay.

No timber.

Undergrowth, shadscale and greasewood.

N. $0^{\circ}03'$ W., along the east boundary of sec. 25.

Over rolling desert land.

Asc. 45 ft. over SE. slope.

6.65 Top of ascent, bears NE. and SW.; desc. 30 ft. over NW. slope.

12.90 Wash, 10 lks. wide, 1 ft. deep, drains irregularly E.; asc. 15 ft. over SE. slope.

15.60 Small spur, slopes E.; desc. 20 ft. over NE. slope.

16.40 Wash, 15 lks. wide, 3 ft. deep, drains irregularly E.

21.40 Wash, 10 lks. wide, 1 ft. deep, drains E.

27.40 Wash, 30 lks. wide, 3 ft. deep, drains NE.; asc. 60 ft. over SE. slope.

39.27 The W. $\frac{1}{4}$ sec. cor. of sec. 30, T. 20 S., R. 9 E., monumented a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

Desc. 10 ft. over NE. slope.

40.39 The E. $\frac{1}{4}$ sec. cor. of sec. 25, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

N. $0^{\circ}06'$ W., beginning new measurement.

Desc. 5 ft. over NE. slope.

0.50 Wash, drains SE.; asc. 20 ft. over SW. slope.

3.10 Ridge, bears NE. and SW.; desc. 30 ft. over NW. slope.

18.70 Wash, 50 lks. wide, 6 ft. deep, drains W.; asc. 20 ft. over SW. slope.

22.90 Spur, slopes SW., from irregularly N.; desc. 15 ft. over NE. slope.

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS

26.40 Wash, 10 lks. wide, 2 ft. deep, drains S. 80° E.; asc. 45 ft. over S. slope., enter scattered large boulders.

36.20 Rocky ridge, bears E. and W.; desc. 20 ft. over gentle N. slope.

38.69 The closing cor. of secs. 19 and 30, T. 20 S., R. 9 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

40.27 The cor. of secs. 24 and 25, monumented with a sandstone, 8x14x27 ins., set, mkd. and witnessed as described in the official record of the 1882 survey.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S
R8E R9E
S24 | S19
S25 |
1962

bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, rolling desert.

Soil, rocky clay.

No timber.

Undergrowth, sparse shadscale.

N. 0°02' E., along the east boundary of sec. 24.

Over gently rolling desert land.

0.50 Wash, 10 lks. wide, 1 ft. deep, drains irregularly S.

1.20 Same wash.

3.60 Same wash, from NE.; asc. 20 ft. over SE. slope.

6.30 Top of ascent, bears NE. and SW., thence over nearly level land.

26.60 Road, unimproved, bears NE. and SW.

38.45 The W. ¼ sec. cor. of sec. 19, T. 20 S., R. 9 E., monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

40.56 The E. ¼ sec. cor. of sec. 24, monumented with a sandstone, 6x10x24 ins., set, mkd. and witnessed as described in the official record of the 1882 survey.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S
R8E R9E
S24 |
S25 |
1962

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS

bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, west of cor.

N. 0°01' W., beginning new measurement.

Continue over gently rolling desert land.

9.40 Low spur, slopes E.

11.05 Wash, 15 lks. wide, 1 ft. deep, drains SW. from N.

16.70 Leave wash, drains S., from NE.

24.70 Wash, 10 lks. wide, 5 ft. deep, drains W.

27.90 E. side of small knoll; desc. 10 ft. over gentle NE. slope.

33.90 Point of spur, slopes NW. from SE.; desc. 30 ft. over NE. slope.

36.80 Wash, 20 lks. wide, 1 ft. deep, drains NW.; asc. 10 ft. along E. slope.

37.86 The closing cor. of secs. 18 and 19, T. 20 S., R. 9 E., monumented with a 2 in iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

This cor. is located on fence line, bears S. 80° W. and E.

40.28 The cor. of secs. 13 and 24, monumented with a sandstone, 4x14x22 ins., set, mkd. and witnessed as described in the official record of the 1882 survey.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T20S
R8E R9E
S13 S18
S24
1962

bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, sandy clay.

No timber.

Undergrowth, shadscale.

N. 0°10' W., along the E. bdy. of sec. 13.

Over rolling desert land.

Asc. 30 ft. over SE. slope.

18.75 Spur, slopes E.; desc. 25 ft. over NE. slope.

21.05 Draw, drains NW.

260

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS	
26.80	Same draw, drains SE.; asc. 25 ft. over SE. slope.
28.75	Spur, slopes E.; desc. 40 ft. over N. slope.
36.95	Draw, drains E.; asc. 10 ft. over SW. slope.
37.65	The W. $\frac{1}{2}$ sec. cor. of sec. 18, T. 20 S., R. 9 E., monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey. Asc. 10 ft. over SW. slope.
38.65	Spur, slopes W.; desc. 30 ft. over NE. slope.
40.00	Small wash, drains NW.; asc. 5 ft. over SW. slope.
40.68	The E. $\frac{1}{2}$ sec. cor. of sec. 13, monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey. <hr/> N. 0°19' W., beginning new measurement. Asc. 15 ft. over SW. slope.
3.00	Top of ascent, slopes W.; desc. 30 ft. over NW. slope.
13.60	Small draw, drains NW.; asc. 20 ft. over SW. slope.
16.60	Spur, slopes W.; desc. 55 ft. over NE. slope.
31.60	Draw, drains NE.; asc. 20 ft. over SE. slope.
36.60	Spur, slopes E.; desc. 20 ft. over N. slope.
37.02	The closing cor. of secs. 7 and 18, T. 20 S., R. 9 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey. Desc. 20 ft. over N. slope.
40.68	The cor. of secs. 12 and 13, monumented with a sandstone, 2x12x24 ins., set, mkd. and witnessed as described in the official record of the 1882 survey. At the cor. point Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd. T20S R8E R9E <u>S12</u> S7 S13 1962 bury original stone cor. alongside iron post. Land, rolling desert. Soil, rocky, sandy clay. No timber. Undergrowth, shadscale.

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS

N. 0°04' E., along the E. bdy. of sec. 12.

Over mountainous land.

Desc. 15 ft. over N. slope.

2.10 Wash, 100 lks. wide, 2 ft. deep, with unimproved road in bottom, drains irregularly E.; asc. 65 ft. over S. slope.

15.60 Ridge, bears E. and W.; desc. 35 ft. over NE. slope.

19.30 Draw, drains SE.; asc. 55 ft. over SW. slope.

21.70 Spur, slopes SE.; desc. 50 ft. over rocky NE. slope.

24.30 Head of draw, drains E.; asc. 145 ft. over rocky SE. slope.

29.50 Ledy point, bears SE. and NW.; desc. 80 ft. over NE. slope.

35.00 Head of rocky draw, drains SE. asc. 20 ft. along rocky E. slope.

36.32 The W. $\frac{1}{4}$ sec. cor. of sec. 7, T. 20 S., R. 9 E., monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey.

Asc. abruptly over sandstone ledge.

37.40 Top of ledge, 15 ft. high, bears NE. and SW.; desc. 20 ft. over gentle NW. slope.

40.02 The E. $\frac{1}{4}$ sec. cor. of sec. 12, monumented with a sandstone, 6x8x12 ins., set, mkd. and witnessed as described in the official record, of the 1882 survey.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 3 ins. in the ground to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T20S
R8E R9E
 $\frac{1}{4}$
S12|
1962

bury original stone cor. alongside iron post.

N. 0°05' W., beginning new measurement.

Continue over mountainous land.

Desc. 20 ft. over NW. slope.

1.10 Draw, drains NW.; asc. 15 ft. over SW. slope.

2.50 Ridge, bears NW. and SE.; desc. 20 ft. over NE. slope.

6.00 Head of draw, drains NE.; asc. 45 ft. over SE. slope.

14.80 Spur, slopes E. desc. 60 ft. over NE. slope.

17.00 Head of draw, drains E.; asc. 100 ft. over SE. slope.

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS

25.30	Ridge, bears NE. and SW.; desc. 35 ft. over NW. slope.
29.00	Draw, drains NW. asc. 45 ft. over SW. slope.
32.80	Spur, slopes W.; desc. 120 ft. over N. slope.
36.27	The closing cor. of secs. 6 and 7, T. 20 S., R. 9 E., monumented with a 2 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey. Desc. 10 ft. over N. slope.
38.10	Small draw, drains NE.; asc. 20 ft. over SE. slope.
40.00	The cor. of secs. 1 and 12, monumented with a sandstone, 3x10x12 ins., set, mkd. and witnessed as described in the official record of the 1882 survey. At the cor. point Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone 3 ft. base to top, with brass cap mkd. <div style="text-align: center;"> T20S R8E R9E <u>S1</u> S6 S12 1962 </div> bury original stone cor. alongside iron post. Land, mountainous desert. Soil, rocky clay, with exposed sandstone. No timber. Undergrowth, shadscale.
	N. 0°02' W., along the E. bdy. of sec. 1. Over rolling mountainous land. Asc. 10 ft. over SE. slope.
1.50	Low spur, slopes NE.; desc. 40 ft. over gentle NW. slope.
17.40	Wash, 30 lks. wide, 3 ft. deep, drains SE.; asc. 25 ft. over S. slope.
27.60	Ridge, bears E. and W.; desc. 35 ft. over N. slope.
36.27	The W. ¼ sec. cor. of sec. 6, T. 20 S., R. 9 E., monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the 1918 survey. Desc. 15 ft. over N. slope.
40.49	The E. ¼ sec. cor. of sec. 1, monumented with a mound of stone, no visible markings. This is at record dist. from the W. ¼ sec. cor. of sec. 6, T. 20 S., R. 9 E., and is accepted as the original cor. point. At the cor. point Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of the East Boundary of T. 20 S., R. 8 E.

CHAINS

T20S
R8E R9E
 $\frac{1}{2}$
S1 |
1962

N. 0°17' E., beginning new measurement.

Desc. 10 ft. over N. slope.

- 1.20 Wash, 100 lks. wide, 4 ft. deep, drains NW.; asc. 30 ft. over SW. slope.
- 2.30 Spur, slopes NW.; desc. 40 ft. over NW. slope.
- 5.10 Rocky draw, drains W.; asc. 100 ft. over S. slope.
- 12.15 Top of ledge, 15 ft. high, south edge of mesa, bears E. and W., thence along mesa top.
- 28.80 North edge of mesa, bears NE. and SW.; desc. 150 ft. over rocky NW. slope.
- 38.50 Wash, 30 lks. wide, 3 ft. deep, drains irregularly E.; asc. 20 ft. over S. slope.
- 40.21 The cor. of Tps. 19 and 20 S., Rs. 8 and 9 E., monumented with a sandstone, 2x12x20 ins., set, mkd. and witnessed as described in the official record of the 1882 survey.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T19S
R8E R9E
S36 | S31
S1 | S6
T20S
1962

bury original stone cor. alongside iron post.

Land, mountainous.

Soil, rocky clay.

No timber.

Undergrowth, shadscale.

Dependent Resurvey of the North Boundary, Town-
ship 20 South, Range 8 East

Reestablishment of the Survey Executed by A. D. Ferron
in 1882

S. 89°42' W., bet. secs. 1 and 36.

Over broken, mountainous land.

Desc. 20 ft. over SW. slope.

Dependent Resurvey of the North Boundary, T. 20 S., R. 8 E.

CHAINS	
2.20	Wash, 50 lks. wide, 2 ft. deep, drains irregularly E.
4.50	Same wash, drains E. from SW.; asc. 150 ft. over broken SE. slope.
10.00	Top of ledgy shelf, bears E. and W.; asc. 85 ft. over E. slope.
11.40	Small wash, drains S.
27.00	Rocky ridge, bears irregularly N. and S.; desc. 120 ft. over rocky SW. slope.
35.20	Wash, 10 lks. wide, 1 ft. deep, drains irregularly W.; thence over gently rolling bench land.
39.20	Draw, 100 lks. wide, 20 ft. deep, drains S.
39.71	Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 36 at proportionate dist. falls in ledgy draw and is not monumented; there is no remaining evidence of the original cor.
40.02	Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 1 and 36. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid sandstone, and in a mound of stone, 4 ft. base to top, with brass cap mkd. <div style="text-align: center;"> T19S R8E $\frac{1}{4}$ $\xrightarrow{\text{S36}}$ W S1 C T20S 1962 </div>
	No accessories available.
	Asc. 5 ft. over gentle NE. slope.
41.20	Rim of bench, bears NW. and SE.; desc. 45 ft. over SW. slope.
45.10	Spur, slopes S.; desc. 30 ft. over SW. slope.
49.40	Wash, 20 lks. wide, 6 ft. deep, drains irregularly N.; asc. 40 ft. over NE. slope.
50.90	Point of spur, slopes N.; desc. 20 ft. over NW. slope.
52.40	Wash, 10 lks. wide, 4 ft. deep, drains NE. asc. 30 ft. over NE. slope.
55.20	Spur, slopes NW.; desc. 10 ft. over SW. slope.
58.65	Wash, 15 lks. wide, 3 ft. deep, drains irregularly N.; asc. 100 ft. over rocky E. slope.
64.80	Rocky ridge, bears irregularly N. and S.; desc. 80 ft. over SW. slope.
74.35	Wash, 10 lks. wide, 2 ft. deep, drains <u>NW.</u> ; <u>asc.</u> 30 ft. over NE. slope.
77.80	Spur, slopes N.; desc. 20 ft. over NW. slope,
78.90	Wash, 10 lks. wide, 2 ft. deep, drains N.; asc. 10 ft. over SE. slope.

Dependent Resurvey of the North Boundary of T. 20 S., R. 8 E.

CHAINS

79.42

The cor. of secs. 1, 2, 35 and 36, monumented with a sandstone, 3x20x24 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground, to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T19S R8E

S35 | S36

S2 | S1

T20S

1962

bury original stone cor. alongside iron post.

Land, mountainous.

Soil, rocky clay.

No timber.

Undergrowth, shadscale.

S. 89°07' W., bet. secs. 2 and 35.

Over rolling desert land.

Asc. 20 ft. over SE. slope.

1.00 Point of spur, slopes N.; desc. 20 ft. over W. slope.

4.90 Draw, drains N.; asc. 40 ft. over E. slope.

7.20 Spur, slopes N.; desc. 40 ft. over W. slope.

10.50 Base of spur, bears N. and S.; enter willows, greasewood and cottonwood trees along Ferron Creek bottom.

14.90 Ferron Creek, 100 lks. wide, 4 ft. deep, with stream of water, 20 lks. wide, 1 ft. deep, flows NE. from SW.

26.00 Ferron Creek, flows SE. from NW., leave willows and cottonwood trees; asc. 40 ft. over rocky NE. slope.

32.15 Rocky point; desc. 40 ft. over NW. slope.

39.51 Fence, bears N. and S., Ferron Creek, 200 lks. wide, 3 ft. deep, with stream of water 20 lks. wide, 1 ft. deep, flows NE. from SW.; enter dense tamarack and willows.

41.30 Point for the ¼ sec. cor. of secs. 2 and 35 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R8E

S35

¼ S2

T20S

1962

No accessories available.

Set a cottonwood post, 5 ins. diam., 2 ft. in the ground, alongside iron post.

Dependent Resurvey of the North Boundary, T. 20 S., R. 8 E.

CHAINS

- 43.00 Leave creek bottom and dense tamarack and willows, bears NE. and SW.; enter meadowland and scattered greasewood.
- 54.23 Fence, bears N. 40° E. and S. 20° W.
- 67.81 Fence, bears N. and S.; leave meadow and enter cultivated land.
- 82.60 Point for the cor. of secs. 2, 3, 34 and 35 at proportionate dist. falls in cultivated land and is not monumented. There is no remaining evidence of the original cor.
- From this point, point selected for the witness cor. of secs. 2, 3, 34 and 35 bears N., 3.15 chs. dist.
- Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
- T19S R8E

S34	S35
S3	S2
W C	

T20S
1962
- No accessories available.
- Land, mountainous, east portion; level meadow and farm land, west portion.
- Soil, rocky sandy clay, east portion; loamy clay, west portion.
- Timber, cottonwood trees along Ferron Creek.
- Undergrowth, shadscale, willows, tamarack, greasewood and grass.
- From true point for cor. of secs. 2, 3, 34 and 35.
- S. 89°07' W., bet. secs. 3 and 34.
- Over level farm land.
- 9.85 Irrigation ditch, 5 lks. wide, 1 ft. deep, drains N. 70° E.
- 10.95 Road, unimproved, bears N. 70° E. and S. 70° W.
- 13.76 Fence, bears N. and S.; road to farm house bears S. and irregularly W.; asc. 60 ft. over SE. slope.
- 20.50 Spur, slopes sharply S.; desc. 50 ft. over SW. slope.
- 23.60 Draw, drains S.; asc. 100 ft. over ledgy, steep SE. slope.
- 26.50 Ridge, bears irregularly N. and S.; desc. 85 ft. over SW. slope.
- 37.42 Base of steep descent, fence, bears N. and S.
- 38.40 Road, improved, dirt, bears NW. and SE.
- 41.30 Point for the ¼ sec. cor. of secs. 3 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Dependent Resurvey of the North Boundary of T. 20 S., R. 8 E.

CHAINS	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.
	<p>T19S R8E $\frac{1}{4}$ $\frac{S34}{S3}$ T20S 1962</p>
	No accessories available.
41.50	Wash, 30 lks. wide, 10 ft. deep, drains irregularly SE.; asc. 20 ft. over NE. slope.
42.60	Spur, slopes E.; desc. 15 ft. over gentle W. slope.
45.85	Road, unimproved, bears S. and N. 20° E.
53.90	Draw, drains NE.; asc. 50 ft. over NE. slope.
64.80	Spur, slopes S.; desc. 30 ft. over SW. slope.
72.60	Draw, drains SE.; asc. 30 ft. over NE. slope.
75.80	Spur, slopes S.; desc. 15 ft. over SW. slope.
82.60	The cor. of secs. 3, 4, 33 and 34, monumented with a sandstone, 6x10x12 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
	<p>T19S R8E $\frac{S33}{S4}$ $\frac{S34}{S3}$ T20S 1962</p>
	bury original stone cor. alongside iron post.
	<p>Land, mountainous. Soil, sandy clay. No timber. Undergrowth, shadscale.</p>
	S. 89°00' W., bet. secs. 4 and 33.
	Over rolling land.
	Desc. 15 ft. over SW. slope.
1.10	Wash, drains SE.; asc. 20 ft. over NE. slope.
12.75	Top of ascent; thence over nearly level land.
40.37	The ¼ sec. cor. of secs. 4 and 33, monumented with a quartz stone, 12x14x20 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of the North Boundary of T. 20 S., R. 8 E.

CHAINS

T19S R8E

 $\frac{1}{2}$ S33

S4

T20S

1962

bury original stone cor. alongside iron post.

S. 88°56' W., beginning new measurement.

Desc. 70 ft. over SW. slope.

14.75 Wash, 20 lks. wide, 4 ft. deep, drains SE.; asc. 45 ft. over SE. slope.

22.10 Spur, slopes SE.; desc. 30 ft. over SW. slope.

27.10 Wash, 15 lks. wide, 5 ft. deep, drains SE.; asc. 20 ft. over NE. slope.

40.30 The cor. of secs. 4, 5, 32 and 33, monumented with a quartz stone, 6x9x18 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R8E

S32|S33

S5|S4

T20S

1962

bury original stone cor. alongside iron post, and deposit glass around iron post, 6 ins. below ground.

Land, rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

S. 88°41' W., bet. secs. 5 and 32.

Over rolling desert land.

Asc. 20 ft. over NE. slope.

6.50 Spur, slopes S.; desc. 50 ft. over gently rolling SW. slope.

12.90 Wash, 15 lks. wide, 4 ft. deep, drains SW.

28.30 Wash, 25 lks. wide, 10 ft. deep, drains SW.

33.80 Wash, 10 lks. wide, 6 ft. deep, drains SE.; asc. 10 ft. over NE. slope.

40.52 The ½ sec. cor. of secs. 5 and 32, monumented with a quartz stone, 12x12x14 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Dependent Resurvey of the North Boundary of T. 20 S., R. 8 E.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R8E

$\frac{1}{2}$ $\frac{S32}{S5}$

T20S

1962

bury original stone cor. alongside iron post, and deposit glass 6 ins. below ground around iron post.

S. $89^{\circ}11'$ W., beginning new measurement.

29.30 Wash, 20 lks. wide, 20 ft. deep, drains S. 50° E.; asc. 30 ft. over NE. slope.

40.43 The cor. of secs. 5, 6, 31 and 32, monumented with a quartz stone, 8x10x16 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R8E

$\frac{S31}{S6} | \frac{S32}{S5}$

T20S

1962

bury original stone cor. alongside iron post.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

S. $88^{\circ}59'$ W., bet. secs. 6 and 31.

Over rolling desert land.

Asc. 10 ft. over NE. slope.

0.80 Spur, slopes NE.; desc. 10 ft. over NW. slope.

23.25 Bottom of descent, slopes N.; asc. 25 ft. over rolling NE. slope.

34.30 Wash, 15 lks. wide, 1 ft. deep, drains irregularly E.; asc. 15 ft. over SE. slope.

36.60 Point of small spur, slopes S.; desc. 10 ft. over SW. slope.

38.95 Wash, 15 lks. wide, 3 ft. deep, drains irregularly E.; asc. 10 ft. over NE. slope.

40.00 Point of spur, slopes NE. from SW.

Dependent Resurvey of the North Boundary, T. 20 S., R. 8 E.

CHADDS

40.33

The $\frac{1}{4}$ sec. cor. of secs. 6 and 31, monumented with a quartz stone, 8x12x18 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R8E

$\frac{1}{4}$ S31
S6

T20S
1962

bury original stone cor. alongside iron post.

S. $88^{\circ}59'$ W., beginning new measurement.

Desc. 15 ft. over NW. slope.

1.70 Wash, 15 lks. wide, 4 ft. deep, drains irregularly E.; asc. 50 ft. over gentle SE. slope.

39.60 Spur, slopes S.; desc. 15 ft. over SW. slope.

40.43 The cor. of Tps. 19 and 20 S., Rs. 7 and 8 E., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the E. bdy. of T. 20 S., R. 7 E.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

Dependent Resurvey of the Subdivision
of Township 20 South, Range 8 East.

Reestablishment of the Survey Executed by A. D. Ferron in
1882

From the standard cor. of secs. 35 and 36, on the S. bdy. of the Tp., hereinbefore described.

N. $0^{\circ}32'$ W., bet. secs. 35 and 36.

Over rolling mountainous land.

Desc. 50 ft. over NW. slope.

3.50 Wash, 20 lks. wide, 1 ft. deep, drains irregularly N.

20.90 Same wash, drains NE.; asc. 25 ft. over SE. slope.

25.95 Spur, slopes E.; desc. 20 ft. over NE. slope.

32.00 Wash, drains SE.; asc. 80 ft. over steep S. slope.

39.50 Spur, slopes E.; desc. 30 ft. over steep N. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS 40.51	Point for the $\frac{1}{2}$ sec. cor. of secs. 35 and 36, at proportionate dist.; there is no remaining evidence of the original cor.
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 15 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T20S R8E $\frac{1}{2}$ S35 S36 1962
	Desc. 40 ft. over steep N. slope.
42.30	Base of spur, bears E. and W., thence over level land.
52.30	Desc. 50 ft. over N. slope.
60.45	Wash, 30 lks. wide, 12 ft. deep, drains E.; asc. 10 ft. over gentle SE. slope.
65.85	Road, improved dirt, bears irregularly E. and W.
71.80	Base of spur, bears NE. and SW.; asc. 25 ft. over SE. slope.
77.65	Spur, slopes E.; desc. abruptly 20 ft. over steep N. slope.
78.10	Wash, 40 lks. wide, 1 ft. deep, drains E. about 2.00 chs.; thence S.; thence over level land.
81.02	The cor. of secs. 25, 26, 35 and 36, monumented with a sandstone, 8x10x14 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T20S R8E S26 S25 S35 S36 1962
	bury original stone cor. alongside iron post, and deposit glass around iron post, 6 ins. below ground.
	Land, rolling desert. Soil, clay. No timber. Undergrowth, shadscale and scattered greasewood.
	From the cor. of secs. 25 and 36, on the E. bdy. of the Tp.
	N. 89°14' W., bet. secs. 25 and 36.
	Over rolling desert land.
0.80	Wash, 20 lks. wide, 1 ft. deep, drains SE.; asc. 70 ft. over SE, slope,
16.00	Spur, slopes S.; desc. 35 ft. over NW. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

- 21.90 Wash, 10 lks. wide, 1 ft. deep, drains S. 20° W.; asc. 15 ft. over SE. slope.
- 23.95 Spur, slopes SW; desc. 20 ft. over NW. slope.
- 29.95 Wash, 10 lks. wide, 2 ft. deep, drains S. 20° W.; asc. 90 ft. over SE. slope.
- 37.70 Spur, slopes S.; desc. 15 ft. over W. slope.
- 40.95 The $\frac{1}{4}$ sec. cor. of secs. 25 and 36, monumented with a sandstone, 8x20x25 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 8 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T20S R8E
 $\frac{1}{4}$ S25
 $\frac{1}{4}$ S36
 1962
- bury original stone cor. alongside iron post.
-
- N. 89°58' W., beginning new measurement.
- Desc. 40 ft. over W. slope.
- 12.75 Wash, 10 lks. wide, 1 ft. deep, drains S.; asc. 25 ft. over E. slope.
- 15.50 Spur, slopes S.; desc. 40 ft. over W. slope.
- 27.10 Wash, 10 lks. wide, 1 ft. deep, drains S.; asc. 40 ft. over E. slope.
- 29.95 Spur, slopes S.; desc. 60 ft. over S. slope.
- 37.75 Wash, 50 lks. wide, 1 ft. deep, drains S.; thence over level land.
- 40.16 The cor. of secs. 25, 26, 35 and 36.
- Land, rolling desert.
 Soil, rocky clay, exposed sandstone.
 No timber.
 Undergrowth, shadscale.
-
- N. 0°15' E., bet. secs. 25 and 26.
- Over rolling desert land.
- Asc. 15 ft. over gentle S. slope.
- 2.80 Wash, 10 lks. wide, 1 ft. deep, drains SE.
- 3.55 Road, unimproved, bears N. 30° E. and S. 60° W.
- 6.55 Same road, bears S. 80° E. and N. 70° W.; asc. 40 ft. over S. slope.
- 10.15 Low rocky ridge, bears E. and W.; desc. 30 ft. over N. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

12.65 Same road, bears E. and W.; asc. 175 ft. over SE. slope.

38.25 Spur, slopes E.; desc. 10 ft. over NE. slope.

40.14 The $\frac{1}{4}$ sec. cor. of secs. 25 and 26, monumented with a red sandstone, 8x14x24 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid sandstone, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$
S26|S25
1962

bury original stone cor. alongside iron post.

N. 0°05' E., beginning new measurement.

Asc. 15 ft. over SW. slope.

3.50 Top of ascent, slopes W.; desc. 30 ft. over NW. slope.

10.60 Head of draw, drains W.; asc. 40 ft. over SW. slope.

13.75 Ridge, bears E. and W.; desc. 20 ft. over N. slope.

19.95 Wash, 25 lks. wide, 2 ft. deep, drains S. 20° W.; asc. 45 ft. over SE. slope.

26.90 Spur, slopes E.; desc. 55 ft. over NE. slope.

31.95 Low ridge, bears E. and W.; desc. 45 ft. over N. slope.

40.00 Wash, 10 lks. wide, 1 ft. deep, drains NW.

40.40 The cor. of secs. 23, 24, 25 and 26, monumented with a sandstone, 4x8x18 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

S23|S24
S26|S25
1962

bury original stone cor. alongside iron post.

Land, rolling desert.

Soil, rocky clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 24 and 25, on the E. bdy. of the Tp.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

N. 89°36' W., bet. secs. 24 and 25.

Over mountainous land.

0.70 Wash, 10 lks. wide, 1 ft. deep, drains S.; asc. 15 ft. over E. slope.

3.15 Rocky low ridge, bears N. and S.; desc. 10 ft. over W. slope.

5.20 Wash, 5 lks. wide, 1 ft. deep, drains NW.; asc. 85 ft. over rocky SE. slope.

14.70 Road, unimproved, bears N. 20° E. and S. 20° W.

21.30 Spur, slopes NE.; desc. 70 ft. over rocky NW. slope.

37.45 Wash, 10 lks. wide, 2 ft. deep, drains S. 20° E.; asc. 20 ft. over SE. slope.

40.47 The $\frac{1}{4}$ sec. cor. of secs. 24 and 25, monumented with a sandstone, 4x14x16 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

$\frac{S24}{4S25}$

1962

bury original stone cor. alongside iron post, and deposit glass around iron post, 6 ins. below ground.

N. 89°52' W., beginning new measurement.

Asc. 235 ft. over steep, broken E. slope.

17.15 Top of ledge, 20 ft. high, bears N. and S.

17.30 Spur, slopes S.; desc. 60 ft. over W. slope.

25.15 Draw, drains N.; asc. 20 ft. over E. slope.

33.10 Low ridge, bears N. and S.; with scattered juniper timber along top; desc. 60 ft. over SW. slope.

40.30 The cor. of secs. 23, 24, 25 and 26.

Land, mountainous, broken.

Soil, rocky clay, exposed sandstone.

Timber, scattered juniper along NS ridge, west portion.

Undergrowth, shadscale.

N. 0°09' E., bet. secs. 23 and 24.

Over rolling mountainous land.

Desc. 10 ft. over gentle NW. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
4.50	Wash, 10 lks. wide, 1 ft. deep, drains NW.; asc. 20 ft. over gentle SW. slope.
11.10	Low ridge, bears E. and W.; desc. 20 ft. over N. slope.
15.90	Wash, 15 lks. wide, 2 ft. deep, drains W.; asc. 25 ft. over S. slope.
17.70	Low ridge, bears E. and W.; desc. 40 ft. over NE. slope.
24.20	Wash, 35 lks. wide, 1 ft. deep, drains N. 70° W.; asc. 25 ft. over SW. slope.
31.60	Ridge, bears E. and W.; desc. 35 ft. over N. slope.
40.28	The $\frac{1}{4}$ sec. cor. of secs. 23 and 24, monumented with a sandstone, 2x12x14 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
	T20S R8E $\frac{1}{4}$ S23 S24 1962
	bury original stone cor. alongside iron post.
	N. 0°06' E., beginning new measurement.
	Over gently rolling desert land.
1.05	Wash, 20 lks. wide, 1 ft. deep, drains W.
2.20	Low ridge, bears E. and W.; desc. 30 ft. over gently rolling NW. slope.
26.45	Wash, 15 lks. wide, 2 ft. deep, drains NW.
28.45	Wash, 15 lks. wide, 3 ft. deep, drains W.
39.00	Road, unimproved, bears E. and W.
40.41	The cor. of secs. 13, 14, 23 and 24, monumented with a sandstone, 3x12x16 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
	T20S R8E S14 S13 S23 S24 1962
	bury original stone cor. alongside iron post.
	Land, rolling mountains south portion; gently rolling desert north portion.
	Soil, clay

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

No timber.
Undergrowth, shadscale.

From the cor. of secs. 13 and 24, on the E. bdy. of the Tp.

S. 89°51' W., bet. secs. 13 and 24.

Over rolling desert land.

Desc. 20 ft. over NW. slope.

2.40 Wash, 30 lks. wide, 1 ft. deep, drains N. 70° W.

7.50 Wash, 100 lks. wide, 2 ft. deep, drains N.; asc. 85 ft. over E. slope.

11.80 Spur, slopes SW.; desc. 60 ft. over W. slope.

22.40 Wash, 20 lks. wide, 1 ft. deep, drains N.

22.60 Wash, 20 lks. wide, 1 ft. deep, drains N.; asc. 10 ft. over SE. slope.

26.00 Point of spur, slopes S., 1.00 ch. to end; desc. 10 ft. over SW. slope.

27.60 Wash, 20 lks. wide, 1 ft. deep, drains SE.; asc. 140 ft. over rocky, broken NE. slope.

37.05 Top of ascent, S. side of knoll; desc. 10 ft. along S. slope.

40.21 The $\frac{1}{2}$ sec. cor. of secs. 13 and 24, monumented with a sandstone, 5x8x24 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 3 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{2}$ S13

S24

1962

bury original stone cor. in mound of stone alongside iron post.

N. 89°37' W., beginning new measurement.

Desc. 45 ft. over SW. slope.

4.35 Wash, 10 lks. wide, 2 ft. deep, drains NW.; thence over gently rolling bench land.

20.30 Wash, 10 lks. wide, 1 ft. deep, drains NW.

21.60 Fence, bears N. 65° W. and S. 65° E.

27.50 Desc. 40 ft. over NW. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
35.20	Road, unimproved, bears S. 70° W. and curves NE.
40.44	The cor. of secs. 13, 14, 23 and 24.
	Land, rolling mountains, east portion; rolling desert, west portion.
	Soil, rocky clay, exposed sandstone, east portion; clay west portion.
	No timber.
	Undergrowth, shadscale.
	N. 0°17' E., bet. secs. 13 and 14.
	Over rolling desert land.
0.15	Wash, 10 lks. wide, 1 ft. deep, drains NW.
1.40	Wash, 10 lks. wide, 1 ft. deep, drains W.
5.20	Spur, slopes W.; desc. 15 ft. over N. slope.
6.95	Wash, 60 lks. wide, 4 ft. deep, drains W.; asc. 40 ft. over SW. slope.
9.61	Fence, bears N. 65° W. and S. 65° E.
17.10	Spur, slopes NE.; desc. 30 ft. over NW. slope.
21.30	Wash, 10 lks. wide, 1 ft. deep, drains irregularly W.; asc. 10 ft. over SW. slope.
27.30	Top of ascent, slopes W.; desc. 20 ft. over NW. slope.
40.89	The $\frac{1}{2}$ sec. cor. of secs. 13 and 14, monumented with a sandstone, 10x12x14 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T20S R8E
	$\frac{1}{2}$
	S14 S13
	1962
	bury original stone cor. alongside iron post.
	N. 0°11' E., beginning new measurement.
	Desc. 10 ft. over NW. slope.
0.80	Wash, drains W.; asc. 15 ft. over SW. slope.
4.60	Spur, slopes W.; desc. 30 ft. over NW. slope.
8.70	Wash, 60 lks. wide, 2 ft. deep, drains irregularly N.
14.40	Same wash, drains NE.; asc. 10 ft. over SE. slope.
15.60	Spur, slopes NE., road, unimproved, bears N. 50° W., S. 50° E.; desc. 10 ft. over NW. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

- 19.70 Wash, 200 lks. wide, 2 ft. deep, drains N. from SW.
- 26.40 Leave wash, drains E.; asc. 10 ft. over SE. slope.
- 28.60 Same road, bears N. 70° E. and S. 60° W.; desc. 10 ft. over NW. slope.
- 29.35 Wash, 40 lks. wide, 4 ft. deep, drains NE.; asc. 40 ft. over SE. slope.
- 40.84 The cor. of secs. 11, 12, 13 and 14, monumented with a sandstone, 10x12x18 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, 2½ ins. diam., 14 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T20S R8E

S11	S12
S14	S13

1962
- bury original stone cor. alongside iron post.
- Land, rolling desert.
Soil, clay.
No timber.
Undergrowth, shadscale.
-
- From the cor. of secs. 12 and 13, on the E. bdy. of the Tp.
- N. 88°50' W., bet. secs. 12 and 13.
- Over rolling desert land.
- Asc. 25 ft. over E. slope.
- 1.70 Point of spur, slopes NE.; desc. 15 ft. over gentle NW. slope.
- 5.55 Wash, 20 lks. wide, 2 ft. deep, drains N. 3.00 chs. dist. to main wash, drains E.
- 9.85 Wash, 20 lks. wide, 4 ft. deep, drains NE. 4.00 chs. to main wash, drains E.; asc. 50 ft. over SE. slope.
- 12.25 Road, unimproved, bears NE. and SW.
- 23.85 Point of spur, slopes E.; asc. 60 ft. over rocky, broken SE. slope.
- 36.55 Top of ledge, 30 ft. high, ridge, bears NE. and SW.; desc. 20 ft. over NW. slope.
- 39.74 The ¼ sec. cor. of secs. 12 and 13, monumented with a sandstone, 7x10x10 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, 2½ ins. diam., 8 ins. in the ground,

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

T20S R8E

 $\frac{1}{4}$ $\frac{S12}{S13}$

1962

bury original stone cor. in mound of stone, alongside iron post.

S. 89°49' W., beginning new measurement.

Desc. 25 ft. over SW. slope.

- 3.50 Small draw, drains NW.; asc. 30 ft. over NE. slope.
- 7.90 Top of ascent, bears NW. and SE.; desc. 25 ft. over SW. slope.
- 24.80 Wash, 40 lks. wide, 2 ft. deep, drains N. from SW.; asc. 50 ft. over gentle SE. slope.
- 33.30 Road, unimproved, bears irregularly N. and S.
- 40.30 The cor. of secs. 11, 12, 13 and 14.

Land, rolling mountains.
Soil, rocky clay.
No timber.
Undergrowth, shadscale.

N. 0°16' E., bet. secs. 11 and 12.

Over rolling mountainous land.

Asc. 5 ft. over SE. slope.

- 1.50 Spur, slopes E.; desc. 30 ft. over NW. slope.
- 10.90 Wash, 10 lks. wide, 1 ft. deep, drains W.; asc. 10 ft. over SW. slope.
- 17.90 Small spur, slopes W.; desc. 40 ft. over N. slope.
- 19.70 Wash, 10 lks. wide, 2 ft. deep, drains W.; asc. 15 ft. over S. slope.
- 25.20 Small spur, slopes W.; desc. 15 ft. over N. slope.
- 28.40 Wash, 5 lks. wide, 1 ft. deep, drains W.; asc. 20 ft. over S. slope.
- 31.40 Spur, slopes W.; desc. 50 ft. over NW. slope.
- 33.90 Wash, 10 lks. wide, 2 ft. deep, drains NW.
- 37.50 Wash, 5 lks. wide, 1 ft. deep, drains irregularly N.
- 40.38 The $\frac{1}{4}$ sec. cor. of secs. 11 and 12, monumented with a sandstone, 8x10x12 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 15 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

T20S. R8E

 $\frac{1}{2}$

S11 | S12

1962

bury original stone cor. alongside iron post.

N. 0°23' E., beginning new measurement.

Desc. 5 ft. over NW. slope.

- 3.50 Wash, 20 lks. wide, 1 ft. deep, drains irregularly W.; asc. 10 ft. over S. slope.
- 5.10 Low ridge, bears E. and W.; desc. 10 ft. over N. slope.
- 7.10 Wash, 10 lks. wide, 1 ft. deep, drains irregularly W.; asc. 30 ft. over S. slope.
- 9.60 Low ridge, bears E. and W.; desc. 15 ft. over N. slope.
- 11.50 Wash, 15 lks. wide, 1 ft. deep, drains W.; asc. 35 ft. over S. slope.
- 13.30 Ridge, bears NE. and W.; desc. 30 ft. over NW. slope.
- 17.60 Draw, drains NE.; asc. 35 ft. over SE. slope.
- 22.20 Top of ascent, E. slope of knoll; desc. 75 ft. over NE. slope.
- 37.70 Wash, 10 lks. wide, 2 ft. deep, drains NE.; thence along E. slope.
- 40.00 The cor. of secs. 1, 2, 11 and 12, monumented with a sandstone, 2x10x18 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

 $\frac{S2}{S1}$

S11 | S12

1962

bury original stone cor. alongside iron post.

Land, rolling desert mountains.

Soil, rocky clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 1 and 12, on the E. bdy. of the Tp.

N. 88°58' W., bet. secs. 1 and 12.

Over rolling desert land.

Asc. 15 ft. over SE. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
1.30	Ridge, bears NE. and S.; desc. 45 ft. over W. slope.
10.40	Wash, 10 lks. wide, 1 ft. deep, drains irregularly N.
15.15	Wash, 20 lks. wide, 1 ft. deep, drains N.; asc. 25 ft. over SE. slope.
16.00	Spur, slopes NE.; desc. 10 ft. over NW. slope.
22.10	Wash, 20 lks. wide, 1 ft. deep, drains NE.; asc. 35 ft. over SE. slope.
34.10	Top of ascent, bears NE. and SW.; desc. 5 ft. over gentle NW. slope.
39.29	The $\frac{1}{4}$ sec. cor. of secs. 1 and 12, monumented with a sandstone, 3x10x20 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 15 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	<p>T20S R8E</p> <p>$\frac{1}{4}$ S1</p> <p>$\frac{1}{4}$ S12</p> <p>1962</p>
	bury original stone cor. alongside iron post.
	N. 89°31' W., beginning new measurement.
	Desc. 90 ft. over rolling NW. slope.
29.35	Wash, 40 lks. wide, 1 ft. deep, drains irregularly N.
38.65	Wash, 10 lks. wide, 1 ft. deep, drains irregularly N.
40.32	The cor. of secs. 1, 2, 11 and 12.
	<p>Land, rolling desert.</p> <p>Soil, clay.</p> <p>No timber.</p> <p>Undergrowth, shadscale.</p>
	N. 1°32' E., bet. secs. 1 and 2.
	Over rolling desert land.
	Desc. 10 ft. over gentle NW. slope.
5.80	Wash, 40 lks. wide, 3 ft. deep, drains irregularly E.
6.60	Wash, 40 lks. wide, 3 ft. deep, drains irregularly W.; asc. 40 ft. over S. slope.
13.90	Ridge, bears E. and W.; desc. 40 ft. over N. slope.
23.05	Wash, 25 lks. wide, 3 ft. deep, drains irregularly W.
24.45	Wash, 25 lks. wide, 3 ft. deep, drains irregularly W.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

- 28.25 Wash, 15 lks. wide, 3 ft. deep, drains W.; asc. 30 ft. over S. slope.
- 33.15 Ridge, bears E. and W.; desc. 30 ft. over N. slope.
- 36.00 Wash, 15 lks. wide, 3 ft. deep, drains irregularly W.; asc. 45 ft. over rocky SW. slope.
- 39.82 The $\frac{1}{4}$ sec. cor. of secs. 1 and 2, monumented with a sandstone, 4x20x30 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$

S2|S1

1962

bury original stone cor. alongside iron post.

N. $0^{\circ}56'$ W., beginning new measurement.

Asc. 150 ft. over steep, broken SW. slope.

- 5.35 Ridge, bears NW. and SE.; desc. 10 ft. over gentle NE. slope.
- 10.85 Top of ledge, 10 ft. high, bears NW. and SE.; desc. 130 ft. over broken NE. slope.
- 20.20 Draw, drains NE.; asc. 30 ft. over S. slope.
- 26.70 Ridge, bears irregularly E. and W.; desc. 85 ft. over NE. slope.
- 33.40 Wash, 10 lks. wide, 3 ft. deep, drains NE.; continue descent.
- 39.25 Wash, 10 lks. wide, 1 ft. deep, drains NE.
- 39.36 The cor. of secs. 1, 2, 35 and 36, on the N. bdy. of the Tp.

Land, rolling, south portion; mountainous, broken, north portion.

Soil, clay, south portion; rocky, gravelly clay, north portion.

No timber.

Undergrowth, shadscale.

From the standard cor. of secs. 34 and 35, on the south bdy. of the Tp., hereinbefore described.

N. $0^{\circ}21'$ W., bet. secs. 34 and 35.

Over mountainous land, through dense greasewood and shadscale.

Desc. 20 ft. over gentle NW. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
12.65	Wash, 20 lks. wide, 8 ft. deep, drains N. 80° E.
15.30	Wash, 30 lks. wide, 8 ft. deep, drains E.; asc. 260 ft. over steep SE. slope.
32.20	Top of ledge, 20 ft. high, bears NE. and SW.; asc. 10 ft. over gentle SE. slope of mesa; enter scattered timber.
33.45	Top of ascent, bears E. and W.; desc. 5 ft. over gentle N. slope.
40.61	The $\frac{1}{4}$ sec. cor. of secs. 34 and 35, monumented with a sandstone, 2x9x12 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T20S R8E $\frac{1}{4}$ S34 S35 1962
	bury original stone cor. alongside iron post.
	<hr/>
	N. 0°03' W., beginning new measurement.
	Desc. 50 ft. over N. slope.
3.80	Rocky wash, drains W.; asc. 10 ft. over SW. slope.
5.80	Point of rocky spur, slopes W.; desc. 40 ft. over NW. slope.
10.15	Wash, 15 lks. wide, 3 ft. deep, drains W.; asc. 50 ft. over SW. slope.
14.00	Spur, slopes NW., thence by triangulation; desc. 5 ft. over NE. slope.
14.70	Top of ledge, rim of mesa, bears NW. and SE.; desc. abruptly about 350 ft. over steep, broken NE. slope. Leave scattered timber.
24.50	Draw, drains E.; asc. abruptly about 400 ft. over precipitous, ledgy S. slope.
33.60	Top of ledge, 20 ft. high, rim of mesa, bears N. 70° E. and SW., end triangulation; desc. 10 ft. along gentle W. slope. Enter scattered timber.
38.80	Small wash, 5 lks. wide, 1 ft. deep, drains irregularly W.
40.04	The cor. of secs. 26, 27, 34 and 35, monumented with a sandstone, 2x12x4 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

T20S R8E

S27 | S26

S34 | S35

1962

bury original stone cor. alongside iron post.

Land, mountainous, broken.

Soil, rocky, sandy clay, exposed sandstone.

Timber, scattered juniper and pinon on mesa top.

Undergrowth, greasewood, south portion; shadscale, north portion.

From the cor. of secs. 25, 26, 35 and 36.

S. 89°50' W., bet. secs. 26 and 35.

Over mountainous land.

Asc. 20 ft. over NE. slope.

1.90 Wash, 60 lks. wide, 1 ft. deep, drains S. 70° E.

2.90 Point of spur, slopes N.; desc. 10 ft. over NW. slope.

10.00 Road, unimproved, bears NE. and SW.

11.90 Wash, 10 lks. wide, 1 ft. deep, drains irregularly S.; asc. 80 ft. over steep E. slope.

21.80 Spur, slopes S. from NW.; desc. 80 ft. over steep SW. slope.

30.10 Base of spur; thence over nearly level land.

39.60 Road, improved dirt, bears N. 25° W., and S. 40° E.

40.08 Point for the $\frac{1}{4}$ sec. cor. of secs. 26 and 35 at proportionate dist. falls in wash, 30 lks. wide, 3 ft. deep, drains SE. and is not monumented; there is no remaining evidence of the original cor.40.38 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 26 and 35.Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S R8E

 $\frac{1}{4}$ S26 W →
S35 C

1962

Asc. 15 ft. over gentle east slope.

42.60 Road, unimproved, bears N. 15° E. and S. 20° W.

50.00 Asc. 120 ft. over rocky E. slope.

55.90 Spur, slopes N.; desc. 40 ft. over rocky W. slope.

61.90 Draw, drains NE.; asc. 210 ft. over steep, broken E. slope.

73.95 Top of ledge, 20 ft. high, rim of mesa, bears N. and S.; enter scattered timber; desc. 25 ft. over gentle W. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

80.16

The cor. of secs. 26, 27, 34 and 35.

Land, mountainous, broken.
Soil, rocky clay, exposed sandstone.
Timber, scattered pinon and juniper, west portion on mesa top.
Undergrowth, shadeless.

N. 0°05' E., bet. secs. 26 and 27.

Over rolling mesa top.

Desc. 35 ft. over gentle NW. slope.

6.90 Wash, 5 lks. wide, 1 ft. deep, drains NW.

13.00 Rim of mesa, ledge, 10 ft. high, bears NW. and SE.; desc. 95 ft. over NE. slope. Leave timber.

21.80 Spur, slopes E.; desc. 30 ft. over NW. slope.

26.50 Draw, drains E.; asc. 30 ft. over SE. slope.

30.00 Spur, slopes E.; desc. 20 ft. over NE. slope.

33.00 Wash, 10 lks. wide, 1 ft. deep, drains E.; asc. 15 ft. over SE. slope.

35.70 Spur, slopes NE.; desc. 20 ft. over NW. slope.

36.50 Wash, drains NE 1.00 ch., thence E.; asc. 110 ft. over steep, S. slope.

40.43 Point for the $\frac{1}{2}$ sec. cor. of secs. 26 and 27 at proportionate dist. falls on steep, loose clay slope and is deemed unsafe to perpetuate; there is no remaining evidence of the original cor.

40.73 Point selected for the witness $\frac{1}{2}$ sec. cor. of secs. 26 and 27.

Set an iron post, 30 ins. long, 2½ ins. diam., 1½ ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mhd.

T205 R8E

↓
S27 S26
↓
W C
1962

Asc. abruptly 45 ft. over ledgy S. slope.

41.45 Top of sandstone ledge, 10 ft. high, bears E. and curves NW.; asc. 10 ft. over gentle S. slope.

42.70 Ridge, bears NW. and SE.; desc. 35 ft. over gentle N. slope.

57.60 Desc. 75 ft. over steep, rocky N. slope.

62.80 Road, improved dirt, bears E. and N. 80° W.; asc. 20 ft. over gentle S. slope.

77.45 Wash, 10 lks. wide, 3 ft. deep, drains irregularly S.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS
80.86

The cor. of secs. 22, 23, 26 and 27, monumented with a sandstone, 4x6x10 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S R8E

S22 | S23

S27 | S26

1962

bury original stone cor. alongside iron post.

From this cor., a 1 in. iron post, 6 ins. above ground, bears S. 3°46' E., 17.68 chs. dist., with brass cap mkd.

BLM PROJECT NO.

25

CINDERELLA RES.

NW NW SEC. 26

T20S R8E

1936

Land, mountainous, broken, south portion; nearly level desert, north portion.

Soil, rocky clay, exposed sandstone, south portion; clay, north portion.

Timber, scattered pinon and juniper, south portion; none, north portion.

Undergrowth, shadscale.

From the cor. of secs. 23, 24, 25 and 26.

N. 89°37' W., bet. secs. 23 and 26.

Over rolling desert land.

Desc. 10 ft. over W. slope.

3.20 Wash, 15 lks. wide, 1 ft. deep, drains N.; asc. 15 ft. over E. slope.

6.30 Spur, slopes N.; desc. 20 ft. over W. slope.

11.35 Wash, 10 lks. wide, 1 ft. deep, drains N.

13.40 Wash, 10 lks. wide, 1 ft. deep, drains N.; asc. 20 ft. over E. slope.

24.90 Spur, slopes N.; desc. 10 ft. over SW. slope.

32.85 Wash, 5 lks. wide, 1 ft. deep, drains N. 20° W.; asc. 15 ft. over NE. slope.

39.85 The ¼ sec. cor. of secs. 23 and 26, monumented with a sandstone, 6x9x15 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

T20S R8E

 $\frac{1}{4}$ S23 $\frac{1}{4}$ S26

1962

bury original stone cor. alongside iron post.

S. 89°49' W., beginning new measurement.

Desc. 30 ft. over W. slope.

10.50 Wash, 10 lks. wide, 1 ft. deep, drains N.

13.00 Wash, 20 lks. wide, 1 ft. deep, drains NE.; thence over nearly level land.

40.28 The cor. of secs. 22, 23, 26 and 27.

Land, rolling desert, east portion; nearly level desert, west portion.

Soil, clay.

No timber.

Undergrowth, shadscale.

N. 0°08' E., bet. secs. 22 and 23.

Over gently rolling desert land.

11.10 Road, unimproved, bears E. and W.

20.90 Wash, 20 lks. wide, 2 ft. deep, drains irregularly N.

26.60 Same wash, drains N. 10° E.

32.60 Low spur, slopes NE.; desc. 20 ft. along W. slope.

40.60 Point for the $\frac{1}{4}$ sec. cor. of secs. 22 and 23 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

 $\frac{1}{4}$

S22 | S23

1962

No accessories available.

Desc. 15 ft. over NW. slope.

44.90 Wash, 10 lks. wide, 2 ft. deep, drains NW.; desc. 20 ft. over NW. slope.

56.20 Same wash, 30 lks. wide, 6 ft. deep, drains NE.; asc. 20 ft. over SE. slope.

57.50 Point of spur, slopes NE.; desc. 30 ft. over NW. slope.

61.05 Wash, 10 lks. wide, 2 ft. deep, drains NE.; asc. 25 ft. over series of small spurs sloping E.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

77.00 Spur, slopes NE.; desc. 25 ft. over NW. slope.

78.20 Wash, 20 lks. wide, 3 ft. deep, drains NE.; asc. 10 ft. over SE. slope.

81.20 The cor. of secs. 14, 15, 22 and 23, monumented with a sandstone, 3x6x12 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

S15 | S14

S22 | S23

1962

bury original stone cor. alongside iron post.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 13, 14, 23 and 24.

N. $89^{\circ}48'$ W., bet. secs. 14 and 23.

Over rolling desert land.

Desc. 10 ft. over W. slope.

11.70 Wash, 30 lks. wide, 2 ft. deep, drains N.; asc. 25 ft. over E. slope.

19.50 Spur, slopes N.; desc. 35 ft. over W. slope.

26.60 Wash, 20 lks. wide, 1 ft. deep, drains N. 20° W.; asc. 30 ft. over E. slope.

40.17 The $\frac{1}{4}$ sec. cor. of secs. 14 and 23, monumented with a sandstone, 3x10x14 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone 5 ft. base to top, with brass cap mkd.

T20S R8E

S14

$\frac{1}{4}$ S23

1962

bury original stone cor. alongside iron post.

N. $89^{\circ}23'$ W., beginning new measurement.

Desc. 30 ft. over SW. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
2.50	Wash, drains S.; asc. 40 ft. over SE. slope.
5.10	Spur, slopes S.; desc. 40 ft. over SW. slope.
9.05	Wash, 20 lks. wide, 1 ft. deep, drains NW.; asc. 10 ft. over NE. slope.
12.20	Spur, slopes NW.; desc. 10 ft. over NW. slope.
16.90	Wash, 25 lks. wide, 1 ft. deep, drains NE.; asc. 30 ft. over SE. slope.
18.90	Spur, slopes N.; desc. 35 ft. over NW. slope.
30.45	Wash, 25 lks. wide, 3 ft. deep, drains irregularly N.
39.15	Wash, 25 lks. wide, 3 ft. deep, drains NE.; asc. 10 ft. over SE. slope.
40.04	The cor. of secs. 14, 15, 22 and 23.
	Land, rolling desert. Soil, clay. No timber. Undergrowth, shadscale.
	N. 0°14' E., bet. secs. 14 and 15.
	Over rolling desert land.
	Asc. 10 ft. over SE. slope.
1.20	Spur, slopes E.; desc. 5 ft. over N. slope.
2.70	Wash, 10 lks. wide, 2 ft. deep, drains E.; asc. 10 ft. over S. slope.
6.30	Spur, slopes E.; desc. 45 ft. over N. slope.
6.60	Wash, 30 lks. wide, 5 ft. deep, drains E.
7.50	Road, unimproved, bears SW. and curves N.
10.30	Wash, 10 lks. wide, 4 ft. deep, drains E.; asc. 10 ft. over SE. slope.
16.30	Low clay ridge, bears E. and W.; thence over gently rolling land.
23.20	Wash, 30 lks. wide, 4 ft. deep, drains NE.
33.50	Wash, 20 lks. wide, 4 ft. deep, drains NE.
35.17	Fence, bears E. and W.
40.44	Point for the $\frac{1}{2}$ sec. cor. of secs. 14 and 15 at proportionate dist.; there is no remaining evidence of the original cor.
	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.
	T20S R8E $\frac{1}{2}$ S15 S14 1962

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

No accessories available.

Desc. 25 ft. over gentle N. slope.

52.90 Wash, 10 lks. wide, 3 ft. deep, drains irregularly E.; asc. 25 ft. over gentle S. slope.

54.30 Small spur, slopes E.; desc. 40 ft. over NW. slope.

61.00 Wash, 10 lks. wide, 3 ft. deep, drains NE.; desc. 30 ft. along E. slope.

77.30 Wash, 15 lks. wide, 2 ft. deep, drains NE.; asc. 5 ft. over gentle SE. slope.

80.88 Point for the cor. of secs. 10, 11, 14 and 15 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R8E

S10 | S11

S15 | S14

1962

No accessories available.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 11, 12, 13 and 14.

S. 89°49' W., bet. secs. 11 and 14.

Over mountainous land.

Along S. slope.

1.50 Spur, slopes NE.; desc. 40 ft. over W. slope.

7.65 Draw, drains NW.; asc. 35 ft. over NE. slope.

9.55 Ridge, bears NW.; desc. 35 ft. over NE. slope.

14.65 S. side of clay knoll, 40 ft. high; desc. 65 ft. over SW. slope.

21.85 Wash, 10 lks. wide, 2 ft. deep, drains N.; asc. 20 ft. over E. slope.

23.15 Ridge, bears N. and S.; desc. 35 ft. over SW. slope.

26.50 Wash, 20 lks. wide, 3 ft. deep, drains NW.; asc. 35 ft. over NE. slope.

30.95 Spur, slopes NW.; desc. 35 ft. over SW. slope.

34.95 Wash, 50 lks. wide, 3 ft. deep, drains irregularly N.

35.60 Wash, 20 lks. wide, 2 ft. deep, drains N.; asc. 20 ft. over E. slope.

37.25 Spur, slopes N.; desc. 20 ft. over W. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS 40.01	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 11 and 14 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T20S R8E $\frac{1}{4}$ <u>S11</u> S14 1962</p> <p>No accessories available.</p> <p>Over gently rolling desert land.</p> <p>Asc. 5 ft. over gentle E. slope.</p> <p>46.70 Spur, slopes N.; desc. 20 ft. over gentle W. slope.</p> <p>51.25 Wash, 20 lks. wide, 3 ft. deep, drains N.; asc. 10 ft. over E. slope.</p> <p>52.40 Spur, slopes N.; desc. 10 ft. over NW. slope.</p> <p>58.95 Road, unimproved, bears N. and S.</p> <p>59.95 Wash, 50 lks. wide, 4 ft. deep, drains NE.; asc. 25 ft. over SE. slope.</p> <p>74.95 Point of spur, slopes S. desc. 5 ft. over gentle SW. slope.</p> <p>80.02 The cor. of secs. 10, 11, 14 and 15.</p> <p>Land, mountainous, east portion; gently rolling desert, west portion. Soil, clay. No timber. Undergrowth, shadscale.</p>
6.70 22.70 40.44	<p>N. $0^{\circ}05'$ E., bet. secs. 10 and 11.</p> <p>Over rolling desert land.</p> <p>Asc. 15 ft. over gentle SE. slope.</p> <p>Spur, slopes NE.; desc. 40 ft. over gentle NW. slope.</p> <p>Base of descent, bears NE. and SW.; asc. 25 ft. over gentle SE. slope.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 10 and 11 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T20S R8E $\frac{1}{4}$ S10 S11 1962</p> <p>No accessories available.</p> <p>Asc. 5 ft. over SE. slope.</p>

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
40.50	Spur, slopes E.; desc. 30 ft. over NW. slope.
44.10	Wash, 5 lks. wide, 2 ft. deep, drains E.; asc. 40 ft. over SE. slope.
48.50	Spur, slopes E.; desc. 30 ft. over N. slope.
51.70	Wash, 20 lks. wide, 4 ft. deep, drains NE.; asc. 25 ft. SE. slope.
56.30	Small spur, slopes NE.; desc. 35 ft. over N. slope.
61.40	Wash, 20 lks. wide, 2 ft. deep, drains E.; asc. 35 ft. over SE. slope.
66.50	Spur, slopes NE.; desc. 45 ft. over NW. slope.
75.50	Wash, 10 lks. wide, 2 ft. deep, drains E.; asc. 20 ft. over SE. slope.
80.88	The cor. of secs. 2, 3, 10 and 11, monumented with a sandstone, 4x5x14 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 14 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	<div style="text-align: center;"> T20S R8E <u>S3 S2</u> S10 S11 1962 </div>
	bury original stone cor. alongside iron post.
	Land, gently rolling desert.
	Soil, clay.
	No timber.
	Undergrowth, shadscale.
	From the cor. of secs. 1, 2, 11 and 12.
	N. 89°55' W., bet. secs. 2 and 11.
	Over mountainous land.
	Asc. 15 ft. over NE. slope.
1.20	Point of spur, slopes N.; desc. 15 ft. over NW. slope.
2.50	Draw, drains N.; asc. 40 ft. over E. slope.
4.75	Spur, slopes N.; asc. 5 ft. along N. slope.
7.65	Spur, slopes N.; desc. 20 ft. over NW. slope.
9.95	Draw, drains N.; asc. 15 ft. over NE. slope.
11.75	Spur, slopes N. desc. 25 ft. over NW. slope.
14.30	Draw, drains N.; asc. 50 ft. over NE. slope.
19.40	Ridge, bears N. and S.; desc. 190 ft. over steep SW. slope.
26.90	Draw, drains N.; asc. 100 ft. over NE. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
29.25	Spur, slopes N.; desc. 50 ft. over W. slope.
36.95	Wash, 20 lks. wide, 1 ft. deep, drains N.
39.30	Wash, 50 lks. wide, 3 ft. deep, drains irregularly N.; asc. 10 ft. over E. slope.
40.01	The $\frac{1}{4}$ sec. cor. of secs. 2 and 11, monumented with a sandstone, 3x10x16 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
	<p style="text-align: center;">T20S R8E $\frac{1}{4}$ $\frac{S2}{S11}$ 1962</p>
	bury original stone cor. alongside iron post, and deposit glass around iron post, 3 ins. below ground.
	N. 89°31' W., beginning new measurement.
	Over gently rolling desert land.
22.30	Wash, 10 lks. wide, 4 ft. deep, drains N.
23.65	Wash, 15 lks. wide, 4 ft. deep, drains NE.; asc. 35 ft. over gently rolling SE. slope.
40.38	The cor. of secs. 2, 3, 10 and 11.
	Land, mountainous, east portion; gently rolling desert, west portion. Soil, rocky clay, east portion; clay, west portion. Undergrowth, shadscale. No timber.
	N. 1°14' W., bet. secs. 2 and 3.
	Over rolling desert land.
	Asc. 15 ft. over SE. slope.
1.50	Ridge, bears irregularly E. and W.; desc. 25 ft. over N. slope.
8.56	Fence, bears E. and W.
12.70	Wash, 20 lks. wide, 2 ft. deep, drains E.; asc. 35 ft. over SE. slope.
19.20	Point of spur, slopes E.; desc. 30 ft. over NE. slope.
21.90	Wash, 10 lks. wide, 2 ft. deep, drains E.
24.15	Wash, 20 lks. wide, 4 ft. deep, drains SE.; asc. 55 ft. over SW. slope.
26.75	Ridge, bears irregularly E. and W.; desc. 60 ft. over N. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
30.00	Wash, 10 lks. wide, 3 ft. deep, drains E. 1.50 chs.; thence N.; asc. 45 ft. over SE. slope.
32.50	Spur, slopes sharply E. 3.00 chs. to end; desc. 85 ft. over steep NE. slope.
39.23	Point for the $\frac{1}{2}$ sec. cor. of secs. 2 and 3 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T20S R8E $\frac{1}{2}$ S3 S2 1962 No accessories available. Desc. 40 ft. over NE. slope.
46.95	Ferron Creek, 60 lks. wide, 5 ft. deep, with stream of water, 20 lks. wide, 1 ft. deep, flows irregularly E., leaving rolling desert and enter farm land.
49.05	Fence, bears N. 80° E. and S. 80° W.
51.90	Fence, bears E. and W., enter cultivated land.
54.65	Fence, bears N. 20° W. and S. 20° E., group of farm buildings bears W. 7.00 chs. dist.
63.75	Fence, bears E. and W.
66.70	Fence, bears E. and W.; leave cultivated land.
77.58	True point for the cor. of secs. 2, 3, 34 and 35, on the north boundary of the Tp., from which its witness cor. bears N. 3.15 chs. dist., hereinbefore described. Land, rolling desert, south portion; farm land, north portion. Soil, clay. Timber, scattered cottonwood trees along Ferron Creek; none other portions. Undergrowth, shadscale, south portion; willows, greasewood along Ferron Creek.
	From the standard cor. of secs. 33 and 34, on the S. bdy of the Tp. North, bet. secs. 33 and 34. Over gently rolling desert land. Desc. 20 ft. over NW. slope.
11.50	Wash, 10 lks. wide, 6 ft. deep, drains S. 80° E.; asc. 30 ft. over gently rolling SE. slope.
33.20	Road, unimproved, bears NE. and SW.
40.26	The $\frac{1}{2}$ sec. cor. of secs. 33 and 34, monumented with a sandstone, 4x16x16 ins., set, mkd. and witnessed as described in the official record.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, with brass cap mkd.

T20S R8E

$$\begin{array}{c} \frac{1}{2} \\ S33|S34 \\ 1962 \end{array}$$

bury original stone cor. alongside iron post, and deposit glass, around iron post, 3 ins. below ground.

N. $0^{\circ}13'$ W., beginning new measurement.

Asc. 50 ft. over gently rolling SE. slope.

13.60 Wash, 10 lks. wide, 4 ft. deep, drains SE.

23.10 Wash, 10 lks. wide, 4 ft. deep, drains SW.

34.90 Small spur, slopes SW.; desc. 5 ft. over NW. slope.

40.26 The cor. of secs. 27, 28, 33 and 34, monumented with a sandstone, 10x12x16 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S R8E

$$\begin{array}{c} S28|S27 \\ S33|S34 \\ 1962 \end{array}$$

bury original stone cor. alongside iron post, and deposit glass around iron post 6 ins. below ground.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 26, 27, 34 and 35.

S. $89^{\circ}53'$ W., bet. secs. 27 and 34.

Over rolling desert land, through scattered timber.

Desc. 120 ft. over W. slope.

10.50 Draw, drains S.; asc. 50 ft. over E. slope.

13.90 Spur, slopes S.; desc. 65 ft. over SW. slope.

17.90 Draw, drains S.; asc. 95 ft. over SE. slope.

29.45 Top of ascent, bears N. and S., leave scattered timber, thence over nearly level land.

38.50 Road, unimproved, bears N. and S.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

40.31

The $\frac{1}{4}$ sec. cor. of secs. 27 and 34, monumented with a sandstone, 5x10x18 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 20 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R8E

$\frac{1}{4}$ S27

S34

1962

bury original stone cor. alongside iron post.

N. $89^{\circ}53'$ W., beginning new measurement.

Asc. 25 ft. over gentle SE. slope.

28.40 Spur, slopes SW.; desc. 20 ft. over NW. slope.

31.40 Wash, 20 lks. wide, 4 ft. deep, drains SW.

33.40 Wash, 15 lks. wide, 4 ft. deep, drains SW.; asc. 15 ft. over SE. slope.

38.60 Spur, slopes SW.; desc. 20 ft. over SW. slope.

40.15 The cor. of secs. 27, 28, 33 and 34.

Land, rolling desert.

Soil, clay.

Timber, scattered scrub pinon and juniper, east portion; none, west portion.

N. $0^{\circ}12'$ E., bet. secs. 27 and 28.

Over rolling desert land.

Asc. 25 ft. over SW. slope.

4.50 Ridge, bears E. and W.; desc. 15 ft. over N. slope.

16.50 Wash, 10 lks. wide, 3 ft. deep, drains E. about 2.00 chs.; thence SE.; asc. 215 ft. over steep, rocky SE. slope.

34.20 Point of spur, slopes E.; asc. 100 ft. over steep, rocky talus SE. slope.

40.53 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 27 and 28.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 15 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$

W C

S28 \uparrow S27

1962

from which

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	<p>An X B0, 5 ft. above ground, on ledge, 50 ft. high, bears N. 1°30' W., 29 lks. dist.</p>
40.78	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 28, at proportionate dist. falls on near vertical ledge and cannot be perpetuated; there is no remaining evidence of the original cor.</p> <p>Thence by traverse, topography scaled from U.S.G.S. topographic sheets.</p> <p>Asc. abruptly 60 ft. over sandstone ledge, bears SW. and curves N.</p> <p>41.50 Top of ascent, on narrow shelf on broken, ledgy E. slope; thence along broken E. slope.</p> <p>62.00 Desc. abruptly 300 ft. over ledgy, broken NE. slope.</p> <p>65.00 Bottom of descent, curves S. and NW. to N.; thence over nearly level land.</p> <p>67.65 End traverse; asc. 50 ft. over SE. slope.</p> <p>75.60 Spur, slopes SE.; asc. 115 ft. over broken SE. slope.</p> <p>78.20 Spur, slopes SE.; desc. 40 ft. over steep NE. slope.</p> <p>79.00 Draw, drains SE.; asc. abruptly 80 ft. over steep talus SE. slope.</p> <p>81.56 Point for the cor. of secs. 21, 22, 27 and 28 at proportionate dist. falls on steep, loose talus slope and is deemed unsafe to perpetuate. There is no remaining evidence of the original cor.</p> <p>From this point, the witness cor. for secs. 21, 22, 27 and 28 bears N. 0°27' E., 0.40 chs. dist., hereinafter described.</p> <p>Land, rolling desert, south portion; broken, ledgy east slope of mesa, north portion.</p> <p>Soil, rocky clay, exposed sandstone.</p> <p>No timber.</p> <p>Undergrowth, shadscale.</p>
40.20	<p>From the cor. of secs. 22, 23, 26 and 27.</p> <p>N. 89°24' W., bet. secs. 22 and 27.</p> <p>Over nearly level desert land.</p> <p>The $\frac{1}{4}$ sec. cor. of secs. 22 and 27, monumented with a sandstone, 2x10x14 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T20S R8E $\frac{1}{4}$ $\frac{S22}{S27}$ 1962</p> <p>bury original stone cor. alongside iron post; raise a mound of stone 3 ft. base, 1½ ft. high, N. of cor.</p>

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

N. 89°39' W., beginning new measurement.

0.50 Road, improved dirt, bears N. 35° W. and S. 55° E.

35.00 Leave nearly level desert; asc. abruptly 200 ft. over steep, broken talus SE. slope.

40.04 True point for the cor. of secs. 21, 22, 27 and 28.

Land, nearly level desert except west 5.00 chs. which is broken east rim of mesa.

Soil, clay.

No timber.

Undergrowth, shadscale.

N. 0°27' E., bet. secs. 21 and 22.

Over broken desert land.

Asc. 20 ft. over steep talus SE. slope.

0.40 Point selected for the witness cor. of secs. 21, 22, 27 and 28, at base of ledge, 60 ft. high, bears SW. curving SE., and NE. curving north.

Set an iron post, 30 ins. long, 2½ ins. diam., 15 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

S21|S22

S28|S27

W C

1962

Asc. abruptly 60 ft. over sandstone ledge.

2.00 Rim of mesa, bears NE. curving north and SW. curving SE.; desc. 85 ft. over NW. slope.

30.10 Wash, 15 lks. wide, 2 ft. deep, drains NW.; asc. 35 ft. over SW. slope.

34.00 Rocky, flat spur, slopes NW.; desc. 10 ft. over NW. slope.

36.30 Rim of mesa, bears irregularly NE. and SW.; desc. 60 ft. over N. slope.

38.00 Draw, drains NW. 1.00 ch., thence N.; asc. 30 ft. over SW. slope.

40.78 The ¼ sec. cor. of secs. 21 and 22, monumented with a sandstone, 5x14x30 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

¼

S21|S22

1962

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	bury original stone cor. alongside iron post.
	N. 0°18' E., beginning new measurement.
	Desc. 40 ft. over NW. slope.
5.50	Top of ledge, 15 ft. high, bears NE. and SW.; desc. abruptly 120 ft. over NW. slope.
13.60	Wash, 5 lks. wide, 3 ft. deep, drains NW.; asc. 40 ft. over SW. slope.
18.50	Spur, slopes W.; desc. 85 ft. over N. slope.
26.15	Road, improved dirt, bears E. and W.; desc. 10 ft. over gentle N. slope.
27.80	Wash, 30 lks. wide, 4 ft. deep, drains irregularly E.; asc. 80 ft. over SE. slope.
36.20	Top of ledge, 20 ft. high, bears NE. and SW.; asc. 20 ft. over gentle SE. slope.
39.50	Spur, slopes E.
40.20	The cor. of secs. 15, 16, 21 and 22, monumented with a sandstone, 6x14x26 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T20S R8E S16 S15 S21 S22 1962
	bury original stone cor. alongside iron post.
	Land, rolling mesa top, south portion; broken, mountainous, north portion. Soil, rocky clay. No timber. Undergrowth, shadscale.
	From the cor. of secs. 14, 15, 22 and 23.
	N. 89°43' W., bet. secs. 15 and 22.
	Over rolling desert land.
	Asc. 65 ft. over rolling SE. slope.
7.50	Wash, 15 lks. wide, 5 ft. deep, drains SE.
8.10	Wash, 25 lks. wide, 4 ft. deep, drains SE.
28.90	Spur, slopes S.; desc. 20 ft. over W. slope.
31.90	Wash, drains S.; asc. 15 ft. over E. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

34.90	Spur, slopes S.; desc. 20 ft. over SW. slope.
37.00	Wash, drains S.; asc. 15 ft. over NE. slope.
39.65	The $\frac{1}{4}$ sec. cor. of secs. 15 and 22, monumented with a limestone, 8x10x14 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
	T20S R8E
	$\frac{1}{4}$ $\frac{S15}{S22}$
	1962
	bury original stone cor. alongside iron post.
	<hr/>
	N. 89°44' W., beginning new measurement.
	Asc. 40 ft. over SE. slope.
6.00	Spur, slopes S.; desc. 60 ft. over SW. slope.
8.45	Wash, drains SE.; asc. 80 ft. over SE. slope.
17.45	Spur, slopes NW.; desc. 60 ft. over SW. slope.
21.40	Wash, drains SE.; asc. 20 ft. over NE. slope.
25.40	Spur, slopes NW.; desc. 15 ft. over SW. slope.
27.40	Wash, drains SE.; asc. 40 ft. over NE. slope.
29.50	Spur, slopes SE.; desc. 5 ft. over SW. slope.
32.30	Base of descent; asc. 95 ft. over steep, broken E. slope.
36.70	Top of ledge, 20 ft. high, bears NW. and SW.; asc. 40 ft. over SE. slope.
40.34	The cor. of secs. 15, 16, 21 and 22.
	Land, rolling desert, east portion; mountainous, west portion.
	Soil, rocky clay.
	No timber.
	Undergrowth, shadscale.
	<hr/>
	N. 0°01' E., bet. secs. 15 and 16.
	Over rolling mesa top.
	Desc. 30 ft. over NE. slope.
11.50	Draw, drains SE.; asc. 60 ft. over SW. slope.
15.20	Rim of mesa, ledge, 10 ft. high, bears NW. and SE.; desc. 50 ft. over gentle NW. slope of mesa.
22.90	Enter scattered pinon and juniper timber, bears E. and W.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS
40.51

The $\frac{1}{4}$ sec. cor. of secs. 15 and 16, monumented with a sandstone, 4x10x12 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 2 ins. in the ground, to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$

S16|S15

1962

bury original stone cor. alongside iron post.

N. $0^{\circ}03'$ E., beginning new measurement.

Desc. 130 ft. over gentle NW. slope.

24.00 Leave scattered timber, bears E. and SW.

32.65 Wash, 10 lks. wide, 1 ft. deep, drains irregularly W.; asc. 15 ft. over SW. slope.

36.50 Small spur, slopes W.; desc. 15 ft. over NW. slope.

37.50 Wash, 10 lks. wide, 1 ft. deep, drains W.; asc. 20 ft. over S. slope.

40.28 The cor. of secs. 9, 10, 15 and 16, monumented with a sandstone, 4x12x16 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

S9|S10

S16|S15

1962

bury original stone cor. alongside iron post.

Land, rolling mesa top.

Soil, shallow sandy clay, rocky.

Timber, scattered scrub pinon and juniper, central portion.

Undergrowth, shadscale, small sagebrush.

From the cor. of secs. 10, 11, 14 and 15.

N. $89^{\circ}51'$ W., bet. secs. 10 and 15.

Over nearly level land.

By triangulation; asc. about 15 ft. over gently rolling SE. slope.

14.00 Base of steep ascent, bears N. and S.; asc. abruptly over ledgy E. slope of mesa rim.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

- 21.65 Top of ledge, about 150 ft. high, rim of mesa, bears N. and S., end triangulation. Desc. 70 ft. over NW. slope.
- 33.55 Draw, drains NE.; asc. 50 ft. over SW. slope.
- 35.15 Spur, slopes N.; desc. 10 ft. over W. slope.
- 40.03 The $\frac{1}{2}$ sec. cor. of secs. 10 and 15, monumented with a sandstone, 5x12x16 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 14 ins. in the ground, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T20S R8E
 $\frac{1}{2}$ S10
S15
1962
- bury original stone cor. alongside iron post.
-
- N. 89°39' W., beginning new measurement.
- Desc. 25 ft. over W. slope.
- 3.30 Wash, 50 lks. wide, 4 ft. deep, drains N.; asc. 10 ft. over E. slope.
- 6.60 Wash, 10 lks. wide, 1 ft. deep, drains NE.; asc. 10 ft. over gentle W. slope.
- 12.30 Base of steep ascent; bears N. and S.; asc. 30 ft. over steep E. slope.
- 14.80 Spur, slopes N., about 6.00 chs. to end; desc. 95 ft. over W. slope.
- 21.30 Wash, 30 lks. wide, 4 ft. deep, drains N.; asc. 60 ft. over E. slope.
- 29.00 Top of ascent, bears N. and S.; desc. 25 ft. over W. slope.
- 40.28 The cor. of secs. 9, 10, 15 and 16.
- Land, nearly level, east portion; broken central portion, and rolling mesa land, west portion.
- Soil, clay, rocky.
- No timber.
- Undergrowth, shadscale.
-
- N. 0°04' W., bet. secs. 9 and 10.
- Over rolling mesa top.
- Asc. 25 ft. over SW. slope.
- 4.00 Spur, slopes W.; desc. 20 ft. over gentle NW. slope.
- 10.80 Rim of mesa, bears NE. and SW.; desc. 100 ft. over rocky NW. slope.
- 23.90 Wash, 15 lks. wide, 3 ft. deep, drains NE.; asc. 60 ft. over SE. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS		
32.60	Rim of mesa spur, bears NE. and SW., ledge, 10 ft. high; desc. 10 ft. over gentle NW. slope.	
40.24	The $\frac{1}{2}$ sec. cor. of secs. 9 and 10, monumented with a sandstone, 4x10x17 ins., set, mkd. and witnessed as described in the official record.	
	At the cor. point	
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.	
	<div style="text-align: center;"> T20S R8E $\frac{1}{2}$ S9 S10 1962 </div>	
	bury original stone cor. alongside iron post.	
	N. 0°04' W., beginning new measurement.	
	Desc. 95 ft. over NW. changing to W. slope.	
34.10	Wash, 10 lks. wide, 2 ft. deep, drains W.	
40.28	The cor. of secs. 3, 4, 9 and 10, monumented with a sandstone, 6x8x16 ins., set, mkd. and witnessed as described in the official record.	
	At the cor. point	
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.	
	<div style="text-align: center;"> T20S R8E S4 S3 S9 S10 1962 </div>	
	bury original stone cor. alongside iron post.	
	Land, gently rolling mesa top.	
	Soil, shallow sandy clay.	
	No timber.	
	Undergrowth, shadscale.	
	From the cor. of secs. 2, 3, 10 and 11.	
	N. 89°57' W., bet. secs. 3 and 10.	
	Over gently rolling desert land.	
9.30	Wash, 10 lks. wide, 4 ft. deep, drains N. 20° E.	
15.45	Wash, 10 lks. wide, 4 ft. deep, drains N. 20° E.	

CHAINS	
16.20	Fence, bears N. 10° E. and S. 10° W.
27.00	Wash, 15 lks. wide, 4 ft. deep, drains N. 20° E.
31.10	Wash, 30 lks. wide, 5 ft. deep, drains N. 20° W.
34.40	Wash, 20 lks. wide, 4 ft. deep, drains irregularly E.; asc. 20 ft. over SE. slope.
36.70	Wash, 10 lks. wide, 2 ft. deep, drains SE.; asc. 30 ft. over E. slope.
40.36	The $\frac{1}{2}$ sec. cor. of secs. 3 and 10, monumented with a sandstone, 4x10x16 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground, and in a mound of stone, 5 ft. base to top, with brass cap mkd.
	<p>T20S R8E</p> <p>$\frac{1}{2}$ $\frac{S3}{S10}$</p> <p>1962</p>
	bury original stone cor. alongside iron post.
	N. 89°56' W., beginning new measurement.
	Asc. 25 ft. over E. slope.
0.60	Top of ascent, bears N. and S.; desc. 45 ft. over gentle W. slope.
22.90	Wash, 10 lks. wide, 1 ft. deep, drains irregularly N.; asc. 55 ft. over NE. slope.
28.20	Top of ascent, bears NW. and SE.; desc. 35 ft. over gentle W. slope.
40.19	The cor. of secs. 3, 4, 9 and 10.
	<p>Land, gently rolling desert, east portion; rolling mesa top, west portion.</p> <p>Soil, clay.</p> <p>No timber.</p> <p>Undergrowth, shadscale.</p>

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

N. 2°48' W., bet. secs. 3 and 4.

Over gently rolling W. slope of mesa.

Desc. 20 ft. along gentle W. slope.

2.10 Wash, 10 lks. wide, 3 ft. deep, drains W.

16.45 North rim of mesa, bears SW. and E.; desc. 120 ft. over broken NW. slope.

28.55 Fence, bears N. 20° W. and S. 20° E., thence over level creek bottom.

36.75 Ferron Creek, with stream of water, 40 lks. wide, 1 ft. deep, flows E. from irregularly SW.

38.14 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 4 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$
S4 | S3
1962

No accessories available.

41.15 Bend in Ferron Creek, flows irregularly E. from SE.; asc. 35 ft. over gentle SE. slope.

47.80 Irrigation ditch, 8 lks. wide, 2 ft. deep, drains N. 60° E.

48.20 Fence, bears S. 60° W. and curves E.

51.65 Road, unimproved, bears irregularly E. and W.; asc. 110 ft. over SW. slope.

61.15 Ridge, bears irregularly E. and W.; desc. 70 ft. over N. slope.

65.35 Wash, 15 lks. wide, 4 ft. deep, drains E.; asc. 40 ft. over SE. slope.

68.75 Point of spur, slopes sharply E. desc. 40 ft. over NE. slope.

74.55 Wash, 10 lks. wide, 1 ft. deep, drains SE.; asc. 50 ft. over SW. slope.

76.43 The cor. of secs. 3, 4, 33 and 34, on the N. bdy. of the Tp., hereinbefore described.

Land, mountainous.

Soil, rocky, loamy clay.

No timber.

Undergrowth, shadscale, with scattered brush in creek bottom.

From the standard cor. of secs. 32 and 33, on the S. bdy. of the Tp., hereinbefore described.

N. 0°15' E., bet. secs. 32 and 33.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	Over level desert land, through scattered greasewood, by triangulation.
9.50	Base of steep ascent, bears E. and W.; asc. abruptly about 300 ft. over precipitous and broken S. slope.
15.70	Point of ledge, 50 ft. high, mesa rim, bears W. and NW., end of one triangulation, beginning of another. Desc. abruptly about 250 ft. over precipitous and broken NE. slope.
26.50	Draw, in bottom of cove, drains E.; asc. about 240 ft. over precipitous and broken SE. slope.
37.50	Rim of mesa, ledge, 40 ft. high, bears SW. and NE., thence along gentle W. slope.
41.52	The $\frac{1}{2}$ sec. cor. of secs. 32 and 33, monumented with a sandstone, 3x12x16 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.
	<p style="text-align: center;">T20S R8E $\frac{1}{2}$ S32 S33 1962</p>
	bury original stone cor. alongside iron post, and deposit glass around iron post, 3 ins. below ground.
	raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
	N. 0°14' E., beginning new measurement.
	Along gentle W. slope of mesa top.
17.80	Enter scattered timber, bears E. and W.
40.39	The cor. of secs. 28, 29, 32 and 33, monumented with a sandstone, 3x14x22 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
	<p style="text-align: center;">T20S R8E S29 S28 S32 S33 1962</p>
	bury original stone cor. alongside iron post.
	<p>Land, broken, mountainous, south portion; gentle west slope of mesa, north portion. Soil, shallow, rocky, sandy clay. Timber, scattered pinon and juniper, north portion. No timber south portion. Undergrowth, greasewood, south portion; shadscale, north portion.</p>

Dependent: Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
	<p>From the cor. of secs. 27, 28, 33 and 34.</p> <p>N. 88°48' W., bet. secs. 28 and 33.</p> <p>Over mountainous, broken land.</p> <p>Desc. 10 ft. over SW. slope.</p>
4.60	Wash, 10 lks. wide, 1 ft. deep, drains SE.
6.20	Wash, 15 lks. wide, 4 ft. deep, drains SE.; asc. 215 ft. over steep, broken SE. slope.
24.70	Point of mesa spur, slopes S., ledge, 20 ft. high; desc. 70 ft. over ledgy SW. slope.
29.00	Bottom of descent, thence along steep, talus S. slope.
40.28	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 33 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T20S R8E $\frac{1}{4}$ $\frac{S28}{S33}$ 1962</p> <p>No accessories available.</p> <p>Continue along steep, S. slope.</p>
42.00	Asc. abruptly 50 ft. over ledgy SE. slope.
45.00	Top of ledge, 20 ft. high, bears SW. and curves E.; asc. 50 ft. over SE. slope.
52.00	Top of ascent, ledge, 10 ft. high, bears NE. and SW.; desc. 60 ft. over gentle W. slope.
67.45	Road, unimproved, bears N. 30° E. and S. 80° W.; desc. 20 ft. over gentle W. slope; enter scattered timber, bears NE. and SW.
80.56	<p>The cor. of secs. 28, 29, 32 and 33.</p> <p>Land, mountainous, broken, east portion; gently sloping mesa, west portion.</p> <p>Soil, rocky clay, exposed sandstone.</p> <p>Timber, scattered pinon and juniper, west portion; no timber, east portion.</p> <p>Undergrowth, shadscale.</p>
	<p>N. 0°13' E., bet. secs. 28 and 29.</p> <p>Over rolling mesa land through scattered timber.</p> <p>Desc. 10 ft. over N. slope.</p>
0.80	Wash, 15 lks. wide, 2 ft. deep, drains W.; asc. 10 ft. along W. slope.
16.60	Wash, 10 lks. wide, 1 ft. deep, drains W.
26.80	Wash, 10 lks. wide, 1 ft. deep, drains W.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

- 36.80 Wash, 15 lks. wide, 2 ft. deep, drains W.
- 40.46 The $\frac{1}{2}$ sec. cor. of secs. 28 and 29, monumented with a sandstone, 10x14x24 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid stone, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
- T20S R8E
 $\frac{1}{2}$
S29 | S28
1962
- bury original stone cor. alongside iron post.
-
- N. $0^{\circ}27'$ E., beginning new measurement.
- Desc. 75 ft. over gentle NW. slope.
- 8.40 Road, unimproved, bears NE. and SW.
- 28.90 Wash, 10 lks. wide, 2 ft. deep, drains NW.
- 32.60 Leave timber, bears NW. and SE.
- 40.52 The cor. of secs. 20, 21, 28 and 29, monumented with a sandstone, 6x20x28 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, with brass cap mkd.
- T20S R8E
S20 | S21
S29 | S28
1962
- bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, W. of cor.
- Land, rolling mesa land.
Soil, shallow, rocky clay.
Timber, scattered pinon and juniper.
Undergrowth, shadscale, sagebrush.
-
- From the true point for the cor. of secs. 21, 22, 27 and 28.
- N. $88^{\circ}53'$ W., bet. secs. 21 and 28.
- Over broken mesa land.
- By triangulation; asc. abruptly about 100 ft. over precipitous SE. slope.
- 2.50 Mesa rim, ledge, 60 ft. high, bears NE. and SW.; desc. 50 ft. over NW. slope.
- 13.70 Head of draw, drains N.; asc. 30 ft. over NE. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
15.00	Spur, slopes N.; desc. 5 ft. over gentle W. slope.
16.75	Top of ledge, 10 ft. high, bears N. and S.; desc. 135 ft. over broken W. slope.
22.50	Draw, drains N.; asc. 120 ft. over broken E. slope.
26.20	Top of ledge, spur, bears N. and S.; desc. 20 ft. over gentle W. slope; enter timber.
40.01	The $\frac{1}{4}$ sec. cor. of secs. 21 and 28, monumented with a sandstone, 6x12x18 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.
	T20S R8E
	$\frac{1}{4}$ $\frac{S21}{S28}$
	1962
	bury original stone cor. alongside iron post.
	N. 89°36' W., beginning new measurement.
	Asc. 25 ft. over rocky E. slope.
9.50	Rocky ridge, bears N. and S.; desc. 35 ft. over rocky W. slope.
10.50	Base of rocky ridge,; desc. 20 ft. over gentle W. slope.
21.20	Top of ledge, 5 ft. high, bears NW. and SE.; desc. 40 ft. over SW. slope. Leave timber, bears NW. and SE.
25.20	Wash, 10 lks. wide, 1 ft. deep, drains NW.; asc. 35 ft.
29.20	Spur, slopes NW.; desc. 70 ft. over SW. slope.
38.10	Wash, 20 lks. wide, 1 ft. deep, drains irregularly N.; asc. 10 ft. over E. slope.
38.50	Top of ascent, slopes NW., thence over level land.
40.39	The cor. of secs. 20, 21, 28 and 29.
	Land, mountainous. Soil, rocky clay, exposed sandstone. Timber, scattered pinon and juniper, central portion; no timber, east or west portions.
	N. 0°49' E., bet. secs. 20 and 21.
	Over mountainous land.
	Desc. 10 ft. over NW. slope.
0.50	Road, unimproved, bears NE. and SW.
3.90	Wash, 15 lks. wide, 5 ft. deep, drains N. 20° E.; asc. 50 ft. over SE. slope.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

- 6.60 Road, improved dirt, bears NE. and SW.
- 9.80 Top of ascent, ledge, 5 ft. high, bears NE. and SW.; desc. 75 ft. over gentle NW. slope. Enter timber, bears NE. and SW.
- 40.54 Point for the $\frac{1}{2}$ sec. cor. of secs. 20 and 21 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid stone, and in a mound of stone, 6 ft. base to top, with brass cap mkd.
- T20S R8E
 $\frac{1}{2}$
S20|S21
1962
- No accessories available.
- Desc. 10 ft. along W. slope.
- 43.70 Leave dense timber, bears NE. and W.; desc. 70 ft. over NW. slope.
- 49.30 Wash, 30 lks. wide, 1 ft. deep, drains N. 10° W.; desc. 55 ft. over NW. slope.
- 65.60 Wash, 15 lks. wide, 2 ft. deep, drains N. 80° W.; desc. 30 ft. along W. slope.
- 72.30 Wash, 10 lks. wide, 1 ft. deep, drains W.
- 81.08 The cor. of secs. 16, 17, 20 and 21, monumented with a sandstone, 8x10x18 ins., firmly set, dimly mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
- T20S R8E
S17|S16
S20|S21
1962
- bury original stone cor. alongside iron post, and deposit glass around iron post, 6 ins. below ground.
- Land, mountainous.
Soil, rocky, sandy clay.
Timber, dense pinon and juniper, south portion; no timber, north portion.
Undergrowth, shadscale.
- From the cor. of secs. 15, 16, 21 and 22.
- N. $89^{\circ}06'$ W., bet. secs. 16 and 21.
- Over rolling mesa land.
- Asc. 60 ft. over SE. slope.
- 2.60 Rim of mesa, bears NE. and SW.; desc. 25 ft. over NW. slope.

Dependent Resurvey of the Subdivision of Township 20 S., R. 8 E.

CHAINS	9.50 Wash, 10 lks. wide, 1 ft. deep, drains NW.; asc. 10 ft. over NE. slope.
22.50	Spur, slopes NW.; desc. 35 ft. over SW. slope. Enter scattered timber.
24.65	Wash, 10 lks. wide, 1 ft. deep, drains NW.; asc. 10 ft. over NE. slope.
31.00	Low rocky ridge, bears NW. and S.; desc. 15 ft. over gentle SW. slope.
39.86	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 16 and 21 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid sandstone, and in a mound of stone, $4\frac{1}{2}$ ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T20S R8E $\frac{1}{4}$ $\frac{S16}{S21}$ 1962</p> <p>Desc. 10 ft. over gentle SW. slope.</p>
42.30	Wash, 30 lks. wide, 1 ft. deep, drains irregularly N.; asc. 10 ft. over E. slope.
43.40	Spur, slopes N.; desc. 120 ft. over rolling NW. slope. Leave timber.
48.75	Wash, 15 lks. wide, 3 ft. deep, drains NW.
56.50	Wash, 25 lks. wide, 2 ft. deep, drains NW.; asc. 20 ft. over NE. slope.
65.00	Spur, slopes NW.; desc. 40 ft. over SW. slope.
67.20	Wash, drains N.
68.50	Wash, 20 lks. wide, 2 ft. deep, drains NW.; asc. 30 ft. over NE. slope.
74.70	Spur, slopes NW.; desc. 25 ft. over SW. changing to W. slope.
79.72	<p>The cor. of secs. 16, 17, 20 and 21.</p> <p>Land, rolling mesa. Soil, rocky, gravelly clay, considerable exposed sandstone. Timber, scattered pinon and juniper, central portion; no timber, east and west portions.</p>
	<p style="text-align: center;">Reestablishment of the Survey Executed by A.D. Ferron, in 1873</p> <hr/> <p>N. $1^{\circ}41'$ W., bet. secs. 16 and 17.</p> <p>Over rolling west slope of mesa, through widely scattered serviceberry bushes and timber.</p> <p>Desc. 90 ft. along W. slope of mesa.</p>

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS
36.54

Point for the $\frac{1}{4}$ sec. cor. of secs. 16 and 17 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

$$\begin{array}{c} \frac{1}{4} \\ S17|S16 \\ 1962 \end{array}$$

Desc. 35 ft. along W. slope.

53.60 Draw, drains W.; asc. 10 ft. over SE. slope.

62.10 Top of ascent, slopes NW.; desc. 30 ft. over NW. slope.

70.60 Top of ledge, 20 ft. high, on E. side of Ferron Creek, bears NE. and SW.; desc. abruptly 30 ft. over broken NW. slope.

73.08 Point for the cor. of secs. 8, 9, 16 and 17 at proportionate dist. longitudinally and by extension of property line fence to the W. which terminates 3 chs. W., and has long been accepted as being on the sec. line.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R8E

$$\begin{array}{c} S8|S9 \\ S17|S16 \\ 1962 \end{array}$$

raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, rolling west slope of mesa.

Soil, shallow sand, with considerable exposed sandstone.

Timber, widely scattered scrub juniper.

Undergrowth, shadscale and widely scattered serviceberry.

From the cor. of secs. 9, 10, 15 and 16.

S. $85^{\circ}22'$ W., bet. secs. 9 and 16.

Over rolling mesa land.

2.10 Top of ledge, 5 ft. high, bears N. and SE.; desc. 60 ft. over SW. slope.

13.95 Wash, 20 lks. wide, 4 ft. deep, drains NW.; desc. 10 ft. over SW. slope.

18.55 Wash, 20 lks. wide, 3 ft. deep, drains NE.; asc. 50 ft. over E. slope.

26.05 Top of ascent, bears N. and S.; desc. 35 ft. over gentle W. slope.

41.03 Point for the $\frac{1}{4}$ sec. cor. of secs. 9 and 16 at proportionate dist.; there is no remaining evidence of the original cor.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground, to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$ $\frac{S9}{S16}$
1962

Desc. 160 ft. over rolling SW. slope.

80.15 Top of ledge, 30 ft. high, on E. side of Ferron Creek, bears N. and SW.; desc. abruptly over NW. slope.

82.06 The cor. of secs. 8, 9, 16 and 17.

Land, rolling west slope of mesa.
Soil, shallow sand, exposed sandstone.
No timber.
Undergrowth, shadscale and brush.

N. $1^{\circ}36'$ E., bet. secs. 8 and 9.

Over rolling land.

0.95 Ferron Creek, with stream of water, 20 lks. wide, 1 ft. deep, flows irregularly NE. from irregularly SW.; asc. 20 ft. over SE. slope.

3.00 West bank of Ferron Creek; asc. 60 ft. over gentle SE. slope; enter scattered rabbit brush.

39.10 Spur, slopes E.; desc. 25 ft. over NE. slope.

41.08 Point for the $\frac{1}{4}$ sec. cor. of secs. 8 and 9 at cor. of property line fences to N. and W., and is accepted as the best evidence of the position of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$
S8 | S9
1962

No accessories available.

N. $1^{\circ}44'$ W., beginning new measurement.

Desc. 40 ft. over NE. slope, along fence line.

5.50 Leave fence, bears NE.

6.05 Road, unimproved, bears W. and irregularly N.; thence over rolling desert land.

6.55 Wash, 50 lks. wide, 4 ft. deep, drains E.

28.30 Same road, bears NE.

28.50 Irrigation ditch, 5 lks. wide, 1 ft. deep, drains NE.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

40.29

Point for the cor. of secs. 4, 5, 8 and 9 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

$$\begin{array}{r} \text{S5} | \text{S4} \\ \hline \text{S8} | \text{S9} \\ 1962 \end{array}$$

No accessories available.

Land, rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale and rabbit brush.

From the cor. of secs. 3, 4, 9 and 10.

S. $86^{\circ}00'$ W., bet. secs. 4 and 9.

Over rolling mesa land.

Desc. 50 ft. over gentle NW. slope.

21.10 Draw, 20 ft. deep, drains NW.; desc. 20 ft. over NW. slope.

29.50 Draw, 15 ft. deep, drains NW.; desc. 15 ft. over NW. slope.

35.20 Top of ledge, 30 ft. high, bears N. and S.; desc. abruptly over W. slope.

37.00 Bottom of descent, thence over level meadow land.

40.98 Point for the $\frac{1}{4}$ sec. cor. of secs. 4 and 9 at proportionate dist., there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R8E

$$\begin{array}{r} \frac{1}{4} \frac{\text{S4}}{\text{S9}} \\ 1962 \end{array}$$

raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, N. of cor.

41.80 Leave meadow, ascend 15 ft. over E. slope.

42.50 Spur, slopes N., thence over level land, enter willow and greasewood.

43.92 Fence, bears N. and S.

54.40 Ferron Creek, 40 lks. wide, 1 ft. deep, flows NE.

56.50 Leave willows and greasewood; asc. 60 ft. over gentle SE. slope.

81.96 The cor. of secs. 4, 5, 8 and 9.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	<p>Land, rolling mesa, east portion; gently rolling, west portion. Soil, sandy clay. No timber. Undergrowth, shadscale, east portion; grass, greasewood and willows, along creek bottom.</p>
	<p>N. 1°55' W., bet. secs. 4 and 5. Over rolling desert land. Desc. 35 ft. over gently rolling NE. slope. 2.12 Fence, bears NW. and SE. 17.27 Fence, bears NE. and SW. 26.40 Wash, 30 lks. wide, 5 ft. deep, drains SE.; asc. 150 ft. over SW. slope. 39.20 Rim of mesa, bears NW. and SE.; desc. 10 ft. over N. slope. 40.29 Point for the $\frac{1}{4}$ sec. cor. of secs. 4 and 5 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p>
	<p>T20S R8E $\frac{1}{4}$ S5 S4 1962</p>
	<p>No accessories available. Desc. 25 ft. over N. slope. 41.70 Wash, 10 lks. wide, 1 ft. deep, drains E.; asc. 20 ft. over S. slope. 45.90 Top of ascent, bears E. and W.; desc. 40 ft. over N. slope. 50.70 Draw, drains E.; asc. 40 ft. over S. slope. 61.40 Top of ascent, bears E. and NW.; desc. 70 ft. over rolling NE. slope. 80.72 The cor. of secs. 4, 5, 32 and 33, on the N. bdy. of the Tp.</p>
	<p>Land, rolling desert, south portion; rolling mesa, north portion. Soil, sandy clay. No timber. Undergrowth, shadscale.</p>
	<p>Reestablishment of the Survey Executed By A. D. Ferron, in 1882</p>
	<p>From the standard cor. of secs. 31 and 32 on the S. bdy. of the Tp., hereinbefore described.</p>

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

N. 0°51' E., bet. secs. 31 and 32.

Over rolling desert land.

Desc. 25 ft. over gently rolling NE. slope.

27.60 Wash, 10 lks. wide, 1 ft. deep, drains NW.; asc. 10 ft. along W. slope.

38.70 Spur, slopes NW.; desc. 25 ft. over NE. slope.

42.54 The $\frac{1}{2}$ sec. cor. of secs. 31 and 32, monumented with a sandstone, 3x10x24 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long; 2 $\frac{1}{2}$ ins. diam., 4 ins. in the ground, to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{2}$
S31|S32
1962

bury original stone cor. alongside iron post.

N. 0°47' W., beginning new measurement.

Desc. 45 ft. over gently rolling NW. slope.

6.40 Wash, 15 lks. wide, 2 ft. deep, drains N. 30° W.

13.80 Wash, 20 lks. wide, 8 ft. deep, drains irregularly N.

20.10 Same wash, drains irregularly N.

22.40 Same wash, drains irregularly NW.

29.60 Wash, 30 lks. wide, 10 ft. deep, drains N.

33.65 Leave wash, drains NW.

33.76 The cor. of secs. 29, 30, 31 and 32, monumented with a sandstone, 3x6x10 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S R8E

S30|S29
S31|S32
1962

bury original stone cor. alongside iron post.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

From the cor. of secs. 28, 29, 32 and 33.

S. 84°01' W., bet. secs. 29 and 32.

Over rolling desert land, through scattered timber.

Desc. 120 ft. over gentle W. slope.

18.00 Leave scattered timber, bears N. and S.

40.62 Point for the $\frac{1}{4}$ sec. cor. of secs. 29 and 32 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, $4\frac{1}{2}$ ft. base to top, with brass cap mkd.

T20S R8E

$\frac{1}{4}$ $\frac{S29}{S32}$
1962

Desc. 120 ft. over gentle west slope.

42.10 Road, unimproved, bears N. 10° W. and S. 10° E.

77.45 Wash, 10 lks. wide, 3 ft. deep, drains N. 15° W.

79.05 Wash, 20 lks. wide, 3 ft. deep, drains N.

80.80 Wash, 50 lks. wide, 5 ft. deep, drains N. 10° E.

81.24 The cor. of secs. 29, 30, 31 and 32.

Land, gently rolling desert.

Soil, shallow sandy clay.

Timber, scattered pinon and juniper, east portion; no timber, west portion.

Undergrowth, shadscale.

S. 89°24' W., bet. secs. 30 and 31.

Over gently rolling desert land.

0.20 Wash, 10 lks. wide, 3 ft. deep, drains NW.

0.75 Wash, 30 lks. wide, 5 ft. deep, drains irregularly N.; asc. 20 ft. over gentle E. slope.

7.25 Top of small ridge, bears E. and W., thence over nearly level land.

10.95 Road, unimproved, bears N. and S.

32.95 Wash, 10 lks. wide, 2 ft. deep, drains NE.

40.43 The $\frac{1}{4}$ sec. cor. of secs. 30 and 31, monumented with a sandstone, 2x9x12 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R8E

$\frac{1}{4}$ $\frac{S30}{S31}$
1962

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

bury original stone cor. alongside iron post, and deposit glass around iron post, 6 ins. below ground.

S. 89°29' W., beginning new measurement.

Over gently rolling desert land.

0.80 Wash, 5 lks. wide, 1 ft. deep, drains N. 80° E.

17.30 Wash, 10 lks. wide, 3 ft. deep, drains N. 65° W.

18.40 Wash, 10 lks. wide, 3 ft. deep, drains N. 65° W.

24.10 Draw, 100 lks. wide, 50 ft. deep, drains N. 15° E.

32.10 Draw, 60 lks. wide, 25 ft. deep, drains N. 20° E.

40.04 The cor. of secs. 25, 30, 31 and 36, on the W. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the E. bdy. of T. 20 S., R. 7 E.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 29, 30, 31 and 32.

N. 1°32' E., bet. secs. 29 and 30.

Over gently rolling desert land.

Desc. 15 ft. over gentle NW. slope.

1.00 Wash, 35 lks. wide, 6 ft. deep, drains N. 25° E.

11.50 Wash, 20 lks. wide, 2 ft. deep, drains irregularly N.; asc. 50 ft. over gentle SE. slope.

18.00 Old fence, bears E. and W.

26.90 Fence, bears N. 40° E. and S. 40° W.

37.60 Spur, slopes irregularly N.; desc. 20 ft. over NE. slope.

39.75 Point for the ¼ sec. cor. of secs. 29 and 30 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 15 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T20S R8E

¼

S30|S29

1962

Desc. 70 ft. over NE. slope.

59.95 Wash, 10 lks. wide, 2 ft. deep, drains NE., thence over nearly level land.

79.50 The cor. of secs. 19, 20, 29 and 30, monumented with a sandstone, 3x14x18 ins., set, dimly mkd. and witnessed as described in the official record.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CREAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E
 $\frac{S19}{S30} \frac{S20}{S29}$
 1962

bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, W. of cor.

Land, gently rolling desert.

Soil, clay.

No timber.

Undergrowth, shadscale.

From the cor. of secs. 20, 21, 28 and 29.

S. $82^{\circ}46'$ W., bet. secs. 20 and 29.

Over rolling land.

- 0.20 Road, unimproved, bears NE. and SW.
- 2.00 Wash, 10 lks. wide, 2 ft. deep, drains NE.; asc. 50 ft. over SE. slope.
- 3.00 Road, improved dirt, bears NE. and SW.
- 5.40 Top of ascent, ledge, 5 ft. high, bears NE. and SW.; desc. 180 ft. over W. slope. Enter medium timber.
- 39.89 Point for the $\frac{1}{4}$ sec. cor. of secs. 20 and 29 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground, to bedrock, and in a mound of stone, 5 ft. base to top, with brass cap mkd.
- T20S R8E
 $\frac{S20}{\frac{1}{4} S29}$
 1962
- Desc. 15 ft. over SW. slope.
- 43.40 Wash, 10 lks. wide, 1 ft. deep, drains NW.; asc. 15 ft. over NE. slope.
- 52.00 Spur, slopes NW.; leave timber, bears NE. and SE.; desc. 60 ft. over SW. slope.
- 69.50 Wash, 15 lks. wide, 2 ft. deep, drains NW.
- 72.50 Road, improved dirt, bears NW. and SE.
- 75.00 Wash, 30 lks. wide, 4 ft. deep, drains N.
- 79.78 The cor. of secs. 19, 20, 29 and 30.

Land, rolling.

Soil, rocky, shallow, gravelly clay.

Timber, medium dense pinon and juniper, east portion; no timber, west portion.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	Undergrowth, shadscale.
	<p>N. 89°39' W., bet. secs. 19 and 30.</p> <p>Over gently rolling desert land.</p> <p>Asc. 20 ft. over E. slope.</p>
2.30	Spur, slopes N., with unimproved road along top, bears irregularly N. and S.; desc. 30 ft. over gentle W. slope.
38.00	Wash, 20 lks. wide, 3 ft. deep, drains N.
39.10	Wash, 30 lks. wide, 2 ft. deep, drains N.; asc. 5 ft. over gentle E. slope.
41.62	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 19 and 30 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T20S R8E $\frac{1}{4}$ <u>S19</u> S30 1962</p> <p>No accessories available.</p> <p>Asc. 15 ft. over E. slope.</p>
48.40	Spur, slopes N.; desc. 20 ft. over NW. slope.
54.30	Wash, 10 lks. wide, 3 ft. deep, drains NE.; asc. 35 ft. over SE. slope.
73.00	Low ridge, bears irregularly N. and S.; desc. 10 ft. over gentle W. slope.
77.50	Road, unimproved, bears irregularly N. and S.
83.29	<p>The cor. of secs. 19, 24, 25 and 30, on the W. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the E. bdy. of T. 20 S., R. 7 E.</p> <p>Land, gently rolling desert. Soil, clay. No timber. Undergrowth, shadscale.</p>
	<p style="text-align: center;">Reestablishment of the Survey Executed by A.D. Ferron, in 1873</p> <hr/> <p>From the cor. of secs. 19, 20, 29 and 30.</p> <p>N. 2°06' W., bet. secs. 19 and 20.</p> <p>Over nearly level desert land.</p>
7.75	Road, improved dirt, bears N. 70° W. and S. 60° E.
21.90	Fence, bears E. and W.; enter farm land.

CHAINS 23.70	Road, unimproved, bears N. 80° E. and curves SW.
24.50	Irrigation ditch, 5 lks. wide, 2 ft. deep, drains NE.
41.21	Point for the $\frac{1}{2}$ sec. cor. of secs. 19 and 20 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T20S R8E $\frac{1}{2}$ S19 S20 1962
61.30	Wash, 100 lks. wide, 40 ft. deep, drains N. 30° E., leave farm land; asc. 30 ft. over gentle SW. slope.
82.42	Point for the cor. of secs. 17, 18, 19 and 20, on E. and W. property line fence and in line with extension of farm lane and road to N.; this point was determined by statements of interested property owners and is accepted as being the position of the original cor. point. There is no remaining evidence of the original cor. stone. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T20S R8E S18 S17 S19 S20 1962 Land, nearly level desert, north and south portions; level farm, central portion. Soil, clay. No timber. Undergrowth, shadscale, north and south portions.
17.50	From the cor. of secs. 16, 17, 20 and 21. S. 78°45' W., bet. secs. 17 and 20. Over W. slope of mesa. Desc. 100 ft. over SW. slope.
18.70	Draw, drains NW.; desc. 40 ft. over gently rolling NW. slope.
18.70	Draw, drains N.
29.20	Wash, 20 lks. wide, 3 ft. deep, drains NE.; asc. 45 ft. over SE. slope.
30.77	Fence, bears NE., and SW. about 2.00 chs., thence irregularly W.
39.40	Ridge, bears NE. and SW.; desc. 15 ft. over NW. slope. Fence, bears irregularly E. and W., thence along fence line.
42.41	Point for the $\frac{1}{2}$ sec. cor. of secs. 17 and 20 at proportionate dist. longitudinally and latitudinally on E. and W. property line fence, which is on the original sec. line, according to statements of interested property owners. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

T20S R8E

 $\frac{1}{4}$ $\frac{S17}{S20}$
1962

S. 89°17' W., beginning new measurement.

Over rolling land and along fence line.

Desc. 40 ft. over gentle NW. slope and along fence line.

3.10 Road, unimproved, bears SW. and NE.

21.00 Wash, 30 lks. wide, 10 ft. deep, drains N.; thence over level land.

25.80 Fence, bears N., continue along fence line.

26.60 Wash, 50 lks. wide, 10 ft. deep, drains NE.; asc. 10 ft. over gentle SE. slope.

33.30 Top of ascent, bears NE. and SW.; desc. 10 ft. over gentle W. slope.

41.60 The cor. of secs. 17, 18, 19 and 20.

Land, west slope of mesa, east portion; gently rolling desert, west portion.

Soil, rocky gravelly clay, east portion; clay, west portion.

No timber.

Undergrowth, shadscale.

S. 89°41' W., along fence line bet. secs. 18 and 19.

Over level meadow land.

1.50 Fence, bears N., continue along fence line.

14.43 Fence, bears S., leave meadow land and enter farm land; continue along fence line.

25.58 Fence, bears S., continue along fence line.

37.00 Irrigation ditch, drains NE.

40.73 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 18 and 19.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

 $\frac{1}{4}$ $\frac{S18}{S19}$
1962

Witness cor. located at intersection of N., S. and E. fences.

40.93 True cor. point for the $\frac{1}{4}$ sec. cor. of secs. 18 and 19 in center of farm lane to N., in line with centerline of road to N., and in line with property line fence to E., and is accepted as the position of the original cor. point. There is no remaining evidence of the original cor. monument. This point is not monumented.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
	S. 88°56' W., beginning new measurement.
0.20	Fence, bears N. and S., enter farm land.
5.82	Fence, bears N. and S., leave farm land, enter dense greasewood and rabbit brush.
21.75	Ferron Creek, with stream of water, 30 lks. wide, 6 ins. deep, flows NE. from NW., enter brushy meadow land.
39.25	Ferron Creek, with stream of water, 20 lks. wide, 6 ins. deep, flows NE.
39.74	Fence, bears N. and S.
40.07	The true point for the cor. of secs. 13, 18, 19 and 24, on the W. bdy. of the Tp., from which its witness cor. bears S. 0°30' E., 2.20 chs. dist., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the E. bdy. of T. 20 S., R. 7 E. Land, level farm and meadow. Soil, loamy clay. Timber, none. Undergrowth, greasewood, willows and grass.
	From the cor. of secs. 17, 18, 19 and 20. N. 0°41' W., bet. secs. 17 and 18. Over gently rolling farm and meadow land. Desc. 40 ft. over gentle N. slope.
22.80	Fence, bears E.
32.60	Ferron Creek, with stream of water, 15 lks. wide, 1 ft. deep, flows irregularly E.; asc. 15 ft. over gentle S. slope.
37.25	Wash, drains SE.
39.10	Fence, bears E. 50 lks. dist., thence N., enter farm lane and road, bears N. and SE.
39.88	Point selected for the witness ¼ sec. cor. of secs. 17 and 18. Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T20S R8E ¼ W.C. S18 S17 1962 Witness cor. set on W. side of road and E. bank of wash.
40.28	True point for ¼ sec. cor. of secs. 17 and 18 in center of farm lane on the sec. line, according to statements of interested property owners, and in line with property line fence to W. falls in ditch alongside road and cannot be perpetuated. There is no remaining evidence of the original cor. monument.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

N. $0^{\circ}56'$ W., along center of farm lane, beginning new measurement.

35.10 Road, bears NW.; asc. 30 ft. over S. slope.

35.19 Fence, bears E. and W.

35.55 Ditch, 10 lks. wide, 4 ft. deep, drains E.

37.30 Bench land, bears E. and W.; asc. 10 ft. over gentle S. slope.

40.70 Gravel road, bears E. and W.

40.98 Point for the cor. of secs. 7, 8, 17 and 18 on E. and W. fence line and in line with extension of farm lane to S.; and is accepted as the best evidence of the original cor. point. There is no remaining evidence of the original cor. monument.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T20S R8E

S7	S8
S18	S17

1962

From this cor., the southwest cor. of Molen cemetery, bears E. 0.30 chs. dist.

Land, nearly level farm and meadow.

Soil, clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 8, 9, 16 and 17.

S. $89^{\circ}34'$ W., bet. secs. 8 and 17.

Over gently rolling desert land.

1.20 Ferron Creek, with stream of water, 20 lks. wide, 1 ft. deep, flows NE. from SW.; asc. abruptly 30 ft.

3.00 Top of ledge, 30 ft. high, bears NE. and SW. Beginning of fence, bears W., thence over nearly level land, along fence line.

20.26 Fence, bears N. and SW., leave fence line.

26.10 Point of spur, slopes S.; desc. 15 ft. over SW. slope.

27.60 Wash, drains SE.; asc. 40 ft. over SE. slope.

40.87 Point for the $\frac{1}{2}$ sec. cor. of secs. 8 and 17 at proportional point latitudinally and in line with extension of a property fence from the S. which terminates about 3 chs. S.; and is accepted as the best evidence of the original cor. point. There is no remaining evidence of the original cor. monument. Old canal draining NE., bears N. 20 lks. from cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

T20S R8E

 $\frac{1}{2}$ S8

S17

1962

S. 89°34' W., beginning new measurement.

Asc. over rolling bench.

- 4.30 Top of rise on bench; desc. over SW. slope.
- 10.10 Wash, 20 lks. wide, 4 ft. deep, drains SE.
- 11.00 Enter cultivated field, NW. and SE.
- 15.50 Leave cultivated field, N. and SW.; asc. E. slope.
- 24.20 Road, improved dirt, bears irregularly W. and S. 70°00' E. about 5 chs., thence E., thence along road.
- 27.00 Gate in fence bearing N. and extending S. 30 lks. to fence along S. side of road; continue along graveled road.
- 31.30 Intersection of a road from the NE. with graveled road bearing E. and W. Fence bears N. and W. along N. side of road; thence along fence line.
- 34.00 SE. cor. of cemetery. Fence bears N. about 3 chs. to the NE. corner of cemetery, and W.; continue in fence line along N. side of road.
- 41.02 SW. cor. of cemetery. Fence bears N. about 3 chs. to the NW. cor. of cemetery, and W.; continue in fence line along N. side of road.
- 41.32 The cor. of secs. 7, 8, 17 and 18.
- Land, nearly level desert, east portion; rolling, west portion.
Soil, gravelly clay.
Timber, none.
Undergrowth, shadscale.

S. 89°18' W., bet. secs. 7 and 18.

Along fence line and N. side of gravel road, over nearly level land.

- 10.10 Desc. 25 ft. over SW. slope.
- 14.60 Junction of roads, with roads bearing SE. and NW. 50 lks., thence W., thence along S. side of road, along fence line.
- 19.70 Base of descent, bears NW. and SE.; enter meadow land.
- 39.79 Fence, bears S.
- 39.85 Point selected for the witness $\frac{1}{2}$ sec. cor. of secs 7 and 18.
- Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
	<p style="text-align: center;">T20S R8E W $\frac{1}{4}$ S7 C $\frac{1}{4}$ S18 1962</p> <p>40.30 Point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 18, at intersection of E. and W. gravel road, and road to S., and is accepted as the best evidence of the position of the original cor. This point is not monumented.</p> <hr/> <p>S. 88°56' W., along gravel road from Molen to Ferron, beginning new measurement.</p> <p>0.51 Fence, bears S.</p> <p>19.35 End of gravel road, thence along oiled road.</p> <p>40.35 The cor. of secs. 7, 12, 13 and 18, on the W. bdy. of the Tp., described in the 1962 field notes of the E. bdy. of T. 20 S., R. 7 E.</p> <p>Land, nearly level farm and meadow. Soil, clay. Timber, none. Undergrowth, shadscale.</p>
	<p>From the cor. of secs. 7, 8, 17 and 18.</p> <p>N. 0°09' E., bet. secs. 7 and 8.</p> <p>Over nearly level farm land.</p> <p>6.00 Leave farm land, asc. 35 ft. over S. slope.</p> <p>10.20 Fence, bears E. and W., top of ascent, bears E. and W.; desc. 40 ft. over N. slope.</p> <p>15.50 Draw, drains E.; asc. 40 ft. over S. slope.</p> <p>20.85 Spur, slopes SE.; desc. 30 ft. over NE. slope.</p> <p>23.50 Enter farm land.</p> <p>28.50 Leave farm land.</p> <p>29.00 Wash, 20 lks. wide, 5 ft. deep, drains SE.; asc. 75 ft. over SW. slope.</p> <p>39.30 Rim of bench, bears E. and W.</p> <p>39.49 Point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 8, on property line fence, bearing E. and W., and proportioned longitudinally and is accepted as the best evidence of the position of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T20S R8E $\frac{1}{4}$ S7 S8 1962</p> <p>Thence over gently rolling desert land.</p>

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS	
54.98	Fence, bears E. and W.
65.40	Wash, 15 lks. wide, 3 ft. deep, drains E.
65.90	N. edge of bench, bears E. and W.; desc. 45 ft. over N. slope.
80.19	Point for the cor. of secs. 5, 6, 7 and 8, at proportionate dist. longitudinally, and on property line fence bearing E. and W., and is accepted as the best evidence of the original cor. position.
	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
	T20S R8E <u>S6 S5</u> <u>S7 S8</u> 1962
	Land, rolling desert and farm. Soil, sandy clay. Timber, none. Undergrowth, shadscale, sagebrush and greasewood, north portion.
	From the cor. of secs. 4, 5, 8 and 9.
	S. 88°50' W., bet. secs. 5 and 8.
	Over mountainous land.
	Asc. 10 ft. over gentle NE. slope.
7.90	Top of ascent, slopes N.; desc. 20 ft. over NW. slope.
11.40	Wash, 30 lks. wide, 4 ft. deep, drains NE.; asc. 90 ft. over steep SE. slope.
17.40	Point of mesa spur, slopes NE.; desc. 70 ft. over NW. slope.
34.95	Draw, drains NE.; asc. 70 ft. over SW. slope.
40.94	Point for the ½ sec. cor. of secs. 5 and 8 at proportionate dist.; there is no remaining evidence of the original cor.
	Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T20S R8E ½ <u>S5</u> <u>S8</u> 1962
	Asc. 5 ft. over SW. slope.
42.50	Top of ascent, bears NE. and SW.; desc. 70 ft. over SW. slope.
54.40	Wash, 30 lks. wide, 3 ft. deep, drains SE.; thence over nearly level land.
54.45	Fence, bears N. and S.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

62.25	Fence, bears S. and S. 88°50' W.; thence along fence line.
77.40	Fence, bears N., continue along fence line.
81.88	The cor. of secs. 5, 6, 7 and 8. Land, mountainous, east portion; nearly level desert; west portion. Soil, rocky clay. Timber, none. Undergrowth, shadscale and scattered greasewood.
	S. 89°36' W., bet. secs. 6 and 7. Over nearly level desert land and along fence line.
20.68	Intersection of fences from SW. and N., with fence from E.; asc. 30 ft. over NE. slope. Leave fence line.
29.60	Spur, slopes N.; desc. 15 ft. over gentle NW. slope.
40.88	Point for the $\frac{1}{2}$ sec. cor. of secs. 6 and 7 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground; and in a collar of stone to top, with brass cap mkd. T20S R8E $\frac{1}{2}$ $\frac{S6}{S7}$ 1962 Asc. 10 ft. over gentle NE. slope.
42.10	Irrigation ditch, 5 lks. wide, 1 ft. deep, drains NE.
51.20	Top of ascent, bears N. and S.; desc. 30 ft. over gentle W. slope.
52.10	Irrigation ditch, 10 lks. wide, 3 ft. deep, drains SE.
52.60	Road, unimproved, bears NW. and SE.
71.70	Small draw, drains S.; asc. 30 ft. over SE. slope.
73.50	Small spur, slopes SE.; desc. 30 ft. over NW. slope.
74.90	Small draw, drains SE.; asc. 50 ft. over NE. slope.
81.81	The cor. of secs. 1, 6, 7 and 12, on the W. bdy. of the Tp., monumented with a 2 $\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the E. bdy. of T. 20 S., R. 7 E. Land, gently rolling desert. Soil, rocky clay. Timber, none. Undergrowth, shadscale.
	From the cor. of secs. 5, 6, 7 and 8. N. 0°56' W., bet. secs. 5 and 6.

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

Over rolling desert land.

11.60 Wash, 20 lks. wide, 3 ft. deep, drains E.; asc. 55 ft. over gently rolling S. slope.

12.75 Fence, bears E. and W.

31.20 Low clay ridge, bears E. and W.; desc. 50 ft. over NE. slope.

40.52 The $\frac{1}{4}$ sec. cor. of secs. 5 and 6, monumented with a quartzite stone, 4x12x15 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T20S R8E

$\frac{1}{4}$
S6|S5
1962

bury original stone cor. alongside iron post.

N. $1^{\circ}39'$ W., beginning new measurement.

Desc. 15 ft. over NE. slope.

7.80 Wash, 30 lks. wide, 4 ft. deep, drains NE.

12.70 Wash, 10 lks. wide, 2 ft. deep, drains NE.; asc. 35 ft. over SE. slope.

23.40 Spur, slopes E.; desc. 35 ft. over N. slope.

28.00 Wash, 10 lks. wide, 3 ft. deep, drains irregularly E.; asc. 15 ft. over gentle SE. slope.

40.47 The cor. of secs. 5, 6, 31 and 32, on the N. bdy. of the Tp., hereinbefore described.

Land, gently rolling desert.

Soil, clay.

Timber, none.

Undergrowth, shadscale.

General Description

Township 20 South, Range 8 East, is located 3 miles east of Ferron, Utah. The town of Molen is located in secs. 7 and 18, and the land around Molen is nearly level farm land and meadow land. The western portion of the township is gently rolling desert land, except for small areas of farm land. The east portion of the township is broken, mountainous mesa land. Vegetation consists mostly of shadscale, with greasewood, rabbit brush and willows along washes. Timber in the area is scattered scrub pinon and juniper on mesa tops. No timber in other areas. The area is drained in an easterly direction by numerous washes and draws. Ferron Creek enters the township at the southwest corner of section 18, and flows

Dependent Resurvey of the Subdivision of T. 20 S., R. 8 E.

CHAINS

northeasterly through the township. No other sources of water were found in the township. The main road from Ferron to Molen runs along the section line between secs. 7 and 18, thence northwest to Paradise Ranch, located in section 3. A gravel and graded road, enters the township in sec. 19, and bears southeasterly through the township. There are numerous unimproved roads throughout the west portion of the township. The elevation of the township varies from 6,200 ft. along the mesa tops to about 5,200 ft. in the lower valleys.

FIELD ASSISTANTS

GPO 834685

CERTIFICATE OF SURVEY

I, Glen B. Hatch, HEREBY CERTIFY upon honor, that,
 in pursuance of special instructions bearing date of the 29th day of June, 1962,
 I have dependently resurveyed the South boundary (Fourth Standard Parallel
 South), the East boundary, the North boundary, and the subdivisional
 lines of Township 20 South, Range 8 West,

of the Salt Lake Meridian, in the State of Utah, which
 are represented in the foregoing field notes as having been executed by me and under my direction;
 and that said survey has been made in strict conformity with said special instructions, the Manual
 of Instructions for the Survey of the Public Lands of the United States, and in specific manner
 described in the foregoing field notes.

January 10, 1963

(Date)

(Cadastral Surveyor)

January 10, 1963

(Date)

Glen B. Hatch
 (Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date DEC 9 1964

BUREAU OF LAND MANAGEMENT,
 Washington, D. C.

The foregoing field notes of the dependent resurvey of the South boundary, (Fourth
 Standard Parallel South), the East boundary, the North boundary, and the
 subdivisional lines of Township 20 South, Range 8 East,

executed by Glen B. Hatch, Cadastral Surveyor,

having been critically examined and found correct, are hereby approved.

JUN 21 1965

(Date)

E. L. Pennington
 (Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in
 _____, is a true copy of the original field notes.

(Date)

(Chief, Division of Engineering)

Blank

Page

Blank

Page

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

335

FIELD NOTES₀

OF THE

DEPENDENT RESURVEY

OF

THE SUBDIVISIONAL LINES

OF

TOWNSHIP 18 SOUTH, RANGE 19 WEST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

LaVern Griffin

Survey Aid

Under the Supervision of Craig P. Sylvester

Cadastral Surveyor

Under special instructions dated March 21, 19 62, which provided for the surveys

included under Group Number 451, approved March 29, 1962,

and assignment instructions dated August 14, 19 62.

Survey commenced February 13, 19 63

Survey completed March 20, 19 63

DEPT. OF THE INTERIOR
BUR OF LAND MGMT

1965 JUL 19 AM 10 00 .0

RECEIVED
STATE & LAND OFFICE
SALT LAKE CITY, UTAH

INDEX DIAGRAM

Township 18 SOUTH, Range 19 WEST

6 37 36	5 25 35	4 19 25	3 13 18	2 7 13	1 7
7 34 34	8 24 33	9 18 24	10 12 17	11 6 11	12 6
18 32 32	17 23 31	16 17 23	15 11 16	14 5 10	13 4
19 30 29	20 22 29	21 16 21	22 10 15	23 4 9	24 3
30 28 27	29 20 27	28 15 20	27 9 14	26 3 8	25 2
31 26	32 19	33 13	34 8	35 1	36

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

The North, South, East and West Boundaries and the Subdivisional lines were surveyed by A. J. Stewart, Jr. in 1882. R. E. L. Collier retraced the North Boundary of sections 1, 2 and 6 in 1895. In 1956, Andrew Nelson dependently resurveyed the South Boundary. The East Boundary was dependently resurveyed by Vern E. Lane et al in 1959. The West Boundary was dependently resurveyed concurrently by Gerald Hochstasser, under the supervision of Craig P. Sylvester. The North Boundary was dependently resurveyed in 1962 under the supervision of Craig P. Sylvester.

The following field notes are those of the dependent resurvey of the subdivisional lines of Township 18 South, Range 19 West,

Before restoring the corners, the lines of the original survey were retraced and a diligent search made for any evidence of the original corner monuments and other calls of the original field note record.

The rules of proportionate measurement were applied to ascertain the position of lost corners, but not until exhausting every reasonable possibility of finding direct evidence for the control of each particular corner.

Line connecting previously established corners were run by random and true method, but for simplification of the record the random lines are omitted from these field notes.

The direction of the lines of this resurvey were determined by reference to true meridians established on line by elongation observations on Polaris or altitude observations on the sun. The lines were carried forward by sustained angulation being supplemented by other numerous altitude observations on the sun taken throughout the progress of the resurvey.

The geographic position for the southeast corner of the township is at latitude $39^{\circ}11'30.8''$ N. and longitude $113^{\circ}55'28.5''$ W. as adjusted from traverses to U.S.C. & G.S. triangulation station "Wildhorse", at latitude $39^{\circ}06'18.893''$ N. and longitude $113^{\circ}50'15.386''$ W., located N. $73^{\circ}22'$ E., 11.88 chs. distance from the $\frac{1}{4}$ section corner of sections 2 and 35, Townships 19 and 20 South, Range 18 West.

The mean magnetic declination was found to be $16^{\circ}30'$ E.

Dependent Resurvey of the Subdivision
Township 18 South, Range 19 West

Reestablishment of the Survey Executed
by A. J. Stewart, Jr. in 1882.

From the cor. of secs. 1, 2, 35 and 36, on the S. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey of the N. bdy., T. 19 S., R. 19 W.

N. $0^{\circ}04'$ E., bet. secs. 35 and 36.

Over nearly level desert land through shadscale undergrowth.

40.31

Point for the $\frac{1}{4}$ sec. cor. of secs. 35 and 36 at propor-

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHADS	
	<p>tionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W * S35 S36 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p>
56.40	Road, unimproved dirt, bears NE. and SW.
80.62	<p>Point for the cor. of secs. 25, 26, 35 and 36 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W S26 S25 S35 S36 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale.</p>
	<p>From the cor. of secs. 25 and 36, on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey of the W. bdy., T. 18 S., R. 18 W.</p> <p>N. $89^{\circ}57'$ W., bet. secs. 25 and 36.</p> <p>Over gently rolling desert land through shadscale and greasewood undergrowth.</p> <p>40.17 Point for the $\frac{1}{4}$ sec. cor. of secs. 25 and 36 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S25 S36 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p> <p>46.20 Road, unimproved dirt, bears NE. and SW.</p> <p>80.34 The cor. of secs. 25, 26, 35 and 36.</p> <p>Land, gently rolling desert. Soil, sandy clay. Timber, none.</p>

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CRADIS

Undergrowth, shadscale and greasewood.

N. 0°17' W., bet. secs. 25 and 26.

Over nearly level desert land through shadscale undergrowth.

40.31

Point for the $\frac{1}{4}$ sec. cor. of secs. 25 and 26 at proportionate dist.; there is no remaining evidence of the original cor.Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{\frac{1}{4}}{S26|S25}$$
 1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

80.62

Point for the cor. of secs. 23, 24, 25 and 26 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{S23|S24}{S26|S25}$$
 1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 24 and 25, on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey of the W. bdy., T. 18 S., R. 18 W.

S. 89°53' W., bet. secs. 24 and 25.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.20

Point for the $\frac{1}{4}$ sec. cor. of secs. 24 and 25 at proportionate dist.; there is no remaining evidence of the original cor.Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{\frac{1}{4}}{S24|S25}$$
 1963
Raise a mound of stone, 3 ft. base, $2\frac{1}{2}$ ft. high, N. of cor.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 We

CHAINS	
80.40	<p>The cor. of secs. 23, 24, 25 and 26.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
40.31	<p>N. 0°11' W., bet. secs. 23 and 24.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 23 and 24 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> <p>T18S R19W</p> <p>$\frac{1}{4}$</p> <p>S23 S24</p> <p>1963</p> </div> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p>
57.03	Fence, barb wire, bears N. 71°45' E. and S. 71°45' W.
62.90	Road, bet. Robonson Ranch and Cowboy Pass, bears N. 75° 25' E. and S. 75°25' W.
80.62	<p>Point for the cor. of secs. 13, 14, 23 and 24 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> <p>T18S R19W</p> <p>S14 S13</p> <p>S23 S24</p> <p>1963</p> </div> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
10.60	<p>From the cor. of secs. 13 and 24 on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey of the W. bdy., T. 18 S., R. 18 W.</p> <p>S. 89°47' W., bet. secs. 13 and 24.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p> <p>Fence, barbwire, bears N. 71°45' E. and S. 71°45' W.</p>
15.35	Road, bet. Robonson Ranch and Cowboy Pass, bears N. 75° 25' E. and S. 75°25' W.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

40.19

Point for the $\frac{1}{4}$ sec. cor. of secs. 13 and 24 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{\frac{1}{4} \text{ S13}}{\text{S24}}$$

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

80.38

The cor. of secs. 13, 14, 23 and 24.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

N. $0^{\circ}08'$ W., bet. secs. 13 and 14.

Over nearly level desert land through shadscale greasewood, sagebrush and brigham tea undergrowth.

40.31

Point for the $\frac{1}{4}$ sec. cor. of secs. 13 and 14 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{\frac{1}{4} \text{ S14} | \text{S13}}{1963}$$

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

80.62

Point for the cor. of secs. 11, 12, 13 and 14 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{\text{S11} | \text{S12}}{\text{S14} | \text{S13}}$$

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale, greasewood, sagebrush and brigham tea.

From the cor. of secs. 12 and 13 on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
<p>0.10</p> <p>40.14</p>	<p>1959 resurvey of the W. bdy., T. 18 S., R. 18 W.</p> <p>S. 89°34' W., bet. secs. 12 and 13.</p> <p>Over nearly level land through shadscale and greasewood undergrowth.</p> <p>Road, unimproved dirt, bears N. and S., along W. side of barbwire fence.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 12 and 13 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ $\frac{S12}{S13}$ 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p> <p>The cor. of secs. 11, 12, 13 and 14.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
<p>40.31</p> <p>80.62</p>	<p>N. 0°01' W., bet. secs. 11 and 12.</p> <p>Over nearly level desert land through shadscale, greasewood and rabbit brush undergrowth.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 11 and 12 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S11 S12 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Point for the cor. of secs. 1, 2, 11 and 12 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W S2 S1 S11 S12 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Land, nearly level desert.</p>

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

Soil, sandy clay.
 Timber, none.
 Undergrowth, shadscale, greasewood and rabbit brush.

From the cor. of secs. 1 and 12 on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey of the W. bdy., T. 18 S., R. 18 W.

S. $89^{\circ}27'$ W., bet. secs. 1 and 12.

Over nearly level desert land through shadscale undergrowth.

0.10 Road, unimproved, bears N. and S., along W. side of barbwire fence.

40.03 Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 12 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ $\frac{S1}{S12}$

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

80.06 The cor. of secs. 1, 2, 11 and 12.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

N. $0^{\circ}25'$ W., bet. secs. 1 and 2.

Over nearly level desert land through shadscale undergrowth.

40.31 Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 2 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$
 S2 | S1

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

81.13 The cor. of secs. 1, 2, 35 and 36, on the N. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the resurvey of the S. bdy., T. 17 S., R. 19 W.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 W

CHAINS	
	<p>Undergrowth, shadscale.</p> <p>From the cor. of secs. 2, 3, 34 and 35, on the S. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey of the N. bdy., T. 19 S., R. 19 W.</p> <p>N. $0^{\circ}22'$ E., bet. secs. 34 and 35.</p> <p>Over nearly level desert land through shadscale, greasewood and brigham tea undergrowth.</p> <p>14.00 Road, unimproved, bears NE. and SW.</p> <p>40.25 Point for the $\frac{1}{4}$ sec. cor. of secs. 34 and 35 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S34 S35 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>80.50 Point for the cor. of secs. 26, 27, 34 and 35 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W S27 S26 S34 S35 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale, greasewood and brigham tea.</p>
40.17	<p>From the cor. of secs. 25, 26, 35 and 36.</p> <p>N. $89^{\circ}53'$ W., bet. secs. 26 and 35.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 26 and 35 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S26 S35 1963</p>

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

- 80.34 Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.
- The cor. of secs. 26, 27, 34 and 35.
- Land; nearly level desert.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale and greasewood.
-
- 40.25 N. 0°26' W., bet. secs. 26 and 27.
- Over nearly level desert land through shadscale and greasewood undergrowth.
- Point for the $\frac{1}{4}$ sec. cor. of secs. 26 and 27 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
 $\frac{1}{4}$
S27 | S26
1963
- 80.50 Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- Point for the cor. of secs. 22, 23, 26 and 27 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
S22 | S23
S27 | S26
1963
- Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- Land, nearly level desert.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale and greasewood.
-
- 40.27 From the cor. of secs. 23, 24, 25 and 26.
- S. 89°59' W., bet. secs. 23 and 26.
- Over nearly level desert land through shadscale and greasewood undergrowth.
- Point for the $\frac{1}{4}$ sec. cor. of secs. 23 and 26 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

T18S R19W

 $\frac{1}{4}$ S23

S26

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

80.54

The cor. of secs. 22, 23, 26 and 27.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

N. 0°23' W., bet. secs. 22 and 23.

Over nearly level desert land through shadscale and greasewood undergrowth.

30.05

Fence, barbwire, bears N. 71°45' E. and S. 71°45' W.

40.25

Point for the $\frac{1}{4}$ sec. cor. of secs. 22 and 23 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

 $\frac{1}{4}$

S22|S23

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

41.45

Road, bet. Robinson Ranch and Cowboy Pass, bears N. 75° 25' E. and S. 75°25' W.

80.50

Point for the cor. of secs. 14, 15, 22 and 23 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S15|S14

S22|S23

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 13, 14, 23 and 24.

S. 89°58' W., bet. secs. 14 and 23.

Over nearly level desert land through shadscale and greasewood undergrowth.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
40.42	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 14 and 23 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ $\frac{S14}{S23}$ 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p>
80.84	<p>The cor. of secs. 14, 15, 22 and 23.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
40.25	<p>N. $0^{\circ}12'$ W., bet. secs. 14 and 15.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p> <p>Point for the $\frac{1}{4}$ sec. cor. of secs. 14 and 15 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S15 S14 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p>
80.50	<p>Point for the cor. of secs. 10, 11, 14 and 15 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W S10 S11 S15 S14 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
	<p>From the cor. of secs. 11, 12, 13 and 14.</p> <p>S. $89^{\circ}50'$ W., bet. secs. 11 and 14.</p>

CHADRS

	Over nearly level desert land through shadscale and greasewood undergrowth.
40.47	Point for the $\frac{1}{4}$ sec. cor. of secs. 11 and 14 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T18S R19W $\frac{1}{4}$ $\frac{S11}{S14}$ 1963 Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.
80.94	The cor. of secs. 10, 11, 14 and 15. Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.
	N. $0^{\circ}06'$ W., bet. secs. 10 and 11. Over nearly level land through shadscale and greasewood undergrowth.
40.25	Point for the $\frac{1}{4}$ sec. cor. of secs. 10 and 11 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T18S R19W $\frac{1}{4}$ S10 S11 1963 Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
80.50	Point for the cor. of secs. 2, 3, 10 and 11 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T18S R19W $\frac{S3}{S10}$ $\frac{S2}{S11}$ 1963 Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor. Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.
	From the cor. of secs. 1, 2, 11 and 12.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

S. 89°45' W., bet. secs. 2 and 11.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.54 Point for the $\frac{1}{4}$ sec. cor. of secs. 2 and 11 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ $\frac{S2}{S11}$

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

81.08 The cor. of secs. 2, 3, 10 and 11.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

N. 0°54' E., bet. secs. 2 and 3.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.25 Point for the $\frac{1}{4}$ sec. cor. of secs. 2 and 3 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$

S3|S2

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

81.01 The cor. of secs. 2, 3, 34 and 35, on the N. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the resurvey of the S. bdy., T. 17 S., R. 19 W.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 3, 4, 33 and 34, on the S. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey of the N. bdy., T. 19 S., R. 19 W.

N. 0°23' E., bet. secs. 33 and 34.

Over nearly level desert land through shadscale and greasewood undergrowth.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 W

CHAINS

40.13

Point for the $\frac{1}{4}$ sec. cor. of secs. 33 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$
S33 | S34
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

80.26

The cor. of secs. 27, 28, 33 and 34, monumented by a wooden stake and charcoal.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S28 | S27
S33 | S34
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 26, 27, 34 and 35.

N. $89^{\circ}58'$ W., bet. secs. 27 and 34.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.34

Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 34 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ S27
S34
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

56.45

Road, unimproved, bears N. and S.

80.68

The cor. of secs. 27, 28, 33 and 34.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

N. 0°16' W., bet. secs. 27 and 28.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.21 Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 28 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$
S28 | S27
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

80.42 Point for the cor. of secs. 21, 22, 27 and 28 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S21 | S22
S28 | S27
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 22, 23, 26 and 27.

S. 89°58' W., bet. secs. 22 and 27.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.21 Point for the $\frac{1}{4}$ sec. cor. of secs. 22 and 27 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ S22
S27
1963

Raise a mound of stone, 3 ft. base, $2\frac{1}{2}$ ft. high, N. of cor.

80.42 The cor. of secs. 21, 22, 27 and 28.

Land, nearly level.

Soil, sandy clay.

Timber, none.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS		ACREAGE
	Undergrowth, shadscale and greasewood.	
	N. 0°29' W., bet. secs. 21 and 22.	
	Over nearly level desert land through shadscale and greasewood undergrowth.	
2.85	Fence, barbwire, bears N. 71°45' E. and S. 71°45' W.	
25.45	Road, bet. Robinson Ranch and Cowboy Pass, bears N. 86°20' E. and S. 86°20' W.	
40.21	Point for the $\frac{1}{2}$ sec. cor. of secs. 21 and 22 at proportionate dist.; there is no remaining evidence of the original cor.	
	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.	
	<div style="text-align: center;"> T18S R19W $\frac{1}{2}$ S21 S22 1963 </div>	
	Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.	
80.42	Point for the cor. of secs. 15, 16, 21 and 22 at proportionate dist.; there is no remaining evidence of the original cor.	
	Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.	
	<div style="text-align: center;"> T18S R19W S16 S15 S21 S22 1963 </div>	
	Raise a mound of stone, 3 ft. base, 2½ ft. high, W. of cor.	
	From this cor., a 2 in. iron post, bears N. 76°19' W., 3.61 chs. dist., mkd.	
	<div style="text-align: center;"> S16 S15 S21 S22 T18S R19W F. W. M. & SON 11-16-57 </div>	
	Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.	
	From the cor. of secs. 14, 15, 22 and 23.	
	S. 89°56' W., bet. secs. 15 and 22.	
	Over nearly level desert land through shadscale and greasewood undergrowth.	
40.26	Point for the $\frac{1}{2}$ sec. cor. of secs. 15 and 22 at proportionate dist.; there is no remaining evidence of the original cor.	

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHASER

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{1}{4} \frac{S15}{S22}$$

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

80.52

The cor. of secs. 15, 16, 21 and 22.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

N. $0^{\circ}20'$ W., bet. secs. 15 and 16.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.21

Point for the $\frac{1}{4}$ sec. cor. of secs. 15 and 16 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{1}{4} \frac{S16}{S15}$$

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

80.42

Point for the cor. of secs. 9, 10, 15 and 16 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$$\frac{S9}{S16} \frac{S10}{S15}$$

1963

Raise a mound of stone, 3 ft. base, $2\frac{1}{2}$ ft. high, W. of cor.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 10, 11, 14 and 15.

S. $89^{\circ}51'$ W., bet. secs. 10 and 15.

Over nearly level desert land through shadscale and greasewood undergrowth.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

40.34 Point for the $\frac{1}{4}$ sec. cor. of secs. 10 and 15 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ $\frac{S10}{S15}$

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

80.68 The cor. of secs. 9, 10, 15 and 16.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

N. $0^{\circ}04'$ E., bet. secs. 9 and 10.

Over nearly level desert land through shadscale and greasewood undergrowth.

40.21 Point for the $\frac{1}{4}$ sec. cor. of secs. 9 and 10 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$
S9 | S10

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

80.42 Point for the cor. of secs. 3, 4, 9 and 10 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{S4}{S9}$ | $\frac{S3}{S10}$

1963

Raise a mound of stone, 3 ft. base, $2\frac{1}{2}$ ft. high, W. of cor.

Land, nearly level desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 2, 3, 10 and 11.

S. $89^{\circ}49'$ W., bet. secs. 3 and 10.

Over nearly level desert land through shadscale and

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

- greasewood undergrowth.
- 40.21 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 10 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
 $\frac{1}{4}$ $\frac{S3}{S10}$
1963
- Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.
- 80.42 The cor. of secs. 3, 4, 9 and 10.
- Land, nearly level desert.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale and greasewood.
-
- N. $0^{\circ}07'$ E., bet. secs. 3 and 4.
- Over nearly level desert land through shadscale and greasewood undergrowth.
- 40.21 Point for the $\frac{1}{4}$ sec. cor. of secs. 3 and 4 at proportionate dist.; there is no remaining evidence of the original cor.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
 $\frac{1}{4}$
S4 | S3
1963
- Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- 81.03 The cor. of secs. 3, 4, 33 and 34, on the N. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the resurvey of the S. bdy., T. 17 S., R. 19 W.
- Land, nearly level desert.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale and greasewood.
-
- From the cor. of secs. 4, 5, 32 and 33, on the S. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey of the N. bdy., T. 19 S., R. 19 W.
- N. $0^{\circ}19'$ E., bet. secs. 32 and 33.
- Over rolling desert land through shadscale and greasewood undergrowth.
- 40.12 Point for the $\frac{1}{4}$ sec. cor. of secs. 32 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$
S32 | S33
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

65.80 Wash, 20 lks. wide, 1 ft. deep, drains E.

80.24 Point for the cor. of secs. 28, 29, 32 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S29 | S28
S32 | S33
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 27, 28, 33 and 34.

N. $89^{\circ}50'$ W., bet. secs. 28 and 33.

Over nearly level desert land through shadscale and greasewood undergrowth.

31.00 Wash, 40 lks. wide, 1 ft. deep, drains ENE.

40.40 Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 33 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ S28
S33
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

80.80 The cor. of secs. 28, 29, 32 and 33.

Land, nearly level E. portion; gently rolling W. portion.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

N. $0^{\circ}01'$ E., bet. secs. 28 and 29.

Over nearly level desert land through shadscale and

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS		
	<p>greasewood undergrowth.</p> <p>16.35 Wash, 10 lks. wide, 3 ft. deep, drains E.</p> <p>28.55 Wash, 20 lks. wide, 2 ft. deep, drains E.</p> <p>40.12 Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 29 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S29 S28 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>67.15 Wash, 10 lks. wide, 1 ft. deep, drains E.</p> <p>73.16 Fence, barbwire, bears E. and W.</p> <p>76.95 Road, graded, bet. Gandy and Garrison, bears N. 24° E. and S. 24° W.</p> <p>77.45 Irrigation ditch, drains E.</p> <p>80.24 Cor. of fences from the W. and E., and N. 6° W., believed to be a perpetuation of the original cor. of secs. 20, 21, 28 and 29.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, alongside fence cor., with brass cap mkd.</p> <p style="text-align: center;">T18S R19W <u>S20 S21</u> <u>S29 S28</u> 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>	
	<p>From the cor. of secs. 21, 22, 27 and 28.</p> <p>West, bet. secs. 21 and 28.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p> <p>27.22 Fence, net wire, bears N. and S., enter cultivated land.</p> <p>40.20 Point for the $\frac{1}{4}$ sec. cor. of secs. 21 and 28 at proportionate dist.; there is no remaining evidence of the original cor. This point falls in cultivated land with no permanent land marks to tie to.</p> <p>Bury broken glass 18 ins. below ground.</p>	

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
80.40	<p>The cor. of secs. 20, 21, 28 and 29.</p> <p>Land, nearly level. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
	<p>N. 0°38' W., bet. secs. 20 and 21.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p>
4.70	Road, graded gravel, bet. Gandy and Garrison, bears
	N. 6°20' W. and S. 6°20' E.
8.20	Irrigation ditch, drains E.
20.00	Irrigation ditch, drains E.
24.71	Robinson Ranch well, bears West, 75 lks. dist.
29.00	Irrigation ditch, drains E.
40.17	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 20 and 21 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S20 S21 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p>
55.70	Fence, barbwire, bears E. and W.
64.30	Wash, 10 lks. wide, 3 ft. deep, drains NE.
80.34	<p>Point for the cor. of secs. 16, 17, 20 and 21 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W S17 S16 S20 S21 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>From this cor., a 2 in. iron post, bears N. 49°33' W., 1.84 chs. dist., mkd.</p> <p style="text-align: center;">S17 S16 S20 S21 T18S R19W F. W. M. & SON 11-15-57</p>
	Land, nearly level desert.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
16.50	Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.
40.29	From the cor. of secs. 15, 16, 21 and 22. S. 89°57' W., bet. secs. 16 and 21. Over nearly level desert land through shadscale and greasewood undergrowth. Road, unimproved, bears N. and S. Point for the $\frac{1}{4}$ sec. cor. of secs. 16 and 21 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd. <div style="text-align: center;"> T18S R19W $\frac{1}{4}$ $\frac{S16}{S21}$ 1963 </div> Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.
80.58	The cor. of secs. 16, 17, 20 and 21. Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.
17.70	N. 0°26' W., bet. secs. 16 and 17. Over gently rolling desert land through shadscale and greasewood undergrowth.
40.17	Wash, 10 lks. wide, 1 ft. deep, drains NE. Point for the $\frac{1}{4}$ sec. cor. of secs. 16 and 17 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd. <div style="text-align: center;"> T18S R19W $\frac{1}{4}$ S17 S16 1963 </div> Raise a mound of stone, 3 ft. base, 3 ft. high, W. of cor.
78.50	Road, unimproved, bears NW. and SE.
80.34	Point for the cor. of secs. 8, 9, 16 and 17 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
	<p style="text-align: center;">T18S R19W $\frac{S8}{S17} \frac{S9}{S16}$ 1963</p> <p>Raise a mound of stone, 3 ft. base, 2½ ft. high, W. of cor.</p> <p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
16.40	<p>From the cor. of secs. 9, 10, 15 and 16.</p> <p>S. 89°54' W., bet. secs. 9 and 16.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p> <p>Road, unimproved, bears N. and S.</p>
40.34	<p>Point for the ¼ sec. cor. of secs. 9 and 16 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4} \frac{S9}{S16}$ 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p>
80.68	<p>The cor. of secs. 8, 9, 16 and 17.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
40.17	<p>N. 0°13' E., bet. secs. 8 and 9.</p> <p>Over gently rolling desert land through shadscale and greasewood undergrowth.</p> <p>Point for the ¼ sec. cor. of secs. 8 and 9 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4} \frac{S8}{S9}$ 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p>
59.90	Fence, net wire, bears E. and W.
76.95	Fence, barbwire, bears E. and W.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
78.80	Wash, 15 lks. wide, 2 ft. deep, drains ENE.
80.34	<p>Point for the cor. of secs. 4, 5, 8 and 9 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W S5 S4 S8 S9 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
40.22	<p>From the cor. of secs. 3, 4, 9 and 10.</p> <p>S. 89°49' W., bet. secs. 4 and 9.</p> <p>Over nearly level desert land through shadscale and greasewood undergrowth.</p> <p>Point for the ¼ sec. cor. of secs. 4 and 9 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W ¼ S4 S9 1963</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p>
80.44	<p>The cor. of secs. 4, 5, 8 and 9.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
40.17	<p>N. 0°07' E., bet. secs. 4 and 5.</p> <p>Over gently rolling desert land through shadscale and greasewood undergrowth.</p> <p>Point for the ¼ sec. cor. of secs. 4 and 5 at proportionate dist.; there is no remaining evidence of the original cor.</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W ¼ S5 S4 1963</p>

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 W

CHAINS

- 80.94 Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- The cor. of secs. 4, 5, 32 and 33, on the N. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the resurvey of the S. bdy., T. 17 S., R. 19 W.
- Land, gently rolling desert.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale and greasewood.
- 40.53 From the cor. of secs. 5, 6, 31 and 32, on the S. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey of the N. bdy., T. 19 S., R. 19 W.
- N. 1°01' E., bet. secs. 31 and 32.
- Over gently rolling desert land through shadscale and greasewood undergrowth.
- The ¼ sec. cor. of secs. 31 and 32, monumented with a flintstone, 14x8x6 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
¼
S31|S32
1963
- Bury original stone cor. alongside iron post.
- Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- N. 0°09' W., beginning new measurement.
- 2.50 Wash, 10 lks. wide, 2 ft. deep, drains E.
- 7.80 Road, unimproved, bears NE. and SW.
- 22.30 Wash, 30 lks. wide, 3 ft. deep, drains ENE.
- 40.46 The cor. of secs. 29, 30, 31 and 32, monumented with a flintstone, 16x8x7 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
S30|S29
S31|S32
1963
- Bury original stone cor. alongside iron post.
- Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
	<p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
	<p>From the cor. of secs. 28, 29, 32 and 33. N. 89°18' W., bet. secs. 29 and 32.</p>
	<p>Over gently rolling desert land through shadscale and greasewood undergrowth. Asc. 65 ft. over gentle E. slope.</p>
18.40	<p>Road, bet. Gandy and Garrison, bears N. 13° E. and S. 13° W.</p>
40.28	<p>Point for the $\frac{1}{4}$ sec. cor. of secs. 29 and 32 at proportionate dist.; there is no remaining evidence of the original cor.</p>
	<p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p>
	<p style="text-align: center;">T18S R19W $\frac{1}{4}$ $\frac{S29}{S32}$ 1963</p>
	<p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p>
	<p>Asc. 75 ft. over gentle E. slope.</p>
71.15	<p>Road, unimproved, bears NNE. and SSW.</p>
80.56	<p>The cor. of secs. 29, 30, 31 and 32.</p>
	<p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
40.55	<p>S. 89°39' W., bet. secs. 30 and 31. Over gently rolling desert land through shadscale and greasewood. Asc. 75 ft. over gentle E. slope. Point for the $\frac{1}{4}$ sec. cor. of secs. 30 and 31 at proportionate dist.; there is no remaining evidence of the original cor.</p>
	<p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p>
	<p style="text-align: center;">T18S R19W $\frac{1}{4}$ $\frac{S30}{S31}$ 1963</p>
	<p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p>
	<p>Asc. 75 ft. over gentle E. slope.</p>
81.10	<p>The cor. of secs. 25, 30, 31 and 36, on the W. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd.</p>

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

and witnessed as described in the 1963 field notes of the E. bdy., T. 18 S., R. 20 W.

Land, gently rolling.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 29, 30, 31 and 32.

N. 0°49' E., bet. secs. 29 and 30.

Over gently rolling desert land through shadscale and greasewood undergrowth.

23.40 Wash, 50 lks. wide, 3 ft. deep, drains E.

40.48 The $\frac{1}{4}$ sec. cor. of secs. 29 and 30, monumented with a limestone, 15x7x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$
S30|S29
1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

N. 0°17' E., beginning new measurement.

14.60 Wash, 1.00 ch. wide, 3 ft. deep, drains E.

20.90 Road, unimproved, to Robinson Ranch, bears ENE. and WSW.

21.30 Irrigation ditch, parallels road.

24.20 Wash, 10 lks. wide, 2 ft. deep, drains ENE.

25.03 Fence, barbwire, bears N. 68°40' E. and S. 68°40' W.

34.80 Wash, 40 lks. wide, 4 ft. deep, drains ENE.

40.58 The cor. of secs. 19, 20, 29 and 30, monumented with a flintstone, 16x9x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S19|S20
S30|S29
1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
	<p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
	<p>From the cor. of secs. 20, 21, 28 and 29. S. 89°57' W., bet. secs. 20 and 29. Over gently rolling desert land through shadscale and greasewood undergrowth.</p>
14.50	Irrigation ditch, drains ESE.
34.40	Road, unimproved, bears NE. and SW.
35.90	Irrigation ditch, drains ENE.
40.07	<p>The $\frac{1}{4}$ sec. cor. of secs. 20 and 29, monumented with a flintstone, 14x7x6 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ $\frac{S20}{S29}$ 1963</p> <p>Bury original stone cor. alongside iron post.</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p>
	<p>N. 87°24' W., beginning new measurement. Asc. 55 ft. over gentle E. slope.</p>
17.20	Road, unimproved, bears N. and S.
18.90	Wash, 30 lks. wide, 5 ft. deep, drains ENE.
39.79	<p>The cor. of secs. 19, 20, 29 and 30.</p> <p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
	<p>S. 88°42' W., bet. secs. 19 and 30. Over gently rolling desert land through shadscale and greasewood undergrowth. Asc. 65 ft. over gentle E. slope.</p>
36.00	Road, unimproved, bears NE. and SW.
40.94	<p>The $\frac{1}{4}$ sec. cor. of secs. 19 and 30, monumented with a flintstone, 15x7x6 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor point</p>

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ S19

S30

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

S. $89^{\circ}17'$ W., beginning new measurement.

1.15 Wash, 35 lks. wide, 2 ft. deep, drains ENE., asc. 125 ft. over gentle E. slope.

40.94 The cor. of secs. 19, 24, 25 and 30, on the W. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1963 field notes of the E. bdy., T. 18 S., R. 20 W.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 19, 20, 29 and 30.

N. $0^{\circ}33'$ E., bet. secs. 19 and 20.

Over gently rolling desert land through shadscale and greasewood undergrowth.

6.10 Road, unimproved, bears E. and W.

30.15 Wash, 20 lks. wide, 3 ft. deep, drains ENE.

32.95 Wash, 20 lks. wide, 2 ft. deep, drains ENE.

37.45 Road, unimproved, bears ESE. and WNW.

40.33 The $\frac{1}{4}$ sec. cor. of secs. 19 and 20, monumented with a flintstone, 16x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$

S19/S20

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, $2\frac{1}{2}$ ft. high, W. of cor.

N. $3^{\circ}04'$ W., beginning new measurement.

1.00 Wash, 25 lks. wide, 3 ft. deep, drains E.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

18.50 Wash, 20 lks. wide, 2 ft. deep, drains E.

23.80 Wash, 30 lks. wide, 3 ft. deep, drains E.

26.70 Road, unimproved, bears ESE. and WNW.

39.74 The cor. of secs. 17, 18, 19 and 20, monumented with a flintstone, 18x10x9 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S18 | S17

S19 | S20

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 16, 17, 20 and 21.

N. $89^{\circ}41'$ W., bet. secs. 17 and 20.

Over gently rolling desert land through shadscale and greasewood undergrowth.

8.15 Fence, barbwire, bears N. $6^{\circ}20'$ W. and S. $6^{\circ}20'$ E.

8.55 Road, bet. Gandy and Garrison, bears N. $6^{\circ}20'$ W. and S. $6^{\circ}20'$ E.

38.15 Road, unimproved, bears NNE. and SSW.

40.59 The $\frac{1}{4}$ sec. cor. of secs. 17 and 20, monumented with a flintstone, 19x10x7 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S17

$\frac{1}{4}$ S20

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

N. $88^{\circ}12'$ W., beginning new measurement.

Asc. 90 ft. over gentle E. slope.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	
40.06	<p>The cor. of secs. 17, 18, 19 and 20.</p> <p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
	<p>S. 88°12' W., bet. secs. 18 and 19.</p> <p>Over gently rolling desert land through shadscale and greasewood undergrowth. Asc. 150 ft. over gentle E. slope.</p> <p>20.10 Road, unimproved, bears NW. and SE.</p> <p>30.70 Wash, 20 lks. wide, 3 ft. deep, drains ESE.</p> <p>40.25 The $\frac{1}{4}$ sec. cor. of secs. 18 and 19, monumented with a flintstone, 16x8x6 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R19W $\frac{1}{4}$ S18 S19 1963</p> <p>Bury original stone cor. alongside iron post.</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.</p>
	<p>S. 89°57' W., beginning new measurement.</p> <p>Asc. 140 ft. over gentle E. slope.</p>
34.90	Wash, 25 lks. wide, 2 ft. deep, drains ESE.
40.15	<p>The cor. of secs. 13, 18, 19 and 24, on the W. bdy. of the Tp., monumented with a 2$\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1963 field notes of the resurvey of the E. bdy., T. 18 S., R. 20 W.</p> <p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.</p>
	<p>From the cor. of secs. 17, 18, 19 and 20.</p> <p>N. 0°45' E., bet. secs. 17 and 18.</p> <p>Over gently rolling desert land through shadscale and greasewood undergrowth. Asc. 35 ft. along gentle E. slope.</p> <p>7.70 Wash, 25 lks. wide, 2 ft. deep, drains E.</p> <p>40.37 The $\frac{1}{4}$ sec. cor. of secs. 17 and 18, monumented with a flintstone, 17x9x8 ins., set, mkd. and witnessed as described in the official record.</p>

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{2}$

S18 | S17

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

N. $0^{\circ}11'$ W., beginning new measurement.

13.90 Wash, 10 lks. wide, 2 ft. deep, drains E.

20.70 Wash, 20 lks. wide, 3 ft. deep, drains ENE.

40.43 The cor. of secs. 7, 8, 17 and 18, monumented with a flintstone, 16x9x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

S7 | S8

S18 | S17

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

From the cor. of secs. 8, 9, 16 and 17.

S. $88^{\circ}45'$ W., bet. secs. 8 and 17.

Over gently rolling desert land through shadscale and greasewood undergrowth. Asc. 75 ft. over gentle E. slope.

12.15 Road, unimproved, bears N. and S.

18.85 Fence, barbwire, bears N. $11^{\circ}20'$ W. and S. $11^{\circ}20'$ E.

19.15 Road, bet. Gandy and Garrison, bears N. $11^{\circ}20'$ W. and S. $11^{\circ}20'$ E.

27.40 Wash, 25 lks. wide, 4 ft. deep, drains ENE.

40.45 The $\frac{1}{2}$ sec. cor. of secs. 8 and 17, monumented with a limestone 16x8x7 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ $\frac{S8}{S17}$
1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

N. $85^{\circ}55'$ W., beginning new measurement.

Asc. 115 ft. over gentle E. slope.

39.29 The cor. of secs. 7, 8, 17 and 18.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale and greasewood.

S. $88^{\circ}35'$ W., bet. secs. 7 and 18.

Over rolling desert land through shadscale undergrowth. Asc. 110 ft. over E. slope.

2.90 Wash, 20 lks. wide, 3 ft. deep, drains ENE.

40.36 Point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 18 at proportionate dist.; there is no remaining evidence of the original cor.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$ $\frac{S7}{S18}$
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

Asc. 145 ft. over E. slope.

77.80 Wash, 25 lks. wide, 5 ft. deep, drains ENE.

80.90 The cor. of secs. 7, 12, 13 and 18, on the W. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the 1963 field notes of the resurvey of the E. bdy., T. 18 S., R. 20 W.

Land, rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 7, 8, 17 and 18.

N. $0^{\circ}44'$ E., bet. secs. 7 and 8.

Over gently rolling desert land through shadscale and greasewood undergrowth.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

- 5.10 Wash, -40 lks. wide, 3 ft. deep, drains E.
- 29.40 Wash, 15 lks. wide, 3 ft. deep, drains ENE.
- 38.00 Wash, 15 lks. wide, 2 ft. deep, drains ENE.
- 40.31 The $\frac{1}{4}$ sec. cor. of secs. 7 and 8, monumented with a limestone, 14x7x6 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
 $\frac{1}{4}$
S7 | S8
1963
- Bury original stone cor. alongside iron post.
- Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
-
- N. $1^{\circ}24'$ W., beginning new measurement.
- 11.00 Road, unimproved, bears ENE. and WSW.
- 12.10 Irrigation ditch, drains ENE.
- 18.90 Wash, 20 lks. wide, 2 ft. deep, drains ESE.
- 31.70 Wash, 80 lks. wide, 2 ft. deep, drains E.
- 34.40 Road, unimproved, bears E. and W.
- 37.93 The cor. of secs. 5, 6, 7 and 8, monumented with a flintstone, 24x10x9 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T18S R19W
S6 | S5
S7 | S8
1963
- Bury original stone cor. alongside iron post.
- Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- Land, gently rolling.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale and greasewood.
-
- From the cor. of secs. 4, 5, 8 and 9.
- S. $89^{\circ}50'$ W., bet. secs. 5 and 8.
- Over gently rolling desert land through shadscale and greasewood undergrowth.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS	CHAINS
36.60	Fence, barbwire, bears N. 7°45' W. and S. 7°45' E.
36.95	Road, bet. Gandy and Garrison, bears N. 7°45' W. and S. 7°45' E.
40.18	Point for the $\frac{1}{4}$ sec. cor. of secs. 5 and 8 at proportionate dist.; there is no remaining evidence of the original cor. Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd. T18S R19W $\frac{1}{4} \frac{S5}{S8}$ 1963 Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor. Asc. 70 ft. over gentle E. slope.
54.50	Road, unimproved, bears NW. and SE.
80.36	The cor. of secs. 5, 6, 7 and 8. Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale and greasewood.
34.80	N. 89°51' W., bet. secs. 6 and 7. Over gently rolling desert land through shadscale undergrowth. Asc. 95 ft. over gentle E. slope. Wash, 30 lks. wide, 2 ft. deep, drains ENE. The $\frac{1}{4}$ sec. cor. of secs. 6 and 7, monumented with a limestone, 14x9x6 ins., set, mkd. and witnessed as described in the official record. At the cor. point Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd. T18S R19W $\frac{1}{4} \frac{S6}{S7}$ 1963 Bury original stone cor. alongside iron post. Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor. S. 89°50' W., beginning new measurement. Asc. 170 ft. over E. slope.
35.30	Wash, 15 lks. wide, 4 ft. deep, drains ESE.
40.12	The cor. of secs. 1, 6, 7 and 12, on the W. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the 1963 field notes of the resurvey of the E. bdy., T. 18 S., R. 20 W.

Dependent Resurvey of the Subdivision, Township 18 South, Range 19 West

CHAINS

Land, gently rolling desert.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale.

From the cor. of secs. 5, 6, 7 and 8.

N. 0°52' W., bet. secs. 5 and 6.

Over gently rolling desert land through shadscale and scattered patches of greasewood undergrowth.

26.60 Road, unimproved, bears N. 70° W. and S. 70° E.

31.15 Wash, 25 lks. wide, 2 ft. deep, drains ENE.

36.30 Wash, 40 lks. wide, 1 ft. deep, drains E.

40.25 The $\frac{1}{4}$ sec. cor. of secs. 5 and 6, monumented with a limestone, 14x9x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R19W

$\frac{1}{4}$

S6|S5

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

N. 0°53' E., beginning new measurement.

30.20 Wash, 40 lks. wide, 5 ft. deep, drains E.

40.51 The cor. of secs. 5, 6, 31 and 32, on the N. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the 1962 field notes of the resurvey of the S. bdy., T. 17 S., R. 19 W.

Land, gently rolling.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale, with scattered patches of greasewood.

Township 18 South, Range 19 West

CHAINS

General Description

Township 18 South, Range 19 West, is located about 18 miles north of Garrison, in the Snake Valley. It is nearly level desert land in the east portion and gently rolling desert land in the west portion. The township is covered with shadscale and greasewood undergrowth, with some grass and brigham tea. There is no timber. The soil is sandy clay. The road from Gandy to Garrison passes through the western portion of the township in a southerly direction, and the road to Cowboy Pass passes through the southern portion of the township in an easterly direction. Both of these roads are graded gravel and well traveled. There are numerous unimproved roads in the northwest portion. Robinson Ranch, the only habitation in the township is located in section 21. No water was noted in this township other than the Robinson Ranch well. The area is drained in a south-easterly direction by numerous small washes. The elevation is about 4,500 ft. above sea level.

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

375

FIELD ASSISTANTS

[illegible]

CERTIFICATE OF SURVEY

I, **Craig P. Sylvester**, HEREBY CERTIFY upon honor that,
 in pursuance of special instructions bearing date of the 21st day of **March**, 19 **62**,
 I have supervised the dependent resurvey of the subdivisional lines of
 Township 18 South, Range 19 West

of the **Salt Lake** Meridian, in the State of **Utah**, which
 are represented in the foregoing field notes as having been executed by me and under my direction;
 and that said survey has been made in strict conformity with said special instructions, the Manual
 of Instructions for the Survey of the Public Lands of the United States, and in specific manner
 described in the foregoing field notes.

January 29, 1965

(Date)

Craig P. Sylvester
 (Cadastral Surveyor)

 (Date)

 (Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date MAR 3 1965

BUREAU OF LAND MANAGEMENT,
 Washington, D. C.

The foregoing field notes of the dependent resurvey of the subdivisional lines of
 Township 18 South, Range 19 West

executed by **LaVern Griffin**, Survey Aid, under the supervision of **Craig P. Sylvester**, Cadastral Surveyor
 having been critically examined and found correct, are hereby approved.

JUN 21 1965

(Date)

E. E. Remington
 (Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

~~I CERTIFY That the foregoing transcript of the field notes of the above described surveys in~~

~~, is a true copy of the original field notes.~~

~~_____
 (Date)~~

~~_____
 (Chief, Division of Engineering)~~

Blank

Page

Blank

Page

FIELD NOTES

OF THE

DEPENDENT RESURVEY

OF A

PORTION OF THE SUBDIVISIONAL LINES

AND THE

COMPLETION SURVEY

OF

THE SUBDIVISIONAL LINES

OF

TOWNSHIP 12 SOUTH, RANGE 18 WEST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

Craig P. Sylvester

Cadastral Surveyor

Under special instructions dated March 21, 1962, which provided for the surveys
included under Group Number 451, approved March 29, 1962,
and assignment instructions dated August 14, 1962.

Survey commenced AUGUST 27, 1962

Survey completed March 29, 1963

DEPT. OF THE INTERIOR
BUR OF LAND MGMT

1965 JUL 19 AM 10 00 .9

RECEIVED
STATE & LAND OFFICE
SALT LAKE CITY, UTAH

INDEX DIAGRAM

Township 19 SOUTH, Range 18 WEST,

6 33 31	5 23 31	4 18 22	3 10 17	2 5 9	1 4
7 30 29	8 21 28	9 16 20	10 8 15	11 3 7	12 2
18 27 26	17 19 25	16 14 18	15 43 42	14 36 41	13 35
19 24 24	20 48 47	21 13 46	22 40 39	23 35 38	24 34
30 49 48	29 45	28 12 47 44	27 7 12	26 33 37	25
31	32	33 11	34 6	35	36

Dependent Resurvey of the Subdivisions, T. 19 S., R. 18 W.

CHAINS

The township boundaries were surveyed by A. J. Stewart in 1882 and 1883. The north and south boundaries were resurveyed by Vern E. Lane in 1959. A portion of the east boundary was dependently resurveyed and a portion was independently resurveyed by Vern E. Lane in 1959. The west boundary was resurveyed by Andrew Nelson in 1956. A portion of the subdivisional lines was surveyed by R. E. L. Collier in 1895. Sections 32 and 36 were completed by Vern E. Lane in 1959.

The following field notes are those of the dependent resurvey of a portion of the subdivisional lines and the completion survey of the subdivisional lines of Township 19 South, Range 18 West.

Before restoring the corners, the lines of the original survey were retraced and diligent search made for any evidence of the original corners, monuments, and other calls of the original field note record.

The rules of proportionate measurement were applied to ascertain the position of the lost corners, but not until exhausting every reasonable possibility of finding direct evidence for the control of each particular corner.

The resurvey and survey was executed with a W. & L. E. Gurley Solar Transit No. 570621, constructed in accordance with the standard instrumental specifications of the Bureau of Land Management. The instrument was in good adjustment prior to the beginning of the survey and resurvey and was maintained in proper adjustment throughout the progress of the survey and resurvey.

Lines connecting previously established corners were run by random and true method, but for simplification of the record the random lines are omitted from these field notes.

Measurements herein contained were made with a narrow steel tape, 8 chains in length, graduated every link for the first 100 links, and thereafter at intervals of 10 links. The tape was tested by comparison with a one chain standard steel tape and found to be correct. Measurements were made on the slope with the vertical angle of each interval ascertained by a clinometer in good adjustment; horizontal equivalents alone are entered in the field notes. All lines of the survey and resurvey were run by direct method where the lines were accessible; lines inaccessible were run by traverse or triangulation methods. Distances to topography on lines run by traverse or triangulation methods are approximately as scaled from reliable U.S.G.S. topographic sheets. The details of such traverses or triangulations have been thoroughly checked and verified, and in order to simplify the record the diagrams and reductions are omitted from these field notes.

The direction of the lines of the survey and resurvey were determined by reference to true meridians established on line by elongation observations on Polaris or altitude observations on the sun. The lines were carried forward by sustained angulation being supplemented by other numerous altitude observations on the sun taken throughout the progress of the survey and resurvey.

382

Dependent resurvey of the subdivision, T. 19 S., R. 18 W.

CHAINS

The geographic position for the southeast corner of the township is at latitude $39^{\circ}06'17.7''$ N. and longitude $113^{\circ}48'44.3''$ W., taken from the plat of the 1959 resurvey.

The mean declination was found to be $16^{\circ}30'$ E.

Dependent Resurvey of a Portion
of the
Subdivision, T. 19 S., R. 18 W.

Reestablishment of the Survey Executed
by R. E. L. Collier in 1895

Beginning at the cor. of secs. 12 and 13, on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.

S. $86^{\circ}15'$ W., bet. secs. 12 and 13.

Over mountainous land through scattered shadscale undergrowth. Asc. 70 ft. over NE. slope.

3.50 Spur, slopes SE., desc. 45 ft. over NW. slope.

8.40 Wash, 30 lks. wide, 5 ft. deep, drains SW., asc. 110 ft. over SE. slope.

16.50 Saddle on spur, slopes S., desc. 115 ft. over W. slope.

24.95 Wash, 30 lks. wide, 4 ft. deep, drains SW., asc. 45 ft. over SE. slope.

28.40 Spur, slopes SW., desc. 90 ft. along S. slope.

31.30 Wash, 80 lks. wide, 3 ft. deep, drains SW.

40.80 Spur, slopes NW., desc. 25 ft. over SW. slope.

42.59 The $\frac{1}{4}$ sec. cor. of secs. 12 and 13, monumented with a limestone, $18 \times 14 \times 6$ ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ S12

$\frac{1}{4}$ S13

1962

Bury original stone cor. alongside iron post.

N. $89^{\circ}55'$ W., beginning new measurement.

Desc. 85 ft. over SW. slope.

6.45 Small draw, drains SW., asc. 20 ft. over SE. slope.

13.75 Spur, slopes SW., desc. 70 Ft. over NW. slope.

21.45 Small draw, drains N., asc. 40 ft. over NE. slope.

23.95 Spur, slopes NW., desc. 165 ft. over SW. slope.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

40.45

The cor. of secs. 11, 12, 13 and 14, monumented with a limestone, 14x8x6 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the cor. of secs. 11 and 12 only.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.

T19S R18W

S11 | S12

S14

1962

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, mountainous.

Soil, rocky.

Timber, none.

Undergrowth, shadscale.

N. 0°23' W., bet. secs. 11 and 12.

Over mountainous land through scattered shadscale undergrowth. Asc. 40 ft. along rolling W. slope.

7.60

Trail road, bears NE. and SW.

9.80

Wash, 80 lks. wide, 4 ft. deep, drains NW.

14.50

Spur, slopes W., desc. 30 ft. over NW. slope.

16.85

Wash, 1.50 chs. wide, 3 ft. deep, drains NW., asc. 200 ft. over SE. slope.

36.00

Spur, slopes SW., desc. 85 ft. over NW. slope.

40.61

The ½ sec. cor. of secs. 11 and 12, monumented with a limestone, 24x12x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

½

S11 | S12

1962

Bury original stone cor. alongside iron post.

N. 0°10' W., beginning new measurement.

Desc. 320 ft. over broken NW. slope.

4.90

Wash, 2.00 chs. wide, 7 ft. deep, drains W.

15.10

Wash, 2.00 chs. wide, 10 ft. deep, drains W.

17.00

Wash, 1.10 chs. wide, 3 ft. deep, drains W.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

- 26.65 Wash, 1.00 ch. wide, 3 ft. deep, drains NW.
- 39.80 Wash, 40 lks. wide, 4 ft. deep, drains SW.
- 40.21 The cor. of secs. 1, 2, 11 and 12, monumented with a limestone, 18x8x6 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T19S R18W
 $\frac{S2}{S11} \frac{S1}{S12}$
 1962
- Bury original stone cor. alongside iron post.
- Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- Land, mountainous.
 Soil, rocky.
 Timber, none.
 Undergrowth, shadscale.
-
- From the cor. of secs. 1 and 12, on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.
- N. $89^{\circ}36'$ W., bet. secs. 1 and 12.
- Over mountainous land through shadscale undergrowth. Desc. 80 ft. over W. slope.
- 3.75 Draw, drains N., asc. 125 ft. over NE. slope.
- 10.35 Spur, slopes NW., desc. 260 ft. over broken SW. slope.
- 26.15 Wash, 50 lks. wide, 6 ft. deep, drains NW., asc. 50 ft. over NE. slope.
- 31.25 Spur, slopes NW., desc. 170 ft. over SW. slope.
- 40.08 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 1 and 12.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T19S R18W
 $\frac{1}{4} \frac{S1}{S12} WC$
 1962
- raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.
- Desc. 50 ft. over SW. slope.
- 40.38 Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 12 at proportionate dist. falls in wash, and deemed unsafe to perpetuate. There is no remaining evidence of the original cor.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

45.05 Wash, 1.70 chs. wide, 4 ft. deep, drains irregularly W., desc. 220 ft. over NW. slope.

56.55 Wash, 1.50 chs. wide, 3 ft. deep, drains NW.

61.35 Wash, 1.70 chs. wide, 5 ft. deep, drains NW.

78.55 Wash, 40 lks. wide, 4 ft. deep, drains SW.

80.76 The cor. of secs. 1, 2, 11 and 12.

Land, mountainous.

Soil, rocky.

Timber, none.

Undergrowth, shadscale.

N. 0°22' W., bet. secs. 1 and 2.

Over gently rolling desert land through scattered shadscale undergrowth. Desc. 40 ft. over gently rolling NW. slope.

2.70 Wash, 80 lks. wide, 4 ft. deep, drains NW.

7.30 Wash, 2.20 chs. wide, 8 ft. deep, drains W.

12.50 Wash, 2.30 chs. wide, 3 ft. deep, drains W.

18.80 Wash, 3.50 chs. wide, 4 ft. deep, drains NW.

39.40 Wash, 4.10 chs. wide, 4 ft. deep, drains NW.

40.17 The $\frac{1}{4}$ sec. cor. of secs. 1 and 2, monumented with a limestone, 12x10x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$

S2 | S1

1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.,

N. 0°15' W., beginning new measurement.

Desc. 40 ft. over gently rolling NW. slope.

7.50 Wash, 2.50 chs. wide, 3 ft. deep, drains NW.

8.90 Trail road, bears W. and NE.

18.40 Wash, 80 lks. wide, 4 ft. deep, drains NW.

21.30 Wash, 1.20 chs. wide, 5 ft. deep, drains W.

31.40 Wash, 1.10 chs. wide, 4 ft. deep, drains W.

38.47 The cor. of secs. 1 and 2, on the N. bdy. of the Tp.,

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.

Land, gently rolling desert.

Soil, rocky sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 34 and 35, on the S. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.

N. $2^{\circ}30'$ W., bet. secs. 34 and 35.

Over mountainous land through shadscale undergrowth.
Asc. 155 ft. over SW. slope.

4.35 Wash, 50 lks. wide, 4 ft. deep, drains SW.

26.05 Ridge, bears E. and W., desc. 120 ft. over NW. slope.

33.95 Wash, 70 lks. wide, 3 ft. deep, drains NW., asc. 20 ft. over SW. slope.

40.85 The $\frac{1}{4}$ sec. cor. of secs. 34 and 35, monumented with a limestone, 12x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$

S34 | S35

1962

Bury original stone cor. alongside iron post.

N. $0^{\circ}20'$ W., beginning new measurement.

Asc. 30 ft. over SW. slope.

4.25 Spur, slopes NW., desc. 65 ft. over NW. slope.

8.55 Wash, 70 lks. wide, 3 ft. deep, drains NW., asc. 40 ft. over SW. slope.

14.00 Spur, slopes NW., desc. 185 ft. over NW. slope.

40.27 The cor. of secs. 26, 27, 34 and 35, monumented with a limestone, 12x8x6 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the cor. of secs. 27 and 34 only.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS	<p style="text-align: center;">T19S R18W $\frac{S27}{S34}$ S26 1962</p> <p>Bury original stone cor. alongside iron post.</p> <p>Land, mountainous. Soil, rocky. Timber, none. Undergrowth, shadscale.</p>
<p>12.70</p> <p>22.20</p> <p>40.12</p>	<p>N. 0°11' W., bet. secs. 26 and 27.</p> <p>Over rolling desert land through scattered shadscale undergrowth. Desc. 15 ft. over NW. slope.</p> <p>Wash, 1.80 chs. wide, 4 ft. deep, drains SW., asc. 140 ft. over SE. slope.</p> <p>Road, unimproved, bears NE. and SW.</p> <p>The $\frac{1}{4}$ sec. cor. of secs. 26 and 27, monumented with a limestone, 14x8x6 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the E. $\frac{1}{4}$ sec. cor. of sec. 27 only.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p>
<p>1.45</p> <p>4.75</p> <p>7.60</p> <p>31.15</p> <p>38.65</p> <p>40.11</p>	<p style="text-align: center;">T19S R18W $\frac{1}{4}$ $\frac{S27}{S34}$ 1962</p> <p>Bury original stone cor. alongside iron post.</p> <p>Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>Original survey discontinued at this point.</p> <p>Land, rolling desert. Soil, rocky. Timber, none. Undergrowth, scattered shadscale.</p> <p>From the cor. of secs. 11 and 12.</p> <p>S. 89°55' W., along the S. bdy. of sec. 11.</p> <p>Over rolling desert land through scattered shadscale undergrowth. Desc. 145 ft. over general W. slope.</p> <p>Wash, 90 lks. wide, 4 ft. deep, drains SW.</p> <p>Wash, 30 lks. wide, 3 ft. deep, drains SW.</p> <p>Road, unimproved, bears NW. and SE.</p> <p>Road, unimproved, bears NE. and SW.</p> <p>Road, unimproved, bears NW. and SE.</p> <p>The $\frac{1}{4}$ sec. cor. of secs. 11 and 14, monumented with a limestone, 14x8x6 ins., set, mkd. and witnessed as des-</p>

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

cribed in the official record. This cor. will now function as the S. $\frac{1}{4}$ sec. cor. of sec. 11 only.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ S11

1962

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

S. $89^{\circ}50'$ W., beginning new measurement.

Desc. 120 ft. over rolling W. slope.

4.10 Road, unimproved, bears NE. and SW.

8.75 Road, unimproved, bears NW. and SE.

11.40 Wash, 30 lks. wide, 4 ft. deep, drains SW.

23.10 Wash, 30 lks. wide, 4 ft. deep, drains NW.

40.05 The cor. of secs. 10, 11, 14 and 15, monumented with a limestone, 12x8x6 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the cor. of secs. 10 and 11 only.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

S10|S11

S15

1962

Bury original stone cor. alongside iron post.

Land, rolling desert.

Soil, rocky sandy clay.

Timber, none.

Undergrowth, scattered shadscale.

N. $0^{\circ}20'$ W., bet. secs. 10 and 11.

Over rolling desert land through scattered shadscale. Desc. 45 ft. over gently rolling NW. slope.

5.90 Wash, 1.20 chs. wide, 6 ft. deep, drains NW.

7.10 Wash, 80 lks. wide, 5 ft. deep, drains SW.

40.18 The $\frac{1}{4}$ sec. cor. of secs. 10 and 11, monumented with a limestone, 12x10x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{2}$
S10 | S11
1962

Bury original stone cor. alongside iron post.

N. $0^{\circ}16'$ W., beginning new measurement.

Desc. 90 ft. over gently rolling NW. slope.

33.80 Wash, 1.20 chs. wide, 3 ft. deep, drains NW.

40.12 The cor. of secs. 2, 3, 10 and 11, monumented with a limestone, 12x10x10 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{S3}{S10}$ | $\frac{S2}{S11}$
1962

Bury original stone cor. alongside iron post.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, scattered shadscale.

From the cor. of secs. 1, 2, 11 and 12.

S. $89^{\circ}34'$ W., bet. secs. 2 and 11.

Over rolling desert land through scattered shadscale undergrowth. Desc. 170 ft. over rolling NW. slope.

10.30 Wash, 70 lks. wide, 5 ft. deep, drains NW.

12.60 Road, unimproved, bears NE. and SW.

14.15 Road, unimproved, bears irregularly E. and W.

15.55 Wash, 80 lks. wide, 5 ft. deep, drains NW.

37.80 Road, unimproved, bears NW. and SE.

40.01 The $\frac{1}{4}$ sec. cor. of secs. 2 and 11, monumented with a limestone, 16x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

T19S R18W

 $\frac{1}{2}$ S2
S11

1962

Bury original stone cor. alongside iron post.

S. 89°36' W., beginning new measurement.

Desc. 10 ft. over gently rolling NW. slope.

5.30 Wash, 4.20 chs. wide, 2 ft. deep, drains NW.

31.90 Wash, 1.90 chs. wide, 4 ft. deep, drains NW.

40.09 The cor. of secs. 2, 3, 10 and 11.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, scattered shadscale.

N. 0°16' W., bet. secs. 2 and 3.

Over gently rolling desert land through scattered shad-scale undergrowth. Desc. 65 ft. over gently rolling NW. slope.

4.30 Wash, 60 lks. wide, 5 ft. deep, drains NW.

19.70 Wash, 40 lks. wide, 3 ft. deep, drains NW.

28.70 Wash, 2.00 chs. wide, 2 ft. deep, drains NW.

32.20 Wash, 1.00 ch. wide, 4 ft. deep, drains NW.

40.09 The $\frac{1}{2}$ sec. cor. of secs. 2 and 3, monumented with a limestone, 20x6x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

 $\frac{1}{2}$ S3
S2

1962

Bury original stone cor. alongside iron post.

N. 1°41' W., beginning new measurement.

Desc. 40 ft. over gently rolling NW. slope.

2.20 Wash, 70 lks. wide, 2 ft. deep, drains NW.

15.50 Wash, 20 lks. wide, 3 ft. deep, drains NW.

30.70 Wash, 1.20 chs. wide, 4 ft. deep, drains NW.

37.00 Road, unimproved, bears NE. and SW.

39.72 The cor. of secs. 2 and 3, on the N. bdy. of the Tp.,

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.

Land, gently rolling.

Soil, sandy clay.

Timber, none.

Undergrowth, scattered shadscale.

From the cor. of secs. 3, 4, 33 and 34, on the S. bdy. of the Tp., monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey.

N. 0°12' W., bet. secs. 33 and 34.

Over rolling desert land through scattered shadscale undergrowth. Asc. 55 ft. over rolling SW. slope.

21.40 Road, unimproved, bears NE. and SW.

22.70 Left bank of large wash, 10 ft. deep, drains SW.

30.90 Right bank of same wash.

34.70 Wash, 3.00 chs. wide, 10 ft. deep, drains SW.

39.50 Wash, 40 lks. wide, 3 ft. deep, in small draw, drains SW.

40.15 The ¼ sec. cor. of secs. 33 and 34, monumented with a limestone, 16x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R18W

¼
S33|S34
1963

Bury original stone cor. alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

N. 0°13' W., beginning new measurement.

Asc. 120 ft. over rolling SW. slope.

12.70 Wash, 2.00 chs. wide, 4 ft. deep, drains SW.

17.75 Road, unimproved, bears NE. and SW.

40.16 The cor. of secs. 27, 28, 33 and 34, monumented with a limestone, 12x8x6 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the cor. of secs. 27 and 34 only.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 18 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

T19S R18W

S28 $\frac{S27}{S34}$

1962

Bury original stone cor. alongside iron post.

Land, rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, scattered shadscale.

From the cor. of secs. 27 and 34.

S. 89°36' W., bet. secs. 27 and 34.

Over rolling desert land through scattered shadscale undergrowth. Desc. 90 ft. over rolling SW. slope.

20.10 Wash, 3.20 chs. wide, 3 ft. deep, drains SW.

24.50 Wash, drains SW.

34.30 Road, unimproved, bears NE. and SW.

40.12 The $\frac{1}{2}$ sec. cor. of secs. 27 and 34, monumented with a limestone, 12x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

 $\frac{1}{2}$ $\frac{S27}{S34}$

1962

Bury original stone cor. alongside iron post.

S. 89°42' W., beginning new measurement.

Desc. 30 ft. over rolling SW. slope.

14.50 Road, unimproved, in wash, 3.90 chs. wide, 7 ft. deep, bears NE. and SW.

36.40 Wash, 70 lks. wide, 5 ft. deep, drains SE., asc. 20 ft. over E. slope.

40.21 The cor. of secs. 27 and 34.

Land, rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

N. 0°10' W., along the W. bdy. of sec. 27.

Over rolling desert land through shadscale undergrowth. Asc. 175 ft. over rolling SW. slope.

9.00 Wash, 2.50 chs. wide, 4 ft. deep, drains SE.

21.00 Wash, 90 lks. wide, 4 ft. deep, drains SW.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

40.27

The $\frac{1}{4}$ sec. cor. of secs. 27 and 28, monumented with a limestone, 16x10x10 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the W. $\frac{1}{4}$ sec. cor. of sec. 27 only.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$

S27

1963

Bury original stone cor. alongside iron post.

N. $0^{\circ}13'$ W., beginning new measurement.

Asc. 225 ft. over rolling desert land.

15.10

Wash, 4.00 chs. wide, 25 ft. deep, drains SW.

19.90

Wash, 5.00 chs. wide, 30 ft. deep, drains W.

33.70

Wash, 60 lks. wide, 4 ft. deep, drains E.

40.12

The cor. of secs. 21, 22, 27 and 28, monumented with a limestone, 16x12x12 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the cor. of secs. 22 and 27 only.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

S21

S22

S27

1963

Bury original stone cor. alongside iron post.

Land, rolling desert.

Soil, rocky, sandy clay.

Timber, none.

Undergrowth, shadscale.

N. $0^{\circ}14'$ W., along the W. bdy. of sec. 22.

Over mountainous land through scattered shadscale undergrowth. Asc. 125 ft. over SE. slope.

10.10

Ridge, bears E. and W., desc. 240 ft. over NW. slope.

27.90

Small draw, drains NE., asc. 25 ft. over SE. slope.

35.40

Spur, slopes NE., desc. 60 ft. over NW. slope.

39.80

The $\frac{1}{4}$ sec. cor. of secs. 21 and 22, monumented with a limestone, 20x14x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{2}$
S21 | S22
1963

Bury original stone cor. alongside iron post.

N. $0^{\circ}36'$ E., beginning new measurement.

Desc. 30 ft. over NW. slope.

- 3.15 Wash, 90 lks. wide, 3 ft. deep, drains NE., desc. 130 ft. over NE. slope.
- 17.90 Wash, 3.00 chs. wide, 3 ft. deep, drains NE.
- 30.65 Wash, 1.00 ch. wide, 5 ft. deep, drains NE.
- 33.35 Road, unimproved, bears NE. and SW.
- 37.95 Wash, 80 lks. wide, 4 ft. deep, drains NE.
- 40.15 The cor. of secs. 15, 16, 21 and 22, monumented with a limestone, $18 \times 12 \times 8$ ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 18 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

S16 | S15
S21 | S22
1962

Bury original stone cor. alongside iron post.

Land, mountainous.
Soil, rocky.
Timber, none.
Undergrowth, shadscale.

N. $0^{\circ}16'$ W., bet. secs. 15 and 16.

Over mountainous land through shadscale undergrowth.
Asc. 50 ft. over SE. slope.

- 9.80 Spur, slopes E., desc. 55 ft. over NE. slope.
- 14.80 Draw, drains E., asc. 40 ft. over S. slope.
- 20.15 Spur, slopes NE., desc. 35 ft. over S. slope.
- 26.70 Draw, drains W., asc. 20 ft. over S. slope.
- 28.15 Spur, slopes W., desc. 135 ft. over NW. slope.
- 38.30 Draw, drains NW.
- 39.98 The $\frac{1}{2}$ sec. cor. of secs. 15 and 16, monumented with a limestone, $14 \times 8 \times 6$ ins., set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{2}$
S16|S15
1962

Bury original stone cor. alongside iron post.

N. $0^{\circ}02'$ W., beginning new measurement.

Desc. 195 ft. over rolling NW. slope.

20.30 Road, unimproved, bears NW. and SE.

35.50 Road, unimproved, bears NW. and SE.

40.32 The cor. of secs. 9, 10, 15 and 16, monumented with a limestone, 12x10x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

S9|S10
S16|S15
1962

Bury original stone cor. alongside iron post.

Land, mountainous and rolling desert.

Soil, rocky, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 10 and 11.

S. $89^{\circ}49'$ W., along the S. bdy. of sec. 10.

Over rolling desert land through scattered shadscale undergrowth.

10.00 Road, unimproved, bears NW. and SE.

11.30 Wash, 2.00 chs. wide, 4 ft. deep, drains NW., asc. 20 ft. over NE. slope.

15.90 Low spur, slopes NW., desc. 55 ft. over NW. slope.

38.50 Wash, drains NW., asc. 15 ft. over NE. slope.

40.12 The $\frac{1}{2}$ sec. cor. of secs. 10 and 15, monumented with a limestone, 14x12x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

T19S R18W

 $\frac{1}{2}$ S10

S15

1962

Bury original stone cor. alongside iron post.

S. 89°48' W., beginning new measurement.

Asc. 100 ft. over gentle NE. slope.

24.10 Right bank of wash, 10 ft. deep, drains NW.

30.20 Left bank of same wash.

32.15 Top of ascent slopes N., desc. 25 ft. over NW. slope.

40.08 The cor. of secs. 9, 10, 15 and 16.

Land, rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

N. 0°10' W., bet. secs. 9 and 10.

Over rolling desert land through shadscale undergrowth.
Desc. 75 ft. over NW. slope.

15.20 Wash, 4.00 chs. wide, 10 ft. deep, drains NW.

39.00 Wash, 1.00 ch. wide, 4 ft. deep, drains NW.

40.09 The $\frac{1}{2}$ sec. cor. of secs. 9 and 10, monumented with a
limestone, 14x8x5 ins., set, mkd. and witnessed as des-
cribed in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 20 ins.
in the ground, and in a collar of stone to top, with
brass cap mkd.

T19S R18W

 $\frac{1}{2}$

S9 | S10

1962

Bury original stone cor. alongside iron post.

N. 0°10' W., beginning new measurement.

Asc. 130 ft. over rolling SW. slope.

8.20 Road, unimproved, bears NE. and SW.

26.70 Wash, drains SW.

39.50 Spur, slopes SW., desc. 10 ft. over NW. slope.

40.19 The cor. of secs. 3, 4, 9 and 10, monumented with a
limestone, 14x8x6 ins., set, mkd. and witnessed as des-
cribed in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 10 ins.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS	in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T19S R18W <u>S4 S3</u> <u>S9 S10</u> 1962
	Bury original stone cor. alongside iron post.
	Land, rolling desert. Soil, rocky, sandy clay. Timber, none. Undergrowth, shadscale.
	From the cor. of secs. 2, 3, 10 and 11.
	S. 89°45' W., bet. secs. 3 and 10.
	Over rolling desert land through shadscale undergrowth. Desc. 90 ft. over rolling NW. slope.
11.90	Wash, 40 lks. wide, 3 ft. deep, drains NW.
13.10	Wash, 50 lks. wide, 4 ft. deep, drains N.
29.80	Wash, 70 lks. wide, 2 ft. deep, drains NW.
40.03	The $\frac{1}{2}$ sec. cor. of secs. 3 and 10, monumented with a limestone, 20x7x6 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2½ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T19S R18W <u>S3</u> $\frac{1}{2}$ S10 1962
	Bury original stone cor. alongside iron post.
	S. 89°45' W., beginning new measurement.
	Desc. 30 ft. over NW. slope.
2.50	Wash, 80 lks. wide, 5 ft. deep, drains NW.
11.40	Road, unimproved, bears NW. and SE.
15.65	Wash, 30 lks. wide, 2 ft. deep, drains NW.
16.90	Road, unimproved, bears NE. and SW.
19.95	Wash, 2.00 chs. wide, 2 ft. deep, drains N., asc. 155 ft. over NE. slope.
20.60	Road, unimproved, bears NW. and SE.
39.95	Spur, slopes NW., desc. 5 ft. over SW. slope.
40.02	The cor. of secs. 3, 4, 9 and 10.
	Land, rolling desert. Soil, sandy clay.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

Timber, none.
Undergrowth, shadscale.

N. 0°19' W., bet. secs. 3 and 4.

Over mountainous land through shadscale undergrowth.
Asc. 5 ft. over SW. slope.

0.20 Spur, slopes NW., desc. 75 ft. over NE. slope.

3.50 Head of draw, drains NW., asc. 40 ft. over SW. slope.

8.50 Spur, slopes W., desc. 50 ft. over NW. slope.

14.55 Draw, drains W., asc. 50 ft. over SW. slope.

18.05 Spur, slopes W., desc. 220 ft. over N. slope.

25.05 Wash, 50 lks. wide, 5 ft. deep, drains NW.

32.95 Road, unimproved, bears NE. and SW.

40.00 The $\frac{1}{4}$ sec. cor. of secs. 3 and 4, monumented with a limestone, 12x10x5 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$

S4|S3

1962

Bury original stone cor. alongside iron post.

N. 0°20' W., beginning new measurement.

Desc. 55 ft. over rolling NW. slope.

35.65 Wash, 2.00 chs. wide, 2 ft. deep, drains NW.

40.54 The cor. of secs. 3 and 4, on the N. bdy. of the Tp., monumented with a 2 $\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.

Land, mountainous S. portion; rolling N. portion.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 15, 16, 21 and 22.

S. 89°43' W., bet. secs. 16 and 21.

Over mountainous land through scattered shadscale undergrowth. Asc. 225 ft. over SE. slope.

14.70 Spur, slopes NE., desc. 140 ft. over NW. slope.

22.95 Wash, 1.10 chs. wide, 3 ft. deep, drains NW., asc. 200 ft. over NE. slope.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

- 34.10 Spur, slopes NE., desc. 115 ft. over steep NW. slope.
- 40.38 The $\frac{1}{4}$ sec. cor. of secs. 16 and 21, monumented with a limestone, 18x12x6 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
- T19S R18W
 $\frac{1}{4}$ $\frac{S16}{S21}$
1962
- Bury original stone cor. alongside iron post.
- _____
- S. 89°47' W., beginning new measurement.
- Desc. 140 ft. over NW. slope.
- 5.60 Wash, 40 lks. wide, 4 ft. deep, drains NW., asc. 80 ft. over NE. slope.
- 8.25 Spur, slopes NW., desc. 200 ft. over NW. slope.
- 17.40 Wash, 2.10 chs. wide, 3 ft. deep, drains NW., asc. 50 ft. over NE. slope.
- 21.70 Spur, slopes N., desc. 30 ft. over SW. slope.
- 23.75 Wash, 70 lks. wide, 4 ft. deep, drains NW., asc. 80 ft. over NE. slope.
- 29.60 Spur, slopes NW., desc. 155 ft. over SW. slope.
- 35.50 Wash, 20 lks. wide, 3 ft. deep, drains SW.
- 38.20 Wash, 60 lks. wide, 4 ft. deep, drains NW., asc. 15 ft. over NE. slope.
- 39.90 The cor. of secs. 16, 17, 20 and 21, monumented with a limestone, 18x10x6 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
- T19S R18W
 $\frac{S17}{S20}$ $\frac{S16}{S21}$
1962
- Bury original stone cor. alongside iron post.
- Land, mountainous.
Soil, rocky.
Timber, none.
Undergrowth, shadscale.
- N. 0°14' W., bet. secs. 16 and 17.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

	Over rolling desert land through scattered shadscale undergrowth. Desc. 20 ft. over NE. slope.
2.45	Wash, 2.00 chs. wide, 10 ft. deep, drains NW., asc. 50 ft. over SW. slope.
13.00	Spur, slopes NW., desc. 215 ft. over NW. slope.
28.35	Wash, drains NW.
40.22	The $\frac{1}{2}$ sec. cor. of secs. 16 and 17, monumented with a limestone, 18x10x6 ins., set, mkd. and witnessed as described in the official record. At the cor. point Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd. T19S R18W $\frac{1}{2}$ S17 S16 1962 Bury original stone cor. alongside iron post. N. 0°15' W., beginning new measurement. Desc. 170 ft. over rolling NW. slope.
8.00	Wash, 50 lks. wide, 5 ft. deep, drains NW.
15.65	Road, unimproved, bears NW. and SE.
27.45	Wash, 80 lks. wide, 6 ft. deep, drains NW.
40.13	The cor. of secs. 8, 9, 16 and 17, monumented with a limestone, 14x12x8 ins., set, mkd. and witnessed as described in the official record. At the cor. point Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T19S R18W S8 S9 S17 S16 1962 Bury original stone cor. alongside iron post. Land, mountainous S. portion; rolling N. portion. Soil, sandy clay. Timber, none. Undergrowth, shadscale.
12.10	From the cor. of secs. 9, 10, 15 and 16. S. 89°47' W., bet. secs. 9 and 16. Over rolling desert land through shadscale undergrowth. Desc. 40 ft. over gently rolling NW. slope. Road, unimproved, bears NE. and SW.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

28.20	Wash, 2.00 chs. wide, 3 ft. deep, drains NW.
32.00	Trail road, bears NE. and SW.
40.16	The $\frac{1}{4}$ sec. cor. of secs. 9 and 16, monumented with a limestone, 18x10x8 ins., set, mkd. and witnessed as described in the official record. At the cor. point Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd. T19S R18W $\frac{1}{4}$ $\frac{S9}{S16}$ 1962 Bury original stone cor. alongside iron post. S. $89^{\circ}48'$ W., beginning new measurement. Desc. 105 ft. over rolling NW. slope.
23.80	Wash, 1.10 chs. wide, 3 ft. deep, drains NW.
37.00	Wash, 70 lks. wide, 4 ft. deep, drains NW.
40.10	The cor. of secs. 8, 9, 16 and 17. Land, rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale.
	N. $0^{\circ}17'$ W., bet. secs. 8 and 9. Over rolling desert land through shadscale undergrowth. Desc. 60 ft. over gently rolling NW. slope.
7.00	Wash, drains NW.
23.65	Road, unimproved, bears NE. and SW.
29.00	Wash, drains W.
33.85	Wash, drains W.
35.85	Road, unimproved, bears E. and W.
40.10	The $\frac{1}{4}$ sec. cor. of secs. 8 and 9, monumented with a limestone, 14x10x8 ins., set, mkd. and witnessed as described in the official record. At the cor. point Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd. T19S R18W $\frac{1}{4}$ $\frac{S8}{S9}$ 1962 Bury original stone cor. alongside iron post.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

N. 0°12' W., beginning new measurement.

Desc. 70 ft. over gently rolling NW. slope.

0.50 Wash, 50 lks. wide, 10 ft. deep, drains W.

17.05 Road, unimproved, bears NE. and SW.

40.07 The cor. of secs. 4, 5, 8 and 9, monumented with a limestone, 16x12x5 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

S5 | S4

S8 | S9

1962

Bury original stone cor. alongside iron post.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 3, 4, 9 and 10,

S. 89°45' W., bet. secs. 4 and 9.

Over rolling desert land through shadscale undergrowth.
Asc. 25 ft. over NE. slope.

5.35 Spur, slopes NW., desc. 70 ft. over NW. slope.

9.50 Small draw, drains N., asc. 20 ft. over NE. slope.

11.10 Spur, slopes NW., desc. 220 ft. over NW. slope.

32.00 Draw, drains N., asc. 20 ft. over NE. slope.

34.80 Spur, slopes N., desc. 65 ft. over NW. slope.

40.09 The ¼ sec. cor. of secs. 4 and 9, monumented with a limestone, 14x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

¼ S4

S9

1962

Bury original stone cor. alongside iron post.

S. 89°44' W., beginning new measurement.

Desc. 135 ft. over rolling NW. slope.

Dependent Resurvey of a Portion of the Subdivisions, T. 19 S., R. 18 W.

CHAINS

10.95 Road, unimproved, bears NE. and SW.

34.30 Wash, 20 lks. wide, 3 ft. deep, drains NW.

37.40 Wash, 80 lks. wide, 3 ft. deep, drains NW.

40.11 The cor. of secs. 4, 5, 8 and 9.

Land, rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

N. $0^{\circ}13'$ W., bet. secs. 4 and 5.

Over gently rolling desert land through shadscale undergrowth.

16.55 Wash, drains W.

40.21 The $\frac{1}{4}$ sec. cor. of secs. 4 and 5, monumented with a limestone, 12x10x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$

S5 S4

1962

Bury original stone cor. alongside iron post.

N. $0^{\circ}15'$ W., beginning new measurement.

9.05 Wash, drains NW.

26.65 Wash, drains NW.

27.65 Road, unimproved, bears NW. and SE.

41.04 The cor. of secs. 4 and 5, on the N. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 19, 20, 29 and 30, monumented with a limestone, 16x14x12 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18

CHAINS	
	<p>T19S R18W S19 S20 S30 S29 1962</p> <p>Bury original stone cor. alongside iron post.</p> <p>Thence,</p> <p>S. 89°42' W., along the S. bdy. of sec. 19.</p> <p>Over mountainous land through scattered shadscale undergrowth. Desc. 75 ft. over SW. slope.</p>
5.90	Wash, 40 lks. wide, 2 ft. deep, drains NW., asc. 50 ft. over NE. slope.
15.45	Spur, slopes NW., desc. 100 ft. over SW. slope.
34.40	Wash, 40 lks. wide, 3 ft. deep, drains NW., asc. 45 ft. over NE. slope.
38.10	Spur, slopes NW., desc. 35 ft. over SW. slope.
40.00	<p>Point for the $\frac{1}{4}$ sec. cor. of sec. 30. Set an iron post, 30 ins. long $2\frac{1}{2}$ ins. diam., 6 ins. in the ground to bed rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;"> $\frac{1}{4}$ <u>T19S R18W</u> S30 1963 </p>
40.31	<p>The $\frac{1}{4}$ sec. cor. of secs. 19 and 30, monumented with a limestone, 18x12x6 ins., set, mkd. and witnessed as described in the official record. This cor. will now function as the S. $\frac{1}{4}$ sec. cor. of sec. 19 only.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 3 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;"> T19S R18W $\frac{1}{4}$ S19 <u>1962</u> </p> <p>Bury original stone cor. alongside iron post.</p> <p>S. 89°43' W., beginning new measurements.</p> <p>Desc. 170 ft. over SW. slope.</p>
7.90	Road, unimproved, bears N. and SW.
9.10	Wash, 1.00 ch. wide, 2 ft. deep, drains SW.
27.40	Wash, 40 lks. wide, 2 ft. deep, drains SW.
39.31	<p>The cor. of secs. 19, 24, 25 and 30, on the W. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey.</p> <p>Land, mountainous. Soil, rocky, shallow. Timber, none. Undergrowth, scattered shadscale.</p>
	<p>From the cor. of secs. 19, 20, 29 and 30.</p> <p>N. 0°15' W., bet. secs. 19 and 20.</p> <p>Over mountainous land through scattered shadscale undergrowth, Desc. 55 ft. over NE. slope.</p>

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

- 6.10 Wash, 50 lks. wide, 3 ft. deep, drains NW., desc. 60 ft. over NW. slope.
- 16.75 Wash, 30 lks. wide, 2 ft. deep, drains NW.
- 21.80 Wash, 1.50 chs. wide, 6 ft. deep, drains W., asc. 50 ft. over SW. slope.
- 25.25 Spur, slopes NW., desc. 45 ft. over NW. slope.
- 29.40 Wash, 30 lks. wide, 2 ft. deep, drains W.
- 35.20 Wash, 90 lks. wide, 4 ft. deep, drains NW.
- 40.28 The $\frac{1}{4}$ sec. cor. of secs. 19 and 20, monumented with a sandstone, 16x10x5 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$

S19 | S20

1962

Bury original stone cor. alongside iron post.

N. $0^{\circ}19'$ W., beginning new measurement.

Desc. 110 ft. over rolling NW. slope.

- 0.30 Wash, 50 lks. wide, 7 ft. deep, drains NW.
- 25.40 Wash, 1.80 chs. wide, 4 ft. deep, drains W.
- 33.25 Wash, 1.30 chs. wide, 4 ft. deep, drains NW.
- 40.49 The cor. of secs. 17, 18, 19 and 20, monumented with a limestone, 16x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

S18 | S17

S19 | S20

1962

Bury original stone cor. alongside iron post.

Land, mountainous, rolling.

Soil, rocky, shallow.

Timber, none.

Undergrowth, scattered shadscale.

From the cor. of secs. 16, 17, 20 and 21.

S. $89^{\circ}52'$ W., bet. secs. 17 and 20.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

	Over mountainous land through scattered shadscale undergrowth. Asc. 60 ft. over NE. slope.
3.65	Spur, slopes NW., desc. 180 ft. over NW. slope.
10.65	Wash, drains NW., asc. 25 ft. over NE. slope.
13.05	Spur, slopes N., desc. 110 ft. over NW. slope.
30.60	Wash, drains NW., asc. 100 ft. over NE. slope.
34.65	Spur, slopes SW., desc. 90 ft. over NW. slope.
40.12	The $\frac{1}{4}$ sec. cor. of secs. 17 and 20, monumented with a limestone, 24x16x10 ins., set, mkd. and witnessed as described in the official record.
	At the cor. point
	Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.
	T19S R18W
	$\frac{1}{4}$ $\frac{S17}{S20}$
	1962
	Bury original stone cor. alongside iron post.
	N. 89°49' W., beginning new measurement.
	Desc. 35 ft. over NW. slope.
3.15	Wash, 3.00 chs. wide, 5 ft. deep, drains SW., asc. 20 ft. over SE. slope.
9.30	Spur, slopes SW., desc. 165 ft. over rolling NW. slope.
17.45	Wash, 2.00 chs. wide, 4 ft. deep, drains NW.
22.75	Wash, 1.00 ch. wide, 5 ft. deep, drains NW.
25.75	Wash, 1.50 chs. wide, 5 ft. deep, drains NW.
35.45	Wash, 50 lks. wide, 2 ft. deep, drains NW.
40.94	The cor. of secs. 17, 18, 19 and 20.
	Land, mountainous.
	Soil, rocky.
	Timber, none.
	Undergrowth, scattered shadscale.
	S. 89°17' W., bet. secs. 18 and 19.
	Over rolling land through shadscale undergrowth. Desc. 135 ft. over NW. slope.
5.40	Wash, 1.10 lks. wide, 3 ft. deep, drains NW.
12.40	Wash, 80 lks. wide, 4 ft. deep, drains NW.
21.10	Wash, 1.20 lks. wide, 6 ft. deep, drains NW.
26.90	Wash, 3.40 chs. wide, 5 ft. deep, drains NW.
39.46	The $\frac{1}{4}$ sec. cor. of secs. 18 and 19, monumented with a

Dependent: Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

limestone, 14x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ S18

S19

1962

Bury original stone cor. alongside iron post.

S. $89^{\circ}48'$ W., beginning new measurement.

Desc. 100 ft. over gently rolling NW. slope.

4.70 Wash, 2.10 chs. wide, 4 ft. deep, drains NW.

39.36 The closing cor. of secs. 18 and 19, monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey.

Land, rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 19 at midpoint bet. the cor. of secs. 19, 24, 25 and 30 and the closing cor. of secs. 18 and 19.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S

R19W R18W

$\frac{1}{4}$

S19

1963

From which, the E. $\frac{1}{4}$ sec. cor. of sec. 24, T. 19 S., R. 19 W., bears N. $0^{\circ}13'$ W., 0.46 chs. dist.

From the cor. of secs. 17, 18, 19 and 20.

N. $0^{\circ}53'$ E., bet. secs. 17 and 18.

Over rolling land through shadscale undergrowth. Desc. 150 ft. over rolling NW. slope.

3.50 Wash, 2.50 chs. wide, 7 ft. deep, drains W.

19.70 Wash, 3.00 chs. wide, 4 ft. deep, drains NW.

29.20 Wash, 1.50 chs. wide, 4 ft. deep, drains NW.

32.20 Wash, drains NW.

36.00 Road, unimproved, bears NW. and SE.

38.85 Wash, drains NW.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

39.87

The $\frac{1}{4}$ sec. cor. of secs. 17 and 18, monumented with a limestone, 14x10x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$
S18|S17
1962

Bury original stone cor. alongside iron post.

N. $0^{\circ}14'$ W., beginning new measurement.

Desc. 85 ft. over gently rolling NW. slope.

1.60

Road, unimproved, bears NE. and irregularly S.

6.40

Road, unimproved, bears NW. and SE.

40.12

The cor. of secs. 7, 8, 17 and 18, monumented with a limestone, 14x10x4 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$
S7|S8
S18|S17
1962

Bury original stone cor. alongside iron post.

Land, gently rolling desert.

Soil, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 8, 9, 16 and 17.

S. $89^{\circ}48'$ W., bet. secs. 8 and 17.

Over rolling desert land through shadscale undergrowth. Desc. 110 ft. over gently rolling NW. slope.

0.55

Wash, 60 lks. wide, 3 ft. deep, drains NW.

10.60

Wash, 2.00 chs. wide, 6 ft. deep, drains NW.

19.60

Road, unimproved, bears NE. and SW.

21.70

Wash, 2.50 chs. wide, 2 ft. deep, drains NW.

24.00

Low spur, slopes SW., continue descent.

40.15

The $\frac{1}{4}$ sec. cor. of secs. 8 and 17, monumented with a sandstone, 16x10x6 ins., set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS	
	<p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T19S R18W $\frac{1}{4} \frac{S8}{S17}$ 1962</p> <p>Bury original stone cor. alongside iron post.</p> <hr/> <p>S. 89°48' W., beginning new measurement.</p> <p>Desc. 65 ft. over gently rolling NW. slope.</p>
6.10	Road, unimproved, bears NE. and SW.
40.13	The cor. of secs. 7, 8, 17 and 18.
	<p>Land, gently rolling desert.</p> <p>Soil, sandy clay.</p> <p>Timber, none.</p> <p>Undergrowth, shadscale.</p>
	<p>S. 89°47' W., bet. secs. 7 and 18.</p> <p>Over gently rolling desert land through shadscale undergrowth. Desc. 50 ft. over gently rolling NW. slope.</p>
4.25	Road, unimproved, bears NW. and SE.
24.55	Ditch, drains NW.
24.80	Road, unimproved, bears NW. and SE.
40.09	The ¼ sec. cor. of secs. 7 and 18, monumented with a limestone, 12x8x6 ins., set, mkd. and witnessed as described in the official record.
	<p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T19S R18W $\frac{1}{4} \frac{S7}{S18}$ 1962</p> <p>Bury original stone cor. alongside iron post.</p> <hr/> <p>S. 89°46' W., beginning new measurement.</p> <p>Desc. 75 ft. over gentle W. slope.</p>
0.50	Road, unimproved, bears NE. and SW.
16.80	Right bank of wash, 15 ft. deep, drains NW.
24.00	Left bank of same wash.
32.50	Wash, 1.10 chs. wide, 2 ft. deep, drains SW.
39.96	The closing cor. of secs. 7 and 18, on the W. bdy. of

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

the Tp. monumented with a 2½ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey.

Land, gently rolling.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale.

Point for the W. ¼ sec. cor. of sec. 18, at midpoint bet. the closing cor. of secs. 7 and 18 and the closing cor. of secs. 18 and 19.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S
R19W R18W

½
| S18
1963

From which, the E. ¼ sec. cor. of sec. 13, T. 19 S., R. 19 W., bears N. 0°11' W., 0.955 chs. dist.

From the cor. of secs. 7, 8, 17 and 18.

N. 0°16' W., bet. secs. 7 and 8.

Over nearly level desert land through shadscale undergrowth.

6.05 Wash, drains NW.

18.65 Road, unimproved, bears NE. and SW.

40.07 The ¼ sec. cor. of secs. 7 and 8, monumented with a limestone, 12x12x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T19S R18W

½
S7 | S8
1962

Bury original stone cor. alongside iron post.

N. 0°15' W., beginning new measurement.

15.05 Irrigation ditch, drains S. 63°15' W.

19.10 Wash, 40 lks. wide, 3 ft. deep, drains NW.

20.80 Wash, 30 lks. wide, 5 ft. deep, drains NW.

32.30 Road, unimproved, bears NW. and SE.

40.09 The cor. of secs. 5, 6, 7 and 8, monumented with a limestone, 14x8x6 ins., set, mkd. and witnessed as described in the official record.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS	
	<p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T19S R18W $\frac{S6}{S7} \frac{S5}{S8}$ 1962</p> <p>Bury original stone cor. alongside iron post.</p> <p>Land, nearly level desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale.</p>
<p>36.00</p> <p>40.13</p>	<p>From the cor. of secs. 4, 5, 8 and 9.</p> <p>S. 89°49' W., bet. secs. 5 and 8.</p> <p>Over gently rolling desert land through shadscale undergrowth.</p> <p>Wash, 4.00 chs. wide, 2 ft. deep, drains NW.</p> <p>The ¼ sec. cor. of secs. 5 and 8, monumented with a limestone, 20x12x8 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">T19S R18W $\frac{1}{4} \frac{S5}{S8}$ 1962</p> <p>Bury original stone cor. alongside iron post.</p>
<p>9.30</p> <p>19.00</p> <p>24.85</p> <p>31.90</p> <p>40.15</p> <p>10.35</p>	<p>S. 89°46' W., beginning new measurement.</p> <p>Road, unimproved, bears NW. and SE.</p> <p>Wash, 2.40 chs. wide, 3 ft. deep, drains NW.</p> <p>Wash, 80 lks. wide, 4 ft. deep, drains NW.</p> <p>Road, unimproved, bears NW. and SE.</p> <p>The cor. of secs. 5, 6, 7 and 8.</p> <p>Land, gently rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale.</p> <p>S. 89°44' W., bet. secs. 6 and 7.</p> <p>Over gently rolling desert land through shadscale undergrowth.</p> <p>Road, unimproved, bears NW. and SE.</p>

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS

- 13.25 Wash, 1.20 chs. wide, 2 ft. deep, drains NW.
- 40.12 The $\frac{1}{4}$ sec. cor. of secs. 6 and 7, monumented with a limestone, 14x8x6 ins., set, mkd. and witnessed as described in the official record.
- At the cor. point
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T19S R18W
 $\frac{1}{4}$ $\frac{S6}{S7}$
1962
- Bury original stone cor. alongside iron post.
-
- S. $89^{\circ}42'$ W., beginning new measurement.
- 4.50 Gravel road, bears N. 42° E. and S. 42° W.
- 39.22 The closing cor. of secs. 6 and 7, on the W. bdy. of the Tp. monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1956 resurvey.
- Land, gently rolling.
Soil, sandy clay.
Timber, none.
Undergrowth, shadscale.
-
- Point for the W. $\frac{1}{4}$ sec. cor. of sec. 7, at midpoint bet. the closing cor. of secs. 7 and 18 and the closing cor. of secs. 6 and 7.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T19S
R19W R18W
 $\frac{1}{4}$ | S7
1963
- From which, the E. $\frac{1}{4}$ sec. cor. of sec. 12, T. 19 S., R. 19 W., bears N. $0^{\circ}08'$ W., 1.235 chs. dist.
-
- Point for the W. $\frac{1}{4}$ sec. cor. of sec. 6, at proportionate dist.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T19S
R19W R18W
 $\frac{1}{4}$ | S6
1963
- From which, the E. $\frac{1}{4}$ sec. cor. of sec. 1, T. 19 S., R. 19 W., bears N. $0^{\circ}12'$ W., 1.49 chs. dist.

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 18 W.

CHAINS	
	<p>From the cor. of secs. 5, 6, 7 and 8.</p> <p>N. 0°11' W., bet. secs. 5 and 6.</p> <p>Over gently rolling desert land through shadscale undergrowth.</p>
23.80	Road, unimproved, bears NW. and SE.
25.90	Wash, 2.00 chs. wide, 2 ft. deep, drains NW.
31.30	Wash, drains NW.
39.90	<p>Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 5 and 6.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T19S R18W $\frac{1}{4}$ S6 \uparrow S5 W C 1962</p> <p>raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p>
40.15	Point for the $\frac{1}{4}$ sec. cor. of secs. 5 and 6, at proportionate dist. falls in wash, 60 lks. wide, 2 ft. deep, drains NW., and deemed unsafe to perpetuate. There is no remaining evidence of the original cor.
42.40	Wash, drains NW.
53.00	Wash, 50 lks. wide, 3 ft. deep, drains NW.
57.25	Gravel road, bears N. 37°32' E. and S. 37°32' W.
62.25	Fence, bears E. and W.
81.88	<p>The cor. of secs. 5 and 6, on the N. bdy. of the Tp. monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.</p> <p>Land, gently rolling. Soil, sandy clay. Timber, none. Undergrowth, shadscale.</p>
Completion Survey of the Subdivision of Township 19 South, Range 18 West	
	<p>From the cor. of secs. 25, 26, 35 and 36, monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.</p> <p>North, bet. secs. 25 and 26, on a sectional guide meridian.</p> <p>Over broken desert land through shadscale undergrowth. Desc. 120 ft. along E. slope.</p>
4.90	Small wash, drains E.
8.00	Small spur, slopes E.
15.40	Small spur, slopes E., desc. 75 ft. over N. slope.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

- 23.30 Base of low hills, bears SE. and W., desc. 55 ft. over gentle NE. slope.
- 36.30 Wash, 20 lks. wide, 2 ft. deep, drains N. 80° W., with jeep trail in bottom, asc. 25 ft. along gentle W. slope.
- 40.00 Point for the $\frac{1}{4}$ sec. cor. of secs. 25 and 26.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.
- T19S R18W
 $\frac{1}{4}$
S26 | S25
1963
- Asc. 15 ft. along W. slope.
- 57.50 Small wash, drains W.
- 62.10 Small wash, drains W.
- 64.00 Low spur, slopes W., desc. 30 ft. along W. slope.
- 71.70 Wash, 20 lks. wide, 2 ft. deep, drains S. 80° W., asc. 15 ft. over gentle S. slope.
- 73.20 Road, unimproved, bears NE. and SW.
- 80.00 Point for the cor. of secs. 23, 24, 25 and 26.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.
- T19S R18W
S23 | S24
S26 | S25
1963
- raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- Land, broken desert.
Soil, rocky.
Timber, none.
Undergrowth, shadscale.
-
- From the cor. of secs. 24 and 25, on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.
- S. 89°42' W., bet. secs. 24 and 25.
- Over mountainous land through shadscale undergrowth. Asc. 360 ft. over SE. slope.
- 18.05 Spur, slopes SW., desc. 220 ft. over NW. slope.
- 40.86 Point for the $\frac{1}{4}$ sec. cor. of secs. 24 and 25.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

T19S R18W

 $\frac{1}{2}$ S24

S25

1963

Desc. 220 ft. over NW. slope.

70.45 Road, unimproved, bears NE. and SW.

75.95 Wash, 20 lks. wide, 1 ft. deep, drains SW.

80.86 The cor. of secs. 23, 24, 25 and 26.

Land, mountainous.

Soil, rocky.

Timber, none.

Undergrowth, shadscale.

North, bet. secs. 23 and 24, on a sectional guide meridian.

Over rolling desert land through shadscale undergrowth.
Asc. 145 ft. over gentle S. slope.

13.60 Trail road, bears E. and W.

30.50 Spur, slopes SW., desc. 80 ft. over NW. slope.

39.10 Draw, drains SW., asc. 25 ft. over SW. slope.

40.00 Point for the $\frac{1}{2}$ sec. cor. of secs. 23 and 24.Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

 $\frac{1}{2}$

S23 | S24

1963

Asc. 45 ft. over SW. slope.

45.90 Ridge, bears NW. and SE., desc. 135 ft. over NE. slope.

80.00 Point for the cor. of secs. 13, 14, 23 and 24.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 15 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

S14 | S13

S23 | S24

1963

Land, rolling desert.

Soil, rocky, sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 13 and 24, on the E. bdy. of the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.S. $89^{\circ}42'$ W., bet. secs. 13 and 24.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

Over mountainous land through shadscale undergrowth.
Asc. 20 ft. over E. slope.

- 2.50 Spur, slopes N., desc. 160 ft. over SW. slope.
- 28.55 Trail road, bears NW. and SE.
- 30.15 Wash, 10 lks. wide, 2 ft. deep, drains NW., asc. 35 ft. over NE. slope.
- 39.05 Spur, slopes NW., desc. 5 ft. over W. slope.
- 40.00 Point for the S. $\frac{1}{4}$ sec. cor. of sec. 13.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

 $\frac{1}{4}$ S13

1963

- 41.46 Point for the N. $\frac{1}{4}$ sec. cor. of sec. 24.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

 $\frac{1}{4}$ S24

1963

- Desc. 10 ft. over SW. slope.
- 42.75 Wash, 10 lks. wide, 1 ft. deep, drains NW., asc. 125 ft. over NE. slope.
- 58.65 Spur, slopes N., desc. 315 ft. over steep W. slope.
- 79.00 Wash, 20 lks. wide, 2 ft. deep, drains N., asc. 30 ft. over NE. slope.
- 81.46 The cor. of secs. 13, 14, 23 and 24.
- Land, mountainous.
Soil, rocky.
Timber, none.
Undergrowth, shadscale.

North, bet. secs. 13 and 14, on a sectional guide meridian.

Over rolling desert hills through shadscale undergrowth.
Desc. 75 ft. over NE. slope.

- 13.55 Wash, 50 lks. wide, 2 ft. deep, drains NW., asc. 60 ft. over SW. slope.
- 21.85 Spur, slopes W., desc. 130 ft. over NW. slope.
- 36.00 Trail road, bears NW. and SE.
- 40.00 Point for the E. $\frac{1}{4}$ sec. cor. of sec. 14.
- Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

T19S R18W

 $\frac{1}{2}$

S14

1963

41.00 raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
Point for the W. $\frac{1}{2}$ sec. cor. of sec. 13.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R18W

 $\frac{1}{2}$

S13

1963

raise a mound of stone, 3 ft. base, 2 ft. high, E. of cor.
Asc. 60 ft. over SW. slope.

55.80 Small spur, slopes W., desc. 25 ft. over NW. slope.

58.00 Wash, 1.00 ch. wide, 2 ft. deep, drains W., asc. 70 ft. over SW. slope.

70.55 Spur, slopes W., desc. 65 ft. over N. slope.

77.60 Wash, 10 lks. wide, 2 ft. deep, drains W., asc. 10 ft. over S. slope.

81.00 Intersect the S. bdy. of sec. 12. Point for the closing cor. of secs. 13 and 14.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

S12

S14 | S13

C C

1963

From which, the cor. of secs. 11 and 12, bears N. 89° 55' W., 0.92 chs. dist., hereinbefore described.

Land, rolling desert hills.

Soil, rocky.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 25, 26, 35 and 36.

West, bet. secs. 26 and 35.

Over rolling desert land through shadscale undergrowth.
Asc. 140 ft. over NE. slope.

10.60 Spur, slopes NE., desc. 45 ft. over NW. slope.

12.50 Small draw, drains N., asc. 30 ft. over E. slope.

17.90 Spur, slopes N., desc. 105 ft. over W. slope.

22.30 Wash, 30 lks. wide, 2 ft. deep, drains N., asc. 130 ft. over E. slope.

30.00 Spur, slopes N., desc. 120 ft. over NW. slope.

38.00 Point selected for the witness S. $\frac{1}{2}$ sec. cor. of sec. 26.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 2 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

W $\frac{1}{2}$ S26

C

1963

Desc. 20 ft. over ledgy NW. slope.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

40.00

Point for the S. $\frac{1}{4}$ sec. cor. of sec. 26 falls on ledge and cannot be perpetuated.

40.67

Point for the N. $\frac{1}{4}$ sec. cor. of sec. 35.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ S35

1963

Desc. 100 ft. over NW. slope.

49.75

Slope changes, desc. 335 ft. over NW. slope.

74.50

Wash, 35 lks. wide, 2 ft. deep, drains NW.

80.67

Intersect the E. bdy. of sec. 34. Point for the closing cor. of secs. 26 and 35.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 2 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

S34 $\frac{S26}{S35}$ CC

1963

From which, the cor. of secs. 27 and 34, bears N. 0° 20' W., 0.34 chs. dist., hereinbefore described.

Land, rolling desert.

Soil, rocky sandy clay.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 23, 24, 25 and 26.

West, bet. secs. 23 and 26.

Over rolling desert land through shadscale undergrowth. Desc. 25 ft. over gentle W. slope.

28.90

Base of descent, asc. 65 ft. over gentle SE. slope. Enter scattered juniper timber.

40.00

Point for the $\frac{1}{4}$ sec. cor. of secs. 23 and 26.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 12 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ $\frac{S23}{S26}$

1963

Asc. 140 ft. over steep, broken SE. slope.

52.10

Draw, drains SE., asc. 230 ft. over steep, broken SE. slope.

60.15

Ridge, bears NE. and SW., desc. 345 ft. over steep, broken NW. slope.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

74.35 Wash, 15 lks. wide, 2 ft. deep, drains SW., asc. 150 ft. over SE. slope.

80.00 Point for the cor. of secs. 22 and 23.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 3 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W

S22 | S23

S26

1963

Land, rolling, mountainous, broken.

Soil, rocky.

Timber, scattered juniper W. portion; no timber E. portion.

Undergrowth, shadscale.

N. $89^{\circ}51'$ W., along the S. bdy. of sec. 22.

Over broken and irregular desert hills through scattered juniper timber and shadscale undergrowth. Asc. 5 ft. over SE. slope.

1.00 Spur, slopes SW., desc. 15 ft. over gentle NW. slope.

10.50 Top of broken ledges facing NW., thence by triangulation, desc. about 300 ft. over broken NW. slope.

26.15 Road, unimproved, bears N. and S. End triangulation. Asc. 30 ft. over E. slope.

31.10 Small spur, slopes SE., desc. 10 ft. over SW. slope.

37.30 Wash, 30 lks. wide, 2 ft. deep, drains SE., asc. 25 ft. over NE. slope.

40.00 Point for the S. $\frac{1}{4}$ sec. cor. of sec. 22.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ S22

1963

Asc. 105 ft. over NE. slope.

49.05 Spur, slopes N., desc. 55 ft. over NW. slope.

59.00 Draw, drains NE., asc. 100 ft. over SE. slope.

67.20 Spur, slopes NE., desc. 40 ft. over NW. slope.

71.15 Draw, drains NE., asc. 55 ft. over E. slope.

81.25 The cor. of secs. 22 and 27, hereinbefore described.

Land, mountainous, broken.

Soil, rocky.

Timber, scattered juniper.

Undergrowth, shadscale.

From the E. $\frac{1}{4}$ sec. cor. of sec. 27, hereinbefore des-

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

cribed.

North, bet. secs. 26 and 27.

Over mountainous land through shadscale undergrowth.
Asc. 50 ft. over SE. slope.

4.90 Spur, slopes SW., desc. 60 ft. over NW. slope.

20.15 Wash, 2.00 chs. wide, 1 ft. deep, drains SW., asc. 265
ft. over SE. slope.39.52 Intersect the S. bdy. of sec. 22. Point for the closing
cor. of secs. 26 and 27.Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid
rock, and in a mound of stone, 4 ft. base to top, with
brass cap mkd.

T19S R18W

$$\begin{array}{c} \text{S22} \\ \hline \text{S27} \mid \text{S26} \\ \text{C C} \\ 1963 \end{array}$$
From which, the cor. of secs. 22 and 23, bears S. 89°
51' E., 0.86 chs. dist., hereinbefore described.

Land, mountainous.

Soil, rocky.

Timber, none.

Undergrowth, shadscale.

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 26, at midpoint
bet. the closing cor. of secs. 26 and 35 and the clo-
sing cor. of secs. 26 and 27.Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T19S R18W

$$\begin{array}{c} \frac{1}{4} \\ \mid \\ \text{S26} \\ 1963 \end{array}$$
raise a mound of stone, 3 ft. base, 2 ft. high, E. of
cor.From this cor., the E. $\frac{1}{4}$ sec. cor. of sec. 27, bears
N. $0^{\circ}11'$ W., 0.47 chs. dist., hereinbefore described.Point for the N. $\frac{1}{4}$ sec. cor. of sec. 27, 40.00 chs.
Easting from the cor. of secs. 22 and 27.Set an iron post 30 ins. long, $2\frac{1}{2}$ ins. diam., 2 ins. in
the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft.
base to top, with brass cap mkd.

T19S R18W

$$\begin{array}{c} \frac{1}{4} \text{ S27} \\ 1963 \end{array}$$
From which, the S. $\frac{1}{4}$ sec. cor. of sec. 22, bears S. 89°
51' E., 1.25 chs. dist., hereinbefore described.

From the cor. of secs. 22 and 23.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

N. 0°01' W., bet. secs. 22 and 23.

Over broken, mountainous land through scattered juniper timber with shadscale undergrowth. Asc. 55 ft. over SE. slope.

6.80 Spur, slopes SW., desc. 370 ft. over NW. slope.

36.60 Wash, 10 lks. wide, 2 ft. deep, drains NE., asc. 10 ft. over SE. slope.

40.00 Point for the $\frac{1}{4}$ sec. cor. of secs. 22 and 23.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$
S22 | S23
1963

Asc. 10 ft. over SE. slope.

44.50 Low spur, slopes NE., desc. 80 ft. over N. slope.

50.80 Wash, 30 lks. wide, with trail road in bottom, drains NE., desc. 65 ft. over gentle NE. slope.

80.00 Point for the cor. of secs. 14, 15, 22 and 23.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R18W

S15 | S14
S22 | S23
1963

raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, broken, mountainous.

Soil, rocky, sandy clay.

Timber, scattered juniper.

Undergrowth, shadscale.

From the cor. of secs. 13, 14, 23 and 24.

N. 89°56' W., bet. secs. 14 and 23.

Over rolling desert land through shadscale undergrowth. Asc. 85 ft. over E. slope.

4.20 Spur, slopes NE., desc. 280 ft. over NW. slope.

39.60 Trail road, bears NE. and SW.

39.98 Point for the $\frac{1}{4}$ sec. cor. of secs. 14 and 23.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ S14
S23
1963

raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS	
	Desc. 65 ft. over gentle NW. slope.
43.70	Wash, 10 lks. wide, 1 ft. deep, drains NW.
49.90	Wash, 25 lks. wide, 2 ft. deep, drains NW.
58.30	Road, unimproved, bears NW. and SE.
70.60	Road, unimproved, bears N. and S.
72.10	Wash, 1.00 ch. wide, 3 ft. deep, drains N., asc. 5 ft. over gentle E. slope.
79.96	The cor. of secs. 14, 15, 22 and 23. Land, rolling desert. Soil, sandy clay. Timber, none. Undergrowth, shadscale.
	N. 89°48' W., bet. secs. 15 and 22. Over rolling desert land through scattered juniper timber with shadscale undergrowth. Asc. 45 ft. over gentle E. slope.
16.15	Spur, slopes S., desc. 40 ft. over SW. slope.
23.25	Wash, 10 lks. wide, 1 ft. deep, drains NW., asc. 25 ft. over E. slope.
27.70	Spur, slopes S., desc. 50 ft. over SW. slope.
32.10	Wash, 20 lks. wide, 2 ft. deep, drains NW., asc. 110 ft. over rocky NE. slope.
40.00	Point for the N. $\frac{1}{4}$ sec. cor. of sec. 22. Set an iron post, 30 ins. long, 2½ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd. T19S R18W <u>¼ S22</u> 1963
41.21	Point for the S. $\frac{1}{4}$ sec. cor. of sec. 15. Set an iron post, 30 ins. long, 2½ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd. T19S R18W <u>¼ S15</u> 1963 Asc. 5 ft. over NE. slope.
41.65	Spur, slopes N., desc. 115 ft. over NW. slope.
44.90	Wash, 15 lks. wide, 2 ft. deep, drains N., asc. 120 ft. over E. slope.
50.25	Spur, slopes N., desc. 50 ft. over NW. slope.
53.65	Wash, drains N., asc. 50 ft. over E. slope.
56.35	Spur, slopes NE., desc. 40 ft. over NW. slope.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS	
60.10	Wash, 10 lks. wide, 2 ft. deep, drains NE., asc. 40 ft. over NE. slope.
62.95	Spur, slopes NE., desc. 85 ft. over NW. slope.
74.85	Wash, 40 lks. wide, 2 ft. deep, drains N., asc. 55 ft. over E. slope.
81.21	<p>The cor. of secs. 15, 16, 21 and 22, hereinbefore described.</p> <p>Land, mountainous. Soil, rocky. Timber, scattered juniper. Undergrowth, shadscale.</p>
	<p>From the cor. of secs. 14, 15, 22 and 23.</p> <p>N. 0°01' W., bet. secs. 14 and 15.</p> <p>Over rolling desert hills through scattered juniper timber with shadscale undergrowth. Desc. 80 ft. over N. slope.</p>
29.55	Wash, 40 lks. wide, 1 ft. deep, with trail road in bottom, drains NW., asc. 15 ft. over gentle SW. slope.
34.75	Small spur, slopes SW., desc. 20 ft. over gentle NW. slope.
40.00	<p>Point for the W. $\frac{1}{4}$ sec. cor. of sec. 14.</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 10 ins. in the ground to bedrock, and in a mound of stone, 3$\frac{1}{2}$ ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T19S R18W $\frac{1}{4}$ S14 1963</p>
40.64	<p>Point for the E. $\frac{1}{4}$ sec. cor. of sec. 15.</p> <p>Set an iron post, 30 ins. long, 2$\frac{1}{2}$ ins. diam., 4 ins. in the ground to bedrock, and in a mound of stone, 3$\frac{1}{2}$ ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T19S R18W $\frac{1}{4}$ S15 1963</p>
	Desc. 80 ft. over NW. slope.
60.55	Same wash and trailroad, drains NE. from SW.
64.75	Same wash and trailroad, drains NW. from SE., asc. 20 ft. over S. slope.
67.35	Small spur, slopes W., desc. 25 ft. over N. slope.
69.80	Wash, 15 lks. wide, 3 ft. deep, drains W., asc. 40 ft. over S. slope.
72.05	Road, unimproved, bears E. and W.
78.10	Small spur, slopes W., desc. 30 ft. over N. slope.

424

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

80.64

Intersect the S. bdy. of sec. 11. Point for the closing cor. of secs. 14 and 15.

Set an iron post; 30 ins. long; $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R18W

S11

S15 | S14

C C

1963

raise a mound of stone, 3 ft. base, 2 ft. high, S. of cor.

From this cor., the cor. of secs. 10 and 11, bears S. $89^{\circ}50'$ W., 1.08 chs. dist., hereinbefore described.

Land, rolling desert hills.

Soil, rocky.

Timber, scattered juniper.

Undergrowth, shadscale.

Point for the N. $\frac{1}{4}$ sec. cor. of sec. 14 at midpoint bet. the closing cor. of secs. 14 and 15 and the closing cor. of secs. 13 and 14.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 16 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

 $\frac{1}{4}$ S14

1963

raise a mound of stone, 3 ft. base, 2 ft. high, S. of cor.

From this cor., the S. $\frac{1}{4}$ sec. cor. of sec. 11, bears S. $89^{\circ}55'$ W., 1.03 chs. dist., hereinbefore described.

From the cor. of secs. 28, 29, 32 and 33, monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey.

East, bet. secs. 28 and 33.

Over broken, mountainous land through scattered juniper timber with shadscale undergrowth. Desc. 90 ft. over E. slope.

10.50 Wash, 35 lks. wide, 2 ft. deep, drains SE., asc. 65 ft. over W. slope.

22.80 Spur, slopes S., desc. 55 ft. over SE. slope.

36.55 Wash, 10 lks. wide, 1 ft. deep, drains S., asc. 50 ft. over W. slope.

40.20 Spur, slopes S.

40.21 Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 33.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock; and in a mound of stone, 4 ft. base to top, with brass cap mkd.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS	
	<p>T19S R18W $\frac{1}{4}$ $\frac{S28}{S33}$ 1963</p> <p>Desc. 60 ft. over SE. slope.</p> <p>46.75 Wash, 20 lks. wide, 1 ft. deep, drains S., asc. 55 ft. over SW. slope.</p> <p>51.50 Spur, slopes S., desc. 55 ft. over SE. slope.</p> <p>56.50 Wash, 30 lks. wide, 1 ft. deep, drains S., asc. 110 ft. over W. slope.</p> <p>64.75 Spur, slopes S., desc. 85 ft. over SE. slope.</p> <p>70.40 Wash, 10 lks. wide, 1 ft. deep, drains S., asc. 50 ft. over W. slope.</p> <p>73.95 Spur, slopes S., desc. 55 ft. over E. slope.</p> <p>80.42 Intersect the W. bdy. of sec. 34. Point for the closing cor. of secs. 28 and 33.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p>T19S R18W C $\frac{S28}{S33}$ S34 1963</p> <p>raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <p>From this cor., the cor. of secs. 27 and 34, bears N. $0^{\circ}13'$ W., 0.67 chs. dist., hereinbefore described.</p> <p>Land, broken and mountainous. Soil, rocky. Timber, scattered juniper. Undergrowth, shadscale.</p>
	<p>From the cor. of secs. 28, 29, 32 and 33.</p> <p>North, bet. secs. 28 and 29.</p> <p>Over broken mountainous land through scattered juniper timber with shadscale undergrowth. Asc. 15 ft. over SE. slope.</p> <p>3.80 Spur, slopes E., desc. 65 ft. over NE. slope.</p> <p>7.15 Wash, 30 lks. wide, 2 ft. deep, drains SE., asc. 115 ft. over SW. slope.</p> <p>21.70 Spur, slopes W., desc. 10 ft. over NW. slope.</p> <p>28.10 Draw, drains SW., asc. 95 ft. over SE. slope.</p> <p>35.95 Spur, slopes SW., desc. 40 ft. over NW. slope.</p> <p>40.00 Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 29 falls in wash, 50 lks. wide, 2 ft. deep, drains SW., and is not perpetuated.</p> <p>41.00 Point selected for the witness $\frac{1}{4}$ sec. cor. of secs. 28 and 29.</p>

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T19S R18W

$\frac{1}{2}$

S29 | S28

W C

1963

Asc. 275 ft. over SE. slope.

66.30 Spur, slopes E., desc. 40 ft. over NE. slope.

68.75 Wash, 20 lks. wide, 1 ft. deep, drains E., asc. 235 ft. over S. slope.

80.00 Point for the cor. of secs. 20, 21, 28 and 29.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T19S R18W

S20 | S21

S29 | S28

1963

Land, broken and mountainous.

Soil, rocky.

Timber, scattered juniper.

Undergrowth, shadscale.

East, bet. secs. 21 and 28.

Over broken mountainous land through scattered juniper timber with shadscale undergrowth. Desc. 205 ft. over SE. slope.

12.65 Wash, 30 lks. wide, 2 ft. deep, drains SE., asc. 15 ft. over SW. slope.

15.25 Small spur, slopes SE., desc. 40 ft. over SE. slope.

21.90 Wash, 35 lks. wide, 1 ft. deep, drains SW., asc. 140 ft. over NW. slope.

32.15 Spur, slopes SW., desc. 75 ft. over SE. slope.

39.65 Small spur, slopes SE., desc. 10 ft. over NE. slope.

40.02 Point for the $\frac{1}{2}$ sec. cor. of secs. 21 and 28.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 3 ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{2}$ S21

S28

1963

Desc. 25 ft. over NE. slope.

42.30 Draw, drains SE., asc. 5 ft. over gentle SW. slope.

45.00 Spur, slopes S., desc. 25 ft. over SE. slope.

47.65 Wash, 20 lks. wide, 2 ft. deep, drains SW., asc. 210 ft. over W. slope.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

- 57.75 Spur, slopes SE., desc. 125 ft. over NE. slope.
- 74.35 Wash, 25 lks. wide, 1 ft. deep, drains SE., asc. 10 ft. over SW. slope.
- 77.95 Spur, slopes SE., desc. 25 ft. over E. slope.
- 80.04 Intersect the W. bdy. of sec. 27. Point for the closing cor. of secs. 21 and 28.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 4 ins. in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W
 C $\frac{S21}{S28}$ | S27
 1963

From which, the cor. of secs. 22 and 27, bears N. $0^{\circ}13'$ W., 1.06 chs. dist., hereinbefore described.

Land, broken and mountainous.
 Soil, rocky.
 Timber, scattered juniper.
 Undergrowth, shadscale.

Point for the E. $\frac{1}{4}$ sec. cor. of sec. 28 at midpoint bet. the closing cor. of secs. 21 and 28 at the closing cor. of secs. 28 and 33.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., on solid rock, and in a mound of stone, $3\frac{1}{2}$ ft. base to top, with brass cap mkd.

T19S R18W
 $\frac{1}{4}$
 S28 |
 1963

From which, the W. $\frac{1}{4}$ sec. cor. of sec. 27, bears N. $0^{\circ}10'$ W., 0.94 chs. dist., hereinbefore described.

From the cor. of secs. 20, 21, 28 and 29.

S. $89^{\circ}54'$ W., bet. secs. 20 and 29.

Over mountainous land through scattered juniper timber with shadscale undergrowth. Asc. 180 ft. over SE. slope.

- 17.00 Ridge, bears NE. and SW., thence by triangulation, desc. about 440 ft. over broken NW. slope.
- 22.50 Draw, drains NW., continue descent over NW. slope.
- 40.08 Point for the $\frac{1}{4}$ sec. cor. of secs. 20 and 29. End triangulation.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 6 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T19S R18W
 $\frac{1}{4}$ $\frac{S20}{S29}$
 1963

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

	Desc. 360 ft. over broken NW. slope.
58.95	Base of descent, asc. 10 ft. over gentle SE. slope.
66.15	Spur, slopes S., desc. 170 ft. over NW. slope.
75.95	Wash, 25 lks. wide, 2 ft. deep, drains NW., asc. 20 ft. over NE. slope.
80.16	The cor. of secs. 19, 20, 29 and 30, hereinbefore described. Land, mountainous, broken. Soil, rocky. Timber, scattered juniper. Undergrowth, shadscale.
	From the cor. of secs. 20, 21, 28 and 29. N. 0°06' W., bet. secs. 20 and 21. Over broken mountainous land through scattered juniper timber with shadscale undergrowth. Asc. 15 ft. over SE. slope.
0.80	Spur, slopes E., asc. 50 ft. along E. slope.
15.60	Ridge, bears NE. and SW.; spur, slopes NW.; desc. 510 ft. over steep NE. slope.
36.10	Wash, 10 lks. wide, 3 ft. deep, drains NW., desc. 130 ft. over NW. slope.
40.54	Point for the $\frac{1}{4}$ sec. cor. of secs. 20 and 21. Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. T19S R18W $\frac{1}{4}$ S20 S21 1963 raise a mound of stone, 3 ft. base, $2\frac{1}{2}$ ft. high, W. of cor. Desc. 45 ft. over NW. slope.
51.85	Wash, 20 lks. wide, 2 ft. deep, drains SW., asc. 75 ft. over SE. slope.
57.55	Spur, slopes W., desc. 90 ft. over NW. slope.
65.40	Spur, slopes NW., desc. 155 ft. over NE. slope.
80.54	The cor. of secs. 16, 17, 20 and 21, hereinbefore described. Land, mountainous, broken. Soil, rocky. Timber, scattered juniper. Undergrowth, shadscale.
	From the cor. of secs. 29, 30, 31 and 32, monumented with a $2\frac{1}{2}$ in. iron post, set, mkd. and witnessed as described in the official record of the 1959 resurvey. S. 89°44' W., bet. secs. 30 and 31.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

Over mountainous land through shadscale undergrowth.
Desc. 60 ft. over W. slope.

2.95 Wash, 20 lks. wide, 3 ft. deep, drains SW., from NE.,
desc. 35 ft. over W. slope.

12.20 Same wash, drains NW., desc. 80 ft. over W. slope.

29.50 Wash, 15 lks. wide, 1 ft. deep, drains NW., asc. 60 ft.
over NE. slope.

38.35 Spur, slopes NW., desc. 15 ft. over SW. slope.

40.00 Point for the $\frac{1}{4}$ sec. cor. of secs. 30 and 31.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins.
in the ground to bedrock, and in a mound of stone, $3\frac{1}{2}$
ft. base to top, with brass cap mkd.

T19S R18W

$\frac{1}{4}$ $\frac{S30}{S31}$
1963

Desc. 90 ft. over SW. slope.

54.20 Bottom of small valley, bears NW. and SE., asc. 80 ft.
over E. slope.

62.75 Ridge, bears N. and S., desc. 140 ft. over W. slope.

78.35 Wash, 30 lks. wide, 1 ft. deep, drains N., asc. 10 ft.
over E. slope.

79.34 The cor. of secs. 25, 30, 31 and 36, on the W. bdy. of
the Tp., monumented with a $2\frac{1}{2}$ in. iron post, set, mkd.
and witnessed as described in the official record of
the 1956 resurvey.

Land, mountainous.

Soil, rocky.

Timber, none.

Undergrowth, shadscale.

From the cor. of secs. 29, 30, 31 and 32.

N. $0^{\circ}05'$ E., bet. secs. 29 and 30.

Over mountainous land through shadscale undergrowth.
Desc. 20 ft. over NW. slope.

0.95 Wash, 15 lks. wide, 3 ft. deep, drains W., asc. 165 ft.
over S. slope.

11.30 Spur, slopes W., desc. 55 ft. over NW. slope.

16.35 Wash, 10 lks. wide, 2 ft. deep, drains SW., asc. 180 ft.
over SE. slope.

28.70 Spur, slopes W., desc. 215 ft. over NW. slope.

40.16 Point for the $\frac{1}{4}$ sec. cor. of secs. 29 and 30.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

Completion Survey of the Subdivision, T. 19 S., R. 18 W.

CHAINS

T19S R18W

 $\frac{1}{2}$
 S30|S29
 1963

- raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
- 40.75 Wash, 20 lks. wide, 3 ft. deep, drains W., asc. 10 ft. over S. slope.
- 44.75 Small spur, slopes W., desc. 50 ft. over N. slope.
- 49.10 Wash, 20 lks. wide, 1 ft. deep, drains W., asc. 20 ft. over SW. slope.
- 52.75 Small spur, slopes W., desc. 20 ft. over NW. slope.
- 58.95 Wash, 30 lks. wide, 2 ft. deep, drains SW., asc. 40 ft. over SE. slope.
- 62.85 Spur, slopes SW., desc. 15 ft. over NW. slope.
- 65.75 Wash, 30 lks. wide, 2 ft. deep, drains SW., asc. 70 ft. over S. slope.
- 72.00 Spur, slopes SW., desc. 70 ft. over NW. slope.
- 80.32 The cor. of secs. 19, 20, 29 and 30, hereinbefore described.

Land, mountainous.
 Soil, rocky.
 Timber, none.
 Undergrowth, shadscale.

General Description

Township 19 South, Range 18 West is located about 10 miles northeast of Garrison, Utah, in the Buckskin Hills of the Conger Range of mountains. It is mostly mountainous, broken desert hills covered with scattered juniper timber with shadscale undergrowth. The northwest portion is rolling desert bench land with no timber. The soil in the mountains is rocky, shallow sandy clay, and in the bench land is deep sandy clay. The area is drained in a northwesterly direction by numerous draws and washes. There are numerous unimproved roads throughout the northwestern portion of the township. No water was noted in the township. The elevation varies from 5,000 ft. in the northwest corner to 6,500 ft. above sea level in the mountains. There are no habitations in the township.

CERTIFICATE OF SURVEY

I, **Craig P. Sylvester**, HEREBY CERTIFY upon honor that,
 in pursuance of special instructions bearing date of the 21st day of **March**, 19 **62**,
 I have dependently resurveyed a portion of the subdivisional lines and
 surveyed the completion of the subdivision of Township 19 South, Range 18 W

of the **Salt Lake** Meridian, in the State of **Utah**, which
 are represented in the foregoing field notes as having been executed by me and under my direction;
 and that said survey has been made in strict conformity with said special instructions, the Manual
 of Instructions for the Survey of the Public Lands of the United States, and in specific manner
 described in the foregoing field notes.

February 19, 1965

(Date)

Craig P. Sylvester
 (Cadastral Surveyor)

 (Date)

 (Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date **MAR 3 1965**

BUREAU OF LAND MANAGEMENT,
 Washington, D. C.

The foregoing field notes of the dependent resurvey of a portion of the subdivision
 lines and the survey of the completion of the subdivision of Township 19 So
 Range 18 West

executed by **Craig P. Sylvester**, Cadastral Surveyor,
 having been critically examined and found correct, are hereby approved.

JUN 21 1965

(Date)

E. E. Remington
 (Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

~~I CERTIFY That the foregoing transcript of the field notes of the above described surveys in~~
~~, is a true copy of the original field notes.~~

~~_____
 (Date)~~

~~_____
 (Chief, Division of Engineering)~~

Blank

Page

Blank Page

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

435

FIELD NOTES

OF THE
DEPENDENT RESURVEY

OF THE
UTAH-NEVADA STATE BOUNDARY

BETWEEN MILE POSTS 142 AND 147

(WEST BOUNDARY)

THE EAST BOUNDARY

AND THE

SURVEY

OF THE SUBDIVISIONAL LINES

OF

TOWNSHIP 18 SOUTH, RANGE 20 WEST

Of the SALT LAKE Meridian,

In the State of UTAH

EXECUTED BY

Gerald W. Hochstrasser

Survey Technician

Under the supervision of Craig P. Sylvester

Cadastral Surveyor

Under special instructions dated March 21, 19 62, which provided for the surveys
included under Group Number 451, approved March 29, 1962,
and assignment instructions dated August 14, 19 62.

Survey commenced April 30, 19 63

Survey completed May 1, 19 63

430

DEPT. OF THE INTERIOR
BUR OF LAND MGMT

1965 JUL 19 AM 10 00

RECEIVED
STATE & LAND OFFICE
SALT LAKE CITY, UTAH

INDEX DIAGRAM

MP 141

Township 18 SOUTH, Range 20 WEST

				MP 142	4	1	9
6	5	4	3	2		15	
				MP 143	3	12	8
7	8	9	10	11		13	
				MP 144	3	15	8
14	17	16	15	14		13	
				MP 145	2	24	7
19	20	21	22	23		12	
				MP 146	1	26	6
30	29	28	27	26		10	
				MP 147		26	5
31	32	33	34	35			

UTAH-NEVADA STATE BOUNDARY

MP 148

Dependent Resurvey of the Utah-Nevada State Boundary
Between Mile Posts 142 and 147 (W. Bdy., T. 18 S., R. 20 W.)

CHAINS

The West boundary (Utah-Nevada state boundary), between mile posts 141 and 148 was surveyed by I. E. James in 1870, and dependently resurveyed between mile posts 147 and 148 by P. L. Inch in 1942 in connection with Nevada surveys. The East boundary was surveyed by A. J. Stewart, Jr. in 1882. The South boundary was surveyed by A. J. Stewart, Jr. in 1882 and dependently resurveyed by Andrew Nelson in 1956. The North boundary was surveyed by A. J. Stewart, Jr. in 1882, retraced in 1895 by R. E. L. Collier and dependently resurveyed concurrently by Craig P. Sylvester.

The following field notes are those of the dependent resurvey of the Utah-Nevada state boundary between mile posts 142 and 147 (West boundary), the East boundary and the survey of the subdivisional lines of Township 18 South, Range 20 West.

Before restoring the corners, the lines of the original survey were retraced and diligent search made for any evidence of the original corners or other calls of the original field note record.

The rules of proportionate measurement were applied to ascertain the position of the lost corners, but not until exhausting every reasonable possibility of finding direct evidence for the control of each particular corner.

Corners on east-west lines were set on the true latitudinal curve. Lines connecting previously established corners were run by random and true method, but for simplification of the record the random lines are omitted from the field notes.

The direction of the lines of this survey and resurvey were determined by reference to true meridians established on line by elongation observations on Polaris and altitude observations on the sun. The lines were carried forward by sustained angulation.

The geographic position for the southeast corner of the township is at latitude $39^{\circ}11'30.7''$ N. and longitude $114^{\circ}02'13.7''$ W., as computed from section line ties to U. S. C. & G. S. triangulation station "Wildhorse", located N. $73^{\circ}22'$ E., 11.88 chs. distance from the $\frac{1}{4}$ section corner of sections 2 and 35, Townships 19 and 20 South, Range 18 West.

The mean magnetic declination was found to be $16^{\circ}30'$ E.

Dependent Resurvey of the Utah-Nevada State Boundary
Between Mile Posts 142 and 147
(West Boundary, Township 18 South, Range 20 West)

Reestablishment of the Survey Executed by
I. E. James in 1870.

Beginning at mile post 147, monumented with a 3 in. iron post mkd.

MP 147
NEV|UTAH
1942

N. $0^{\circ}04'$ E., along the 146th. mile.

Over nearly level desert land through scattered shrubs and undergrowth.

Dependent Resurvey of the Utah-Nevada State Boundary
Between Mile Posts 142 and 147 (W. Bdy., T. 18 S., R. 20 W.)

CHAINS	<p>Soil, gravelly. Timber, none. Undergrowth, scattered shadscale.</p>
	<p>N. 0°02' E., along the 144th. mile.</p> <p>Over gently rolling desert land through scattered shad- scale undergrowth.</p>
3.10	Wash, 1.00 ch. wide, 6 ft. deep, drains E.
10.55	Wash, 1.50 chs. wide, 8 ft. deep, drains E.
25.60	Wash, 1.50 chs. wide, 6 ft. deep, drains E.
27.85	Road, unimproved, bears E. and W.
40.35	Wash, 30 lks. wide, 5 ft. deep, drains E.
73.60	Wash, 25 lks. wide, 4 ft. deep, drains E.
80.05	<p>Mile post 144, monumented with a limestone, 12x8x4 ins., mkd. "B", as described in the official record.</p> <p>At the mile point</p> <p>Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.</p> <p style="text-align: center;">144 M NEV UTAH 1963</p> <p>Bury original stone cor. alongside iron post, and set a steel fence post alongside.</p> <p>Land, gently rolling desert. Soil, gravelly. Timber, none. Undergrowth, scattered shadscale.</p>
	<p>N. 0°01' E., along the 143rd. mile.</p> <p>Over gently rolling desert land through scattered shad- scale undergrowth.</p>
8.50	Road, unimproved, bears E. and W.
17.65	Wash, 20 lks. wide, 4 ft. deep, drains E.
25.35	Wash, 1.30 chs. wide, 10 ft. deep, drains E.
34.65	Wash, 40 lks. wide, 2 ft. deep, drains E.
38.45	Wash, 15 lks. wide, 3 ft. deep, drains E.
48.15	Wash, 30 lks. wide, 2 ft. deep, drains E.
54.20	Wash, 30 lks. wide, 8 ft. deep, drains E.
63.90	Road, unimproved, bears NE. and SW.
69.50	Wash, 2.00 chs. wide, 10 ft. deep, drains E.
74.30	Wash, 2.50 chs. wide, 10 ft. deep, drains SW.
78.80	Wash, 80 lks. wide, 8 ft. deep, drains SW.

Dependent Resurvey of the Utah-Nevada State Boundary

Between Mile Posts 142 and 147 (W. Bdy., T. 18 S., R. 20 W.)

CHAINS

79.89

Mile post 143, monumented with a limestone, 14x10x1 ins. dimly mkd. "B", as described in the official record.

At the mile point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

143 M
NEV|UTAH
1963

Bury original stone cor. alongside iron post, and set a steel fence post alongside.

Land, gently rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, scattered shadscale.

N. 0°10' E., along the 142nd. mile.

Over gently rolling desert land through scattered shad-scale undergrowth.

2.80

Road, unimproved, bears NE. and SW.

26.80

Wash, 30 lks. wide, 6 ft. deep, drains E.

31.10

Wash, 30 lks. wide, 4 ft. deep, drains E.

35.30

Road, unimproved, bears E. and W.

40.70

Road, unimproved, bears E. and W.

41.00

Wash, 15 lks. wide, 2 ft. deep, drains NE.

66.00

Wash, 45 lks. wide, 10 ft. deep, drains E.

67.15

Wash, 50 lks. wide, 6 ft. deep, drains E.

79.58

Mile post 142, monumented with a 2½ in. iron post, set, 24 ins. in the ground, with a mound of stone, 3 ft. base, 2 ft. high, N. of cor., with brass cap mkd.

142 M
NEV|UTAH
1962

From this mile post, the closing cor. of Tps. 17 and 18 S., R. 20 W., bears N. 0°07' E., 11.74 chs. dist., monumented with a 2½ in. iron post, with brass cap mkd.

T17S
R20W
NEV|S36
S1 CC
T18S
R20W
1962

Land, gently rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, scattered shadscale.

Dependent Resurvey of the East Boundary, T. 18 S., R. 20 W.

CHAINS

Reestablishment of the Survey Executed
by A. J. Stewart, Jr. in 1882.

From the cor. of Tps. 18 and 19 S., Rs. 19 and 20 W.,
monumented with a 3 in. iron post. mkd.

T18S
R20W R19W
S36 | S31
S1 | S6
T19S
1956

N. 0°09' W., bet. secs. 31 and 36.

Over gently rolling desert land through shadscale and
greasewood undergrowth.

11.00 Wash, 20 lks. wide, 1 ft. deep, drains ESE.

31.00 Wash, 10 lks. wide, 1 ft. deep, drains E.

40.09 The $\frac{1}{4}$ sec. cor. of secs. 31 and 36, monumented with a
flintstone, 18x14x10 ins., set, mkd. and witnessed as
described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T18S
R20W R19W
 $\frac{1}{4}$
S36 | S31
1963

Bury original stone cor. alongside iron post, and raise
a mound of stone, 3 ft. base, 2 ft. high, E. of cor.

N. 0°04' W., beginning new measurement.

8.00 Wash, 15 lks. wide, 1 ft. deep, drains E.

25.20 Wash, 20 lks. wide, 3 ft. deep, drains ESE.

27.60 Wash, 25 lks. wide, 3 ft. deep, drains ESE.

30.70 Wash, 20 lks. wide, 2 ft. deep, drains ESE.

40.07 The cor. of secs. 25, 30, 31 and 36, monumented with a
flintstone, 18x9x8 ins., set, mkd. and witnessed as
described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T18S
R20W R19W
S25 | S30
S36 | S31
1963

Bury original stone cor. alongside iron post, and raise

Dependent Resurvey of the East Boundary, T. 18 S., R. 20 W.

CHAINS

a mound of stone, 3 ft. base, 2 ft. high, E. of cor.

Land, gently rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, shadscale and greasewood.

N. 0°06' W., bet. secs. 25 and 30.

Over gently rolling desert land through shadscale and greasewood.

8.00 Wash, 25 lks. wide, 3 ft. deep, drains E.

14.40 Wash, 30 lks. wide, 3 ft. deep, drains ENE.

25.70 Road, unimproved, bears ENE. and WSW.

26.00 Irrigation ditch, drains ENE.

28.55 Irrigation ditch, drains ENE.

28.75 Drift fence, bears N. 61°35' E. and S. 61°35' W.

37.30 Wash, 20 lks. wide, 2 ft. deep, drains ENE.

40.08 The $\frac{1}{4}$ sec. cor. of secs. 25 and 30, monumented with a flintstone, 19x12x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

$\frac{1}{4}$
S25 | S30
1963

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

North, beginning new measurement.

10.20 Road, unimproved, bears NE. and SW.

12.40 Wash, 15 lks. wide, 3 ft. deep, drains E.

26.10 Wash, 15 lks. wide, 2 ft. deep, drains ESE.

40.08 The cor. of secs. 19, 24, 25 and 30, monumented with a flintstone, 18x9x8 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

S24 | S19
S25 | S30
1963

Dependent Resurvey of the East Boundary, T. 18 S., R. 20 W.

CHAINS

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, shadscale and greasewood.

N. 0°11' W., bet. secs. 19 and 24.

Over gently rolling desert land through shadscale and greasewood undergrowth.

6.60 Wash, 25 lks. wide, 4 ft. deep, drains E.

17.80 Wash, 50 lks. wide, 2 ft. deep, drains ESE.

36.80 Wash, 10 lks. wide, 3 ft. deep, drains ESE.

40.10 The $\frac{1}{4}$ sec. cor. of secs. 19 and 24, monumented with a flintstone, 17x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

$\frac{1}{4}$
S24 | S19
1963

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

N. 0°09' W., beginning new measurement.

8.60 Wash, 35 lks. wide, 3 ft. deep, drains E.

20.80 Wash, 30 lks. wide, 10 ft. deep, drains ESE.

36.20 Road, unimproved, bears N. 70° W. and S. 70° E.

40.02 The cor. of secs. 13, 18, 19 and 24, monumented with a flintstone, 20x11x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2 $\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

S13 | S18
S24 | S19
1963

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, shadscale and greasewood.

Dependent Resurvey of the East Boundary, T. 18 S., R. 20 W.

CHAINS

N. 0°04' W., bet. secs. 13 and 18.

Over gently rolling desert land through shadscale and greasewood undergrowth.

1.45 Wash, 20 lks. wide, 5 ft. deep, drains ESE.

5.00 Wash, 40 lks. wide, 3 ft. deep, drains ESE.

18.10 Wash, 10 lks. wide, 6 ft. deep, drains ESE.

39.98 The $\frac{1}{4}$ sec. cor. of secs. 13 and 18, monumented with a flintstone, 17x9x7 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

$\frac{1}{4}$
S13 | S18
1963

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

N. 0°05' W., beginning new measurement.

2.40 Wash, 15 lks. wide, 4 ft. deep, drains E.

6.30 Road, unimproved, bears WNW. and ESE.

18.00 Wash, 25 lks. wide, 3 ft. deep, drains E.

39.80 Wash, 20 lks. wide, 3 ft. deep, drains ENE.

40.15 The cor. of secs. 7, 12, 13 and 18, monumented with a flintstone, 18x14x12 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

S12 | S7
S13 | S18
1963

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, shadscale and greasewood.

N. 0°02' W., bet. secs. 7 and 12.

Over gently rolling desert land through shadscale and greasewood undergrowth.

7.20 Wash, 10 lks. wide, 6 ft. deep, drains E.

Dependent Resurvey of the East Boundary, T. 18 S., R. 20 W.

CHAINS

15.80 Road, unimproved, bears WSW. and ENE.

18.30 Wash, 10 lks. wide, 3 ft. deep, drains ENE.

40.11 The $\frac{1}{4}$ sec. cor. of secs. 7 and 12, monumented with a flintstone, 16x8x6 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

$\frac{1}{2}$
S12 | S7
1963

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

N. $0^{\circ}04'$ E., beginning new measurement.

2.80 Wash, 40 lks. wide, 4 ft. deep, drains E.

17.90 Wash, 20 lks. wide, 6 ft. deep, drains E.

20.30 Road, unimproved, bears ESE. and WNW.

20.90 Wash, 10 lks. wide, 2 ft. deep, drains E.

29.20 Wash, 15 lks. wide, 4 ft. deep, drains ESE.

39.00 Wash, 15 lks. wide, 2 ft. deep, drains E.

40.13 The cor. of secs. 1, 6, 7 and 12, monumented with a limestone, 26x12x10 ins., set, mkd. and witnessed as described in the official record.

At the cor. point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W R19W

S1 | S6
S12 | S7
1963

Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Land, gently rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, shadscale and greasewood.

N. $0^{\circ}04'$ W., bet. secs. 1 and 6.

Over gently rolling desert land through shadscale and greasewood undergrowth.

30.30 Wash, 50 lks. wide, 3 ft. deep, drains E.

34.90 Wash, 40 lks. wide, 5 ft. deep, drains E.

Dependent Resurvey of the East Boundary, T. 18 S., R. 20 W.

CHAINS

37.80	Road, unimproved, bears E. and W.
40.10	<p>The $\frac{1}{2}$ sec. cor. of secs. 1 and 6, monumented with a limestone, 17x9x6 ins., set, mkd. and witnessed as described in the official record.</p> <p>At the cor. point</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T18S R20W R19W $\frac{1}{2}$ S1 S6 1963</p> <p>Bury original stone cor. alongside iron post, and raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 0°01' E., beginning new measurement.</p>
25.40	Wash, 30 lks. wide, 3 ft. deep, drains ESE.
34.90	Wash, 20 lks. wide, 2 ft. deep, drains ESE.
40.23	<p>The cor. of Tps. 17 and 18 S., Rs. 19 and 20 W. monumented with a $2\frac{1}{2}$ in. iron post mkd.</p> <p style="text-align: center;">T17S R20W R19W <u>S36 S31</u> S1 S6 T18S 1962</p> <p>Land, gently rolling desert. Soil, gravelly. Timber, none. Undergrowth, shadscale and greasewood.</p>
Survey of the Subdivision, Township 18 South, Range 20 West.	
	<p>From the cor. of secs. 25, 30, 31 and 36, on the E. bdy. of the Tp.</p> <p>West, bet. secs. 25 and 36.</p> <p>Over gently rolling desert land through shadscale and greasewood undergrowth. Asc. 85 ft. over gentle E. slope.</p>
20.00	Wash, 90 lks. wide, 5 ft. deep, drains ENE.
40.00	<p>Point for the $\frac{1}{2}$ sec. cor. of secs. 25 and 36.</p> <p>Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 8 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.</p> <p style="text-align: center;">T18S R20W $\frac{1}{2}$ <u>S25</u> S36 1963</p> <p>Cor. falls in wash, 40 lks. wide, 3 ft. deep, drains ENE.</p>

Survey of the Subdivision, Township 18 South, Range 20 West

CHAINS

45.84

Intersect the Utah-Nevada state boundary. Point for the closing cor. of secs. 25 and 36.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 15 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T18S
R20W
NEV $\frac{1}{2}$ S25 C
S36 C
1963

From this cor., mile post 147, on the Utah-Nevada state boundary, bears S. $0^{\circ}04'$ W., 10.44 chs. dist., hereinbefore described.

Land, gently rolling desert.
Soil, gravelly.
Timber, none.
Undergrowth, shadscale and greasewood.

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 36, on the Utah-Nevada state boundary, at midpoint between closing cors.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W
 $\frac{1}{2}$
NEV S36
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, E. of cor.

From this cor., mile post 147, on the Utah-Nevada state boundary, bears N. $0^{\circ}06'$ E., 29.59 chs. dist., hereinbefore described.

Point for the S. $\frac{1}{4}$ sec. cor. of sec. 36, only on the S. bdy. of the Tp., at a point 40.00 chs. westing from the southeast cor. of the Tp.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S R20W
 $\frac{1}{2}$ S36
T19S
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

From this cor., the $\frac{1}{4}$ sec. cor. of sec. 1, T. 19 S., R. 20 W., bears N. $89^{\circ}50'$ W., 0.57 chs. dist., monumented with a 1 in. iron post mkd.

$\frac{1}{2}$ S1
1956

From the cor. of secs. 19, 24, 25 and 30, on the E. bdy.

Survey of the Subdivision, Township 18 South, Range 20 West

CHAINS

of the Tp.

West, bet. secs. 13 and 24.

Over rolling desert land through scattered shadscale and greasewood undergrowth. Asc. 190 ft. over E. slope.

8.90 Road, unimproved, bears irregularly E. and WNW.

23.60 Wash, 30 lks. wide, 2 ft. deep, drains ESE.

40.00 Point for the $\frac{1}{4}$ sec. cor. of secs. 13 and 24.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T18S R20W

$\frac{1}{4}$ $\frac{S13}{S24}$

1963

45.32 Intersect the Utah-Nevada state boundary. Point for the closing cor. of secs. 13 and 24.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 15 ins. in the ground to bedrock, and in a mound of stone, 4 ft. base to top, with brass cap mkd.

T18S

R20W

NEV $\frac{S13}{S24}$ C

1963

From this cor., mile post 145, on the Utah-Nevada state boundary, bears S. $0^{\circ}02'$ W., 10.57 chs. dist., hereinbefore described.

Land, rolling desert.

Soil, gravelly.

Timber, none.

Undergrowth, shadscale and greasewood.

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 24, on the Utah-Nevada state boundary, at midpoint between closing cors.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S

R20W

NEV $\frac{1}{4}$ S24

1963

Raise a mound of stone, 3 ft. base, $1\frac{1}{2}$ ft. high, E. of cor.

From this cor., mile post 145, on the Utah-Nevada state boundary, bears N. $0^{\circ}04'$ E., 29.50 chs. dist., hereinbefore described.

From the cor. of secs. 7, 12, 13 and 18, on the E. bdy. of the Tp.

West, bet. secs. 12 and 13.

Survey of the Subdivision, Township 18 South, Range 20 West

CHAINS

Over rolling, broken bench land through shadscale and greasewood undergrowth. Asc. 190 ft. over rolling and broken E. slope.

16.70 Wash, 1.20 chs. wide, 6 ft. deep, drains ENE.

40.00 Point for the $\frac{1}{4}$ sec. cor. of secs. 12 and 13.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T18S R20W

$\frac{1}{4}$ S12

S13

1963

41.50 Road, unimproved, bears NE. and SW.

42.10 Ditch, drains NE.

45.14 Intersect the Utah-Nevada state boundary. Point for the closing cor. of secs. 12 and 13.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T18S

R20W

NEV S12 C

S13 C

1963

Raise a mound of stone, 2 ft. base, $1\frac{1}{2}$ ft. high, E. of cor.

From this cor., mile post 144, on the Utah-Nevada state boundary, bears S. $0^{\circ}01'$ W., 10.67 chs. dist., hereinbefore described.

Land, rolling and broken bench land.

Soil, rocky gravel.

Timber, none.

Undergrowth, shadscale and greasewood.

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 13, on the Utah-Nevada state boundary, at midpoint between closing cors.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S

R20W

$\frac{1}{4}$

NEV S13

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, E. of cor.

From this cor., mile post 144, on the Utah-Nevada state boundary, bears N. $0^{\circ}02'$ E., 29.40 chs. dist., hereinbefore described.

From the cor. of secs. 1, 6, 7 and 12, on the E. bdy. of the Tp.

Survey of the Subdivision, Township 18 South, Range 20 West

CHAINS

West, bet. secs. 1 and 12.

Over broken bench land through scattered shadscale and greasewood undergrowth. Asc. 300 ft. over E. slope.

30.30 Road, unimproved, bears NW. and S.

40.00 Point for the $\frac{1}{4}$ sec. cor. of secs. 1 and 12.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T18S R20W

$\frac{1}{4}$ $\frac{S1}{S12}$
1963

Raise a mound of stone, 4 ft. base, 2 ft. high, N. of cor.

45.09 Intersect the Utah-Nevada state boundary. Point for the closing cor. of secs. 1 and 12.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T18S
R20W
NEV $\frac{S1}{S12}$ C
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, E. of cor.

From this cor., mile post 143, on the Utah-Nevada state boundary, bears S. $0^{\circ}10'$ W., 11.02 chs. dist., hereinbefore described.

Land, broken bench land.

Soil, gravelly.

Timber, none.

Undergrowth, scattered shadscale and greasewood.

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 12, on the Utah-Nevada state boundary, at midpoint between closing cors.

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

T18S
R20W
 $\frac{1}{4}$
NEV $\frac{S1}{S12}$
1963

Raise a mound of stone, 3 ft. base, 2 ft. high, E. of cor.

From this cor., mile post 143, on the Utah-Nevada state boundary, bears N. $0^{\circ}01'$ E., 29.10 chs. dist., hereinbefore described.

Point for the W. $\frac{1}{4}$ sec. cor. of sec. 1, on the Utah-

Survey of the Subdivision, Township 18 South, Range 20 West

CHAINS

Nevada state boundary, at 40.00 chs. N. 0°10' E., from the closing cor. of secs. 6 and 12.

Set an iron post, 30 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone to top, with brass cap mkd.

T18S

R20W

¼

NEV S1

1963

Raise a mound of stone, 3 ft. base, 2 ft. high, E. of cor.

From this cor., mile post 142, on the Utah-Nevada state boundary, bears N. 0°10' E., 28.56 chs. dist., hereinbefore described.

General Description

Township 18 South, Range 20 West, is located along the Utah-Nevada state line about 20 miles north of Garrison, Utah. It is gently rolling to rolling, broken bench land covered with shadscale and greasewood undergrowth with no timber. The area is drained in an easterly direction by numerous washes. There are several unimproved roads in the township. The elevation is about 5,500 ft. above sea level. The soil is gravelly. There is a small creek which flows easterly through section 25. No other water or permanent habitations were noted in the township.

FIELD ASSISTANTS

GPO 834685

CERTIFICATE OF SURVEY

I, **Craig P. Sylvester**, **HEREBY CERTIFY** upon honor that,
in pursuance of special instructions bearing date of the **21st** day of **March**, 19**62**,
I have supervised the dependent resurvey of the Utah-Nevada state boundary
between mile posts 142 and 147 (West boundary), the East boundary and the
survey of the subdivisional lines of Township 18 South, Range 20 West

of the **Salt Lake** Meridian, in the State of **Utah**, which
are represented in the foregoing field notes as having been executed by me and under my direction;
and that said survey has been made in strict conformity with said special instructions, the Manual
of Instructions for the Survey of the Public Lands of the United States, and in specific manner
described in the foregoing field notes.

February 1, 1965

(Date)

Craig P. Sylvester
(Cadastral Surveyor)

(Date)

(Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL

Date **MAR 3 1965**

BUREAU OF LAND MANAGEMENT,
Washington, D. C.

The foregoing field notes of the dependent resurvey of the Utah-Nevada state boundary
between mile posts 142 and 147 (West boundary), the East boundary and the
survey of the subdivisional lines of Township 18 South, Range 20 West

executed by **Gerald W. Hochstrasser**, Survey Technician under the supervision of
Craig P. Sylvester, Cadastral Surveyor
having been critically examined and found correct, are hereby approved.

JUN 21 1965

(Date)

E. E. Lemington
(Chief, Division of Engineering)

CERTIFICATE OF TRANSCRIPT

~~I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in~~
~~, is a true copy of the original field notes.~~

~~_____
(Date)~~

~~_____
(Chief, Division of Engineering)~~